


WAAS CH 78022 W05B	APP CRS 052°	Rwy Ldg 11004 TDZE 744 Apt Elev 744
--	------------------------	--

RNAV (GPS) RWY 5L

RICKENBACKER INTL (LCK)

RNP APCH - GPS.		MALSR	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
⚠ Circling NA northwest of Rwy 5L-23R. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. Baro-VNAV NA when using John Glenn Columbus Intl altimeter setting. When local altimeter setting not received, use John Glenn Columbus Intl altimeter setting: increase LPV DA to 979 feet; increase LNAV/VNAV DA to 1042 feet; increase all MDAs 40 feet and Circling visibility Cat D ¼ SM.			
ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8

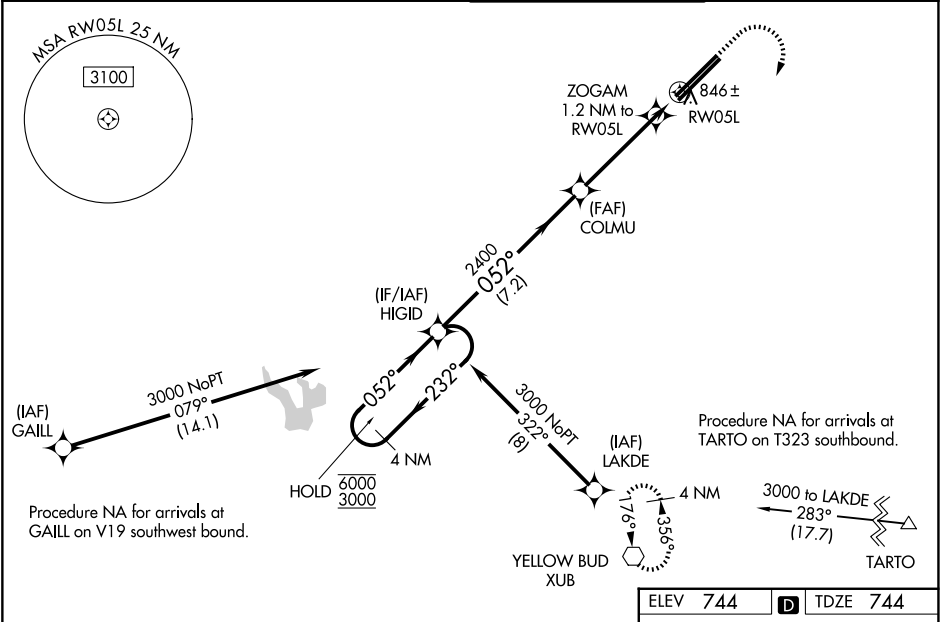

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).		1500	3000	XUB
4 NM Holding Pattern				
HIGID				
6000 ← 232°				
3000 → 052°				
GP 3.00° TCH 55				
COLMU 2400				
ZOGAM 1.2 NM to RWY 5L				
RWY 5L				
2400				
1200				
7.2 NM				
3.8 NM				
1.2 NM				
CATEGORY	A	B	C	D
LPV DA	944-1½		200 (200-½)	
LNAV/VNAV DA	1007-1½		263 (300-½)	
LNAV MDA	1100-½	356 (400-½)	1100-⅝	356 (400-⅝)
CIRCLING	1240-1	496 (500-1)	1280-1½ 536 (600-1½)	1400-2 656 (700-2)

TWZL/RCLS Rwy 5R

REIL Rwy 23R

HIRL Rwy 5L-23R and 5R-23L