

APP CRS
311°

Rwy Ldg
TDZE
Apt Elev

4507
322
332

RNAV (GPS) RWY 32

DAWSON MUNI (16J)

RNP APCH


▼

NA

Rwy 32 helicopter visibility reduction below $\frac{3}{4}$ SM NA.
Use Albany altimeter setting. When Albany altimeter settings not received, use Americus altimeter setting and increase all MDAs 20 feet.

MISSED APPROACH: Climbing left turn to 2900 direct PZD VOR/DME and hold, continue climb-in-hold to 2900.

AWOS-3PT 118.8	ABY AWOS-3PT 133.05	JACKSONVILLE CENTER 125.75 363.075	UNICOM 123.05 (CTAF) 0
--------------------------	-------------------------------	--	----------------------------------

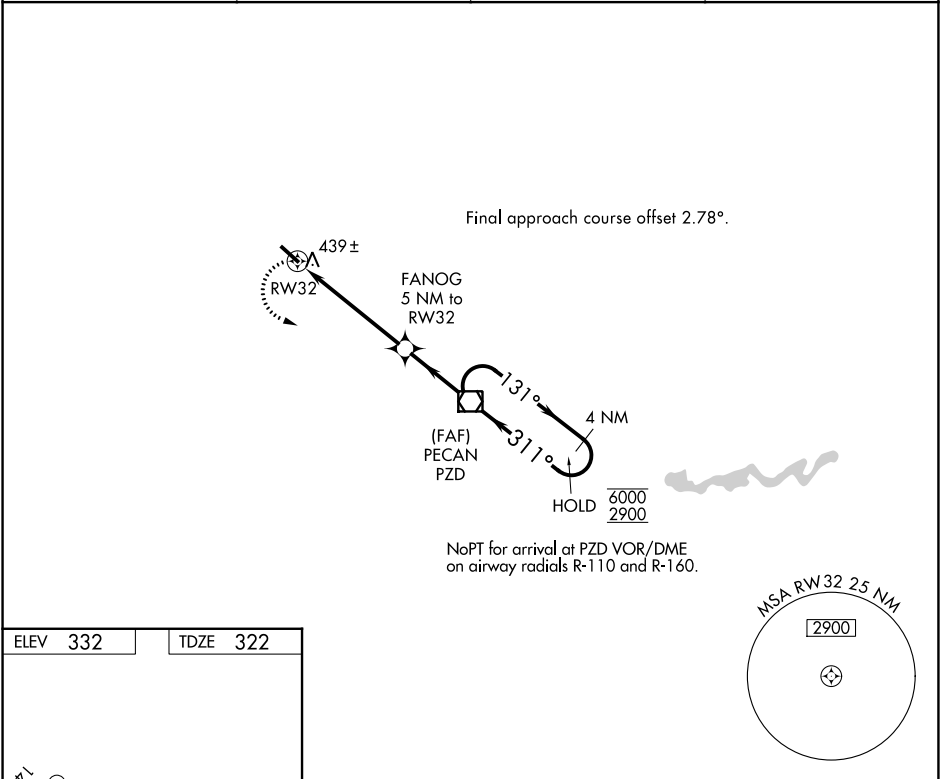

ELEV 332

TDZE 322

1

2

4507 X 75

1.0% UP

311°

311°

2900

PZD

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 48).

4 NM Holding Pattern

RW32

5 NM

311°

1920

3.04° TCH 40

FANOG 5 NM to RW32

311°

131°

6000 2900

CATEGORY	A	B	C	D
LNAV MDA	760-1	438 (500-1)	NA	
CIRCLING	960-1	628 (700-1)	NA	

MIRL Rwy 14-32 0