

APP CRS	Rwy Ldg	7569
055°	TDZE	708
	Apt Elev	727

RNAV (RNP) Z RWY 5


BUFFALO NIAGARA INTL (BUF)

⚠ For uncompensated Baro-VNAV systems, procedure NA below -18°C (0°F) or above 54°C (130°F). GPS required. For inoperative MALSR, increase RNP 0.10 all Cats visibility to 1¼. For inoperative MALSR, increase RNP 0.30 all Cats visibility to 1½.

MALSR

MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to TRAVA and hold.

D-ATIS 135.35	BUFFALO APP CON 126.15 263.125	BUFFALO TOWER 120.5 257.8	GND CON 133.2 257.8
-------------------------	--	-------------------------------------	-------------------------------

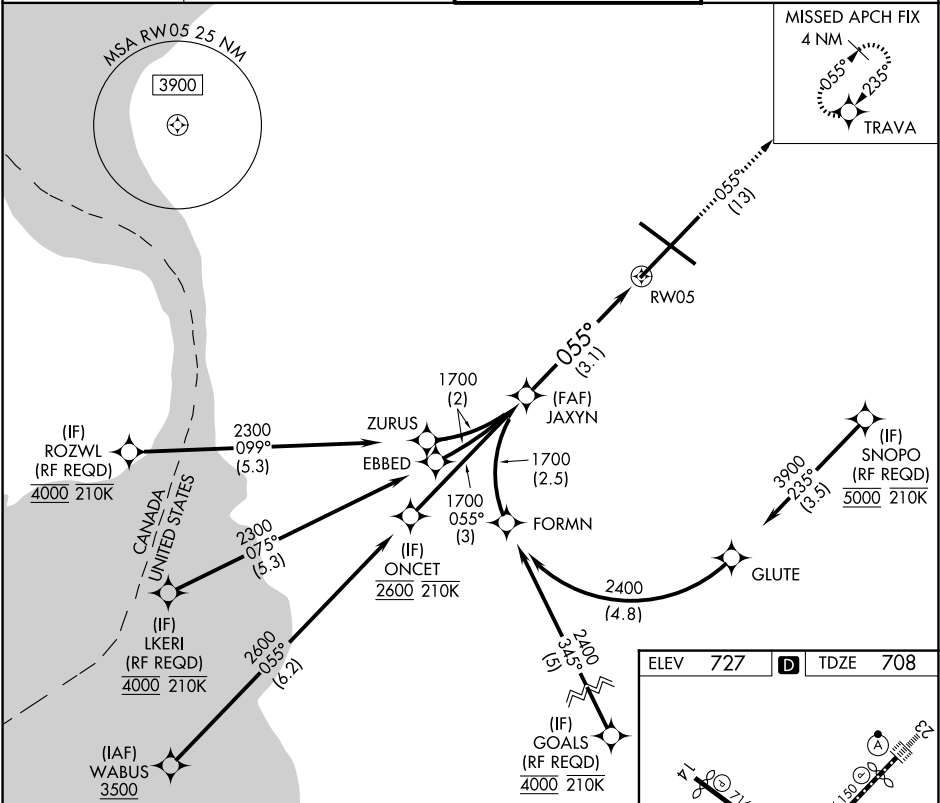

JAXYN See planview for multiple IF locations

1700

GP 3.00° TCH 46

055°

3.1 NM

RW05

3000

TRAVA

CATEGORY	A	B	C	D
RNP 0.10 DA	1065/45 357 (400-¾)			
RNP 0.30 DA	1159/60 451 (500-1¼)			

AUTHORIZATION REQUIRED

ELEV 727 **D** TDZE 708

REIL Rwy 14

TDZL/RCLS Rwy 5 and 23

HIRL Rwy 5-23 and 14-32

NE-2, 03 SEP 2026 to 01 OCT 2026

NE-2, 03 SEP 2026 to 01 OCT 2026