

TACAN RWY 13L

VORTAC CBM 115.2 Chan 99	APCH CRS 142°	Rwy Idg 8001 TDZE 194 Arpt Elev 218
--	-------------------------	--

[USAF]



COLUMBUS AFB (KCBM)

Missed approach requires use of RNAV or RADAR monitoring.


T When circling to Rwy 31R at night, operational VGSI required, remain on or above VGSI glidepath until threshold.

MISSED APPROACH: Climbing left turn to WOLOV and hold as published. Maintain 3000.


ATIS ★ 115.2 273.5	APP CON ★ 126.075 239.25 (N) 134.55 350.3 (SE) 135.6 32.275 (SW)	TOWER ★ 126.65 379.925	GND CON ★ 121.9 275.8
-----------------------	---	---------------------------	--------------------------

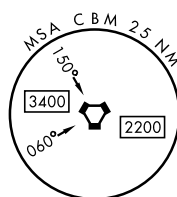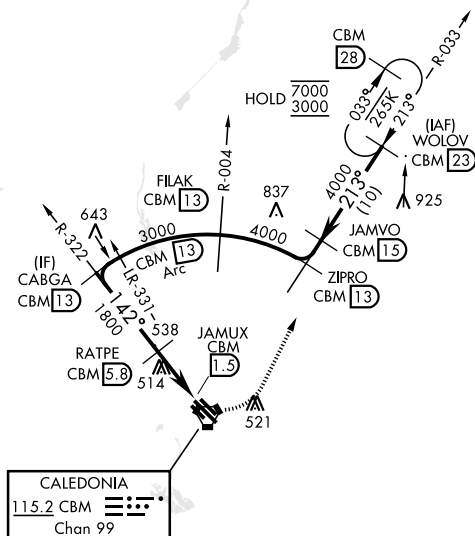

EMERG SAFE ALT 100 NM 3700

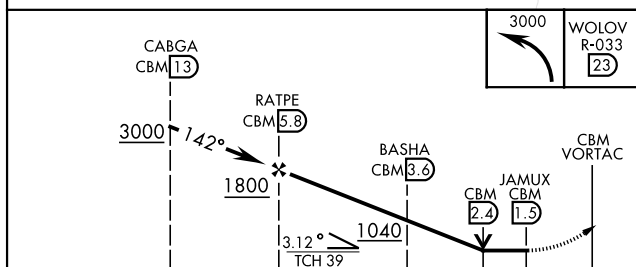

CATEGORY		A		B		C		D		E	
S-13L		660/55		466 (500-1)		660-13%		466		(500-13%)	
CIRCLING		700-1 482 (500-1)		720-1 502 (600-1)		740-1½ 522 (600-1½)		880-2 662 (700-2)		1240-3 1022 (1100-3)	

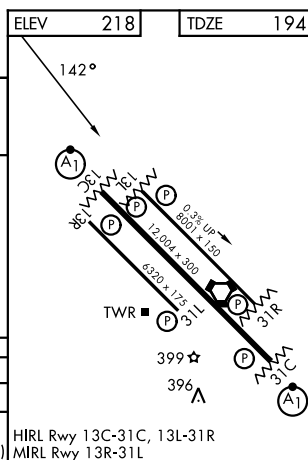

COLUMBUS, M|SS|SS|PP|

33° 39' N-88° 27' W

COLUMBUS AFB (KCBM)

Amdt 1 21APR22

TACAN RWY 13L

SC-4, 03 SEP 2026 to 01 OCT 2026

SC-4, 03 SEP 2026 to 01 OCT 2026