
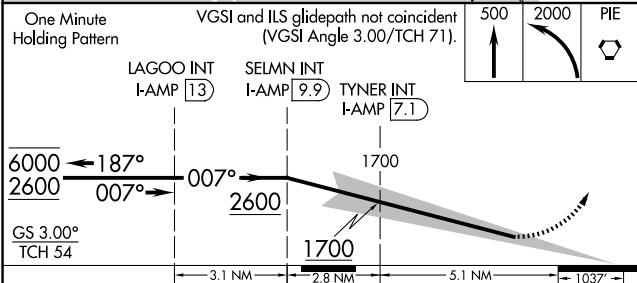


LOC/DME I-AMP	APP CRS	Rwy Ldg
108.9	007°	10800
Chan 26		TDZE 11
		Apt Elev 26

ILS RWY 1L (SA CAT I)
TAMPA INTL (TPA)

DME and RADAR required.	ALSIF-2	MISSED APPROACH: Climb to 500 then climbing left turn to 2000 direct PIE VORTAC and hold, continue climb-in-hold to 2000. (TACAN aircraft climb to 500 then climbing left turn to 2000 direct PIE VORTAC then on PIE VORTAC R-276 to LAFAL INT/PIE 8 DME and hold W, RT, 096° inbound).
Simultaneous approach authorized. Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH.		


D-ATIS 126.45	TAMPA APP CON 118.5 307.175	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4
-------------------------	---------------------------------------	-----------------------------------	-------------------------------

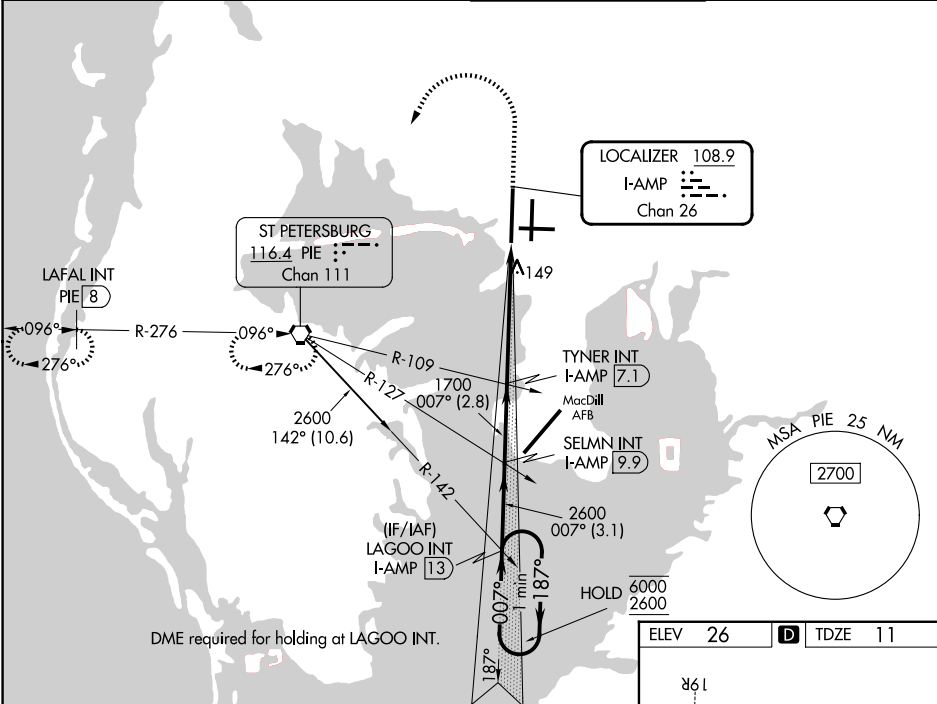

CATEGORY	A	B	C	D
S-ILS 1L	RA 155/14 150 DA 161			

SA CATEGORY I ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

ELEV 26	TDZE 11
---------	---------

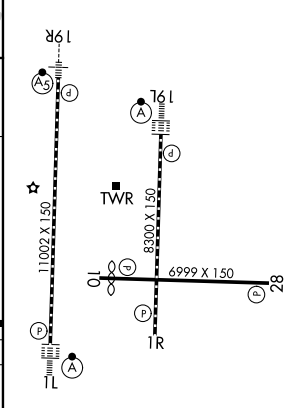

REIL Rwy 1R
HIRL Rwy 1L-19R, 1R-19L, and 10-28
TDZL/RCLS Rwy 1L and 19L