

NDB RWY 25

NDB/DME UTO 272 Chan 22(Y)	APCH CRS 256°	Rwy Idg TDZE 1161 Arpt Elev 1261
--	-------------------------	--

[USAF]

INDIAN MOUNTAIN LRRS (PAIM)

Night operations not authorized.	MISSED APPROACH: Climb to 5000, then climbing left turn to 6600 direct UTO NDB and hold. Continue climb climb-in-hold to 6600.
----------------------------------	--

ANCHORAGE CENTER APP CON 124.6 352.0	FAIRBANKS RDO 122.6	CTAF 126.2	AWOS-3
--	-------------------------------	----------------------	--------



CAUTION: Rwy located on a slope of a 3415' mountain with W end at the base of cliff, APPROACH ONLY FROM THE EAST.

Successful go-around improbable if initiated past MAP.

Uncontrolled Airspace below 700' AGL within 4 NM of Indian Mountain airport.

Visibility reduction by helicopters not authorized.

PAPI Beyond 8° right of RCL unusable.

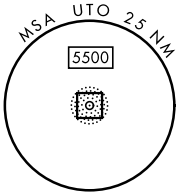
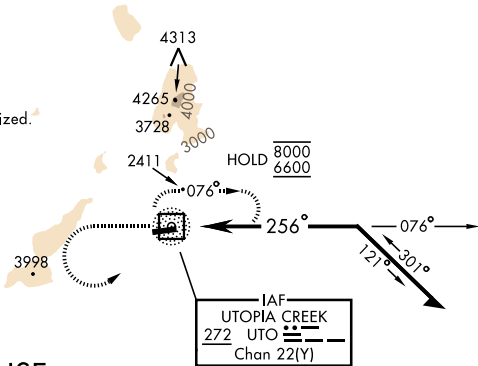


EMERG SAFE ALT 100 NM 10,100

5000	6600	UTO
------	------	-----

ELEV 1261	TDZE 1161
-----------	-----------

Land Rwy 25
Takeoff Rwy 7

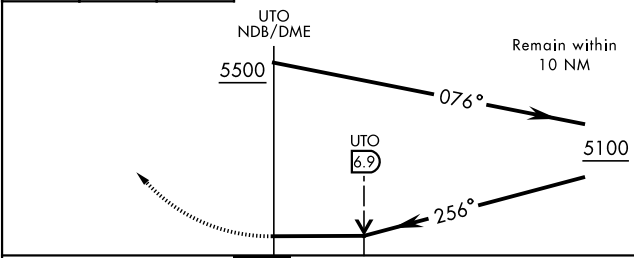

CATEGORY	A	B	C	D
S-25	3940-1¼ 2779 (2700-1¼)	3940-1½ 2779 (2700-1½)	3940-3 2779 (2700-3)	NOT AUTHORIZED

REIL Rwy 25

NDB RWY 25