



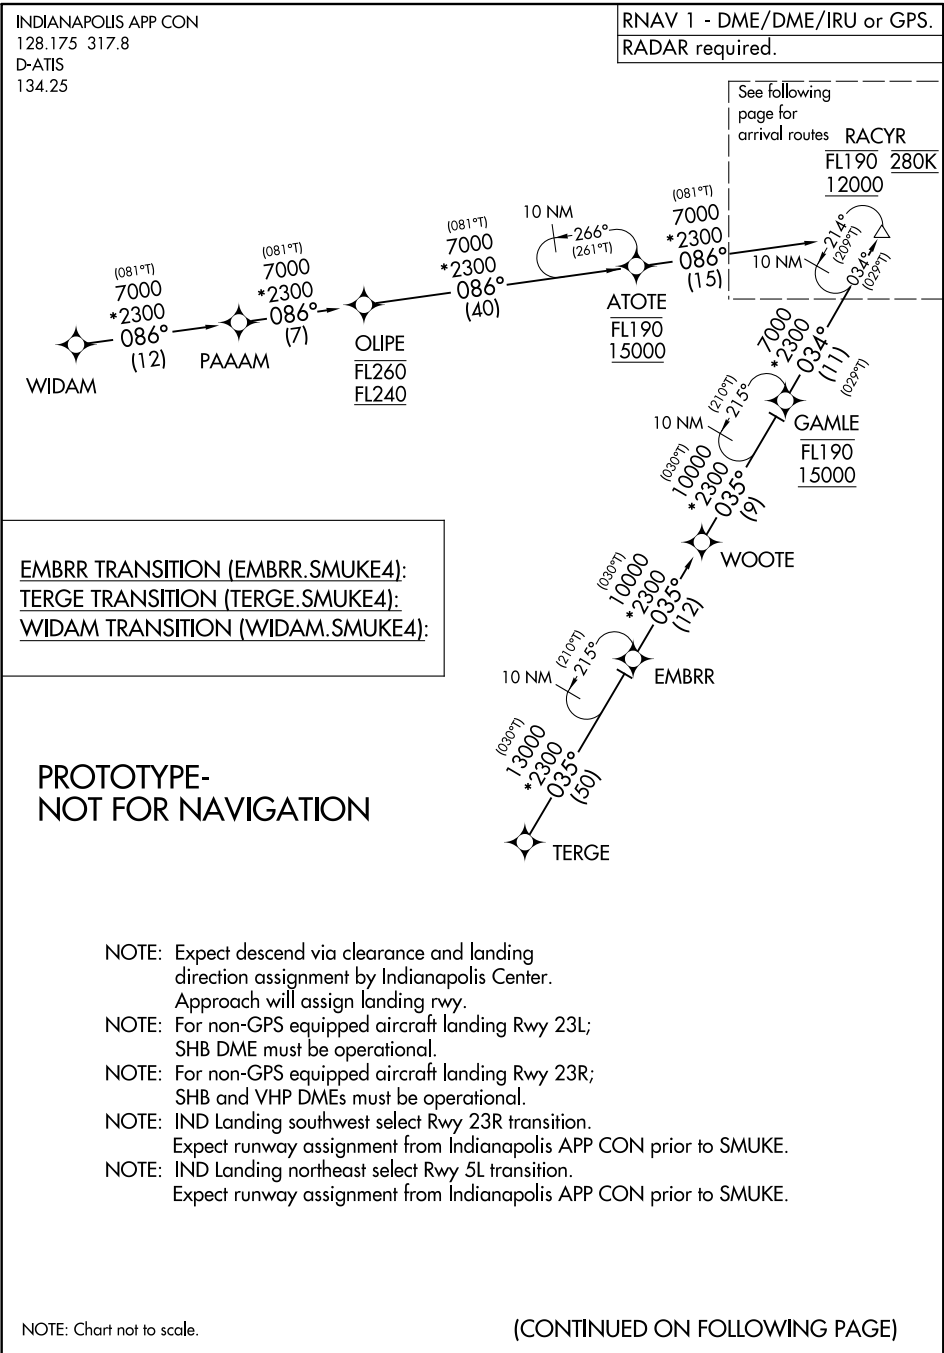

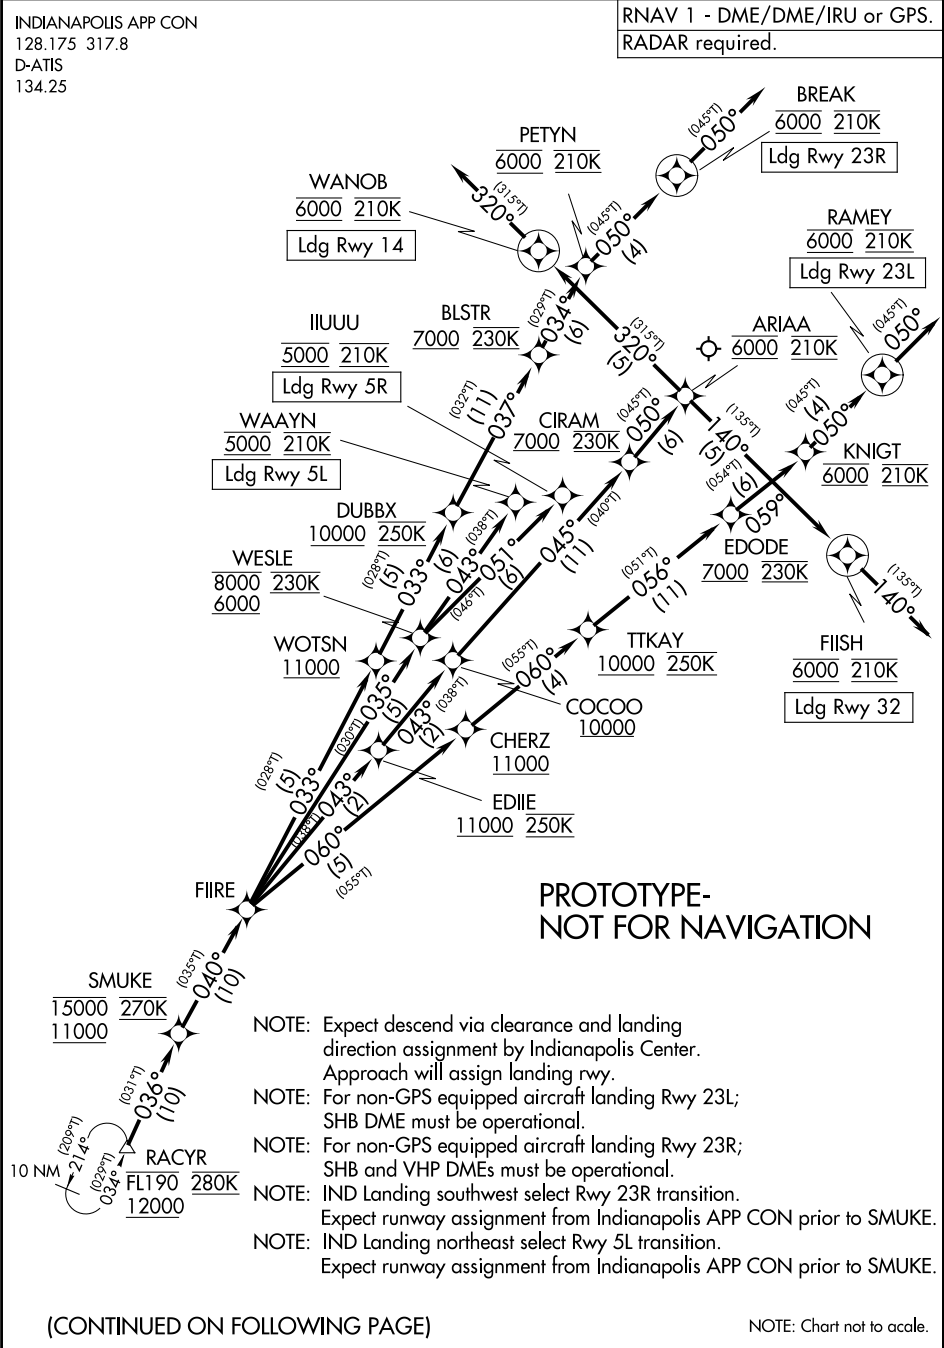

ARRIVAL ROUTE DESCRIPTION

From RACYR on track 036° to cross SMUKE between 11000 and 15000 and at 270K, then on track 040° to FIIRE.

LANDING RUNWAY 5L: From FIIRE on track 035° to cross WESLE between 6000 and 8000 and at 230K, then on track 043° to cross WAAYN at 5000 and at 210K. Expect assigned instrument approach for Rwy 5L or RADAR vectors to final approach course.

LANDING RUNWAY 5R: From FIIRE on track 035° to cross WESLE between 6000 and 8000 and at 230K, then on track 051° to cross IIUUU at 5000 and at 210K. Expect assigned instrument approach for Rwy 5R or RADAR vectors to final approach course.

LANDING RUNWAY 14: From FIIRE on track 043° to cross EDIIE at or above 11000 and at 250K, then on track 043° to cross COCOO at or above 10000, then on track 045° to cross CIRAM at or above 7000 and at 230K, then on track 050° to cross ARIAA at 6000 and at 210K, then on track 320° to cross WANOB at 6000 and at 210K, then on track 320°. Expect assigned instrument approach for Rwy 14 or RADAR vectors to final approach course.

LANDING RUNWAY 23L: From FIIRE on track 060° to cross CHERZ at or above 11000, then on track 060° to cross TTKAY at or above 10000 and at 250K, then on track 056° to cross EDODE at or above 7000 and at 230K, then on track 059° to cross KNIGT at 6000 and at 210K, then on track 050° to cross RAMEY at 6000 and at 210K, then on track 050°. Expect assigned instrument approach for Rwy 23L or RADAR vectors to final approach course.

LANDING RUNWAY 23R: From FIIRE on track 033° to cross WOTSN at or above 11000, then on track 033° to cross DUBBX at or above 10000 and at 250K, then on track 037° to cross BLSTR at or above 7000 and at 230K, then on track 034° to cross PETYN at 6000 and at 210K, then on track 050° to cross BREAK at 6000 and at 210K, then on track 050°. Expect assigned instrument approach for Rwy 23R or RADAR vectors to final approach course.

LANDING RUNWAY 32: From FIIRE on track 043° to cross EDIIE at or above 11000 and at 250K, then on track 043° to cross COCOO at or above 10000, then on track 045° to cross CIRAM at or above 7000 and at 230K, then on track 050° to cross ARIAA at 6000 and at 210K, then on track 140° to cross FIISH at 6000 and at 210K, then on track 140°. Expect assigned instrument approach for Rwy 32 or RADAR vectors to final approach course.

PROTOTYPE-NOT FOR NAVIGATION