

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: Graphical DP	Estimated Chart Date: 10/29/2026	APWS Task ID: 589E013F49DF4338883B6DB4B13B51D5	APWS Project ID: 9CDFEE8DE36B45C69AF19C12DA86A96C
Procedure: CONCORD ONE DEPARTURE (OBSTACLE)		Enroute: YES	Specialist: Palmer, Leo		Agreement Number:
Airport ID: KCCR			Airport City: CONCORD		State: CA
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: NEW CONCORD DEPARTURE (OBSTACLE) GRAPHIC ODP FOR RWY 01 L/R, 32L/R. CCR VOR/DME DECOMMISSIONING 10/26/26 AFS REQUIRED: APPROVAL FOR VCOA OPT OUT ACTIVE AIRNAV DATA USED: PUB'D 01/02/20 NEW ICA IMPLEMENTED. NO KMZ FILES PROVIDED, CONVENTIONAL GRAPHIC ODP, TARGET UNABLE TO UTILIZE AUTOMATION: MANUAL BUILD/EVAL, FIMS PROVIDED. MANAGER: APRIL SARMENTO QUALITY 41 CHECKED QUALITY 42 CHECKED					

FIPC BASIC FORM						
PROCEDURE: CONCORD ONE DEPARTURE (OBSTACLE)			AIRPORT NAME: BUCHANAN FLD		AIRPORT ID: KCCR	SPECIAL CONTROL NO: SP-07-033-26
FAC ID: CCR1		CITY: CONCORD			ST: CA	ORIG CHART DATE: 10/29/2026
DFL TYPE: PROC/T	THIRD PARTY: ☐ YES	EST. TIME ON SITE: 0.4	REIMB. NUMBER: AC0721	PTS TASK ID: 589E013F49DF4338883B6DB4B13B51D5		
PREFLIGHT NOTES						
REVIEWER:					DATE:	
COMMENTS:					CHECK ONE: ☐ FLT CK REQ ☐ NFCR ☐ REJECT	
					YES	NO
					CPV COMPLETE? ☒ X	
PROCEDURE RESULTS						
INSPECTION DATE: 08/05/2026	CREW #: VN588	N #: N66	INSTRUMENT PROCEDURE STATUS: ☐ SAT ☐ SAT W/CHANGES ☒ UNSAT		ARINC CODING: ☐ SAT ☐ SAT/GOLD ☒ UNSAT	
FLIGHT INSPECTOR SIGNATURE: james r jones @ 08/05/2026 21:21			PRINTED NAME: JONES, JAMES ROBERT			NOTAM INITIATED? ☐ YES ☒ NO
FLIGHT INSPECTOR REMARKS: BUCHANAN FLD, CONCORD, CA. CONCORD ONE DEPARTURE. UNSAT The Textual Departure Procedures and the Departure Procedures on the Concord One Departure depict two different procedures and present potential confusion which direction to turn during their execution. (CCR RWY 19R CLIMBING LEFT TURN HEADING 011.00 TO 4900' BEFORE PRECEDING ON COURSE. CONCORD ONE TAKEOFF RUNWAYS 19L/R: CLIMBING LEFT TURN HEADING 341 AND OAK VOR/DME R-022 TO CROSS PITTS AT OR ABOVE 3400 THENCE.)						
IN-FLIGHT OBSTACLE REPORT						
OBSTRUCTION ID #:	COORDINATES OR LOCATION:	GNSS ALTITUDE (MSL):	BAROMETRIC ALTITUDE (MSL):	HEIGHT ABOVE GROUND LEVEL:		



Federal Aviation Administration


Memorandum

Date: 09/03/2026
To: Wade Terrell, Manager, Flight Technologies and Procedures Division THRU:
Wayne Radicke, Manager, Flight Procedures and Airspace Group
From: Beverly L. Bordy, Manager, Team 2, AJV-A42
Subject: Approval Request: Concord, CA. (KCCR) CONCORD DEPARTURE


Concord One Departure
Concord Ca. (KCCR)
VISUAL CLIMB OVER AIRPORT (VCOA), 8260.46K, 2-1-2 i (3).

SUU Approach Control advises "The proximity of this airport to other surrounding airports and the complexity of the airspace do not support the addition of a VCOA." The major metropolitan area surrounding this airfield and the traffic flow dictate the need for a highly controlled departure procedure. The addition of a VCOA would not add to the operational safety of the flying public but rather it would increase the complexity of an already congested airspace.


BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
RWY 1L 100K
LOW CLOSE-IN DER CROSSING
CG, CGTA

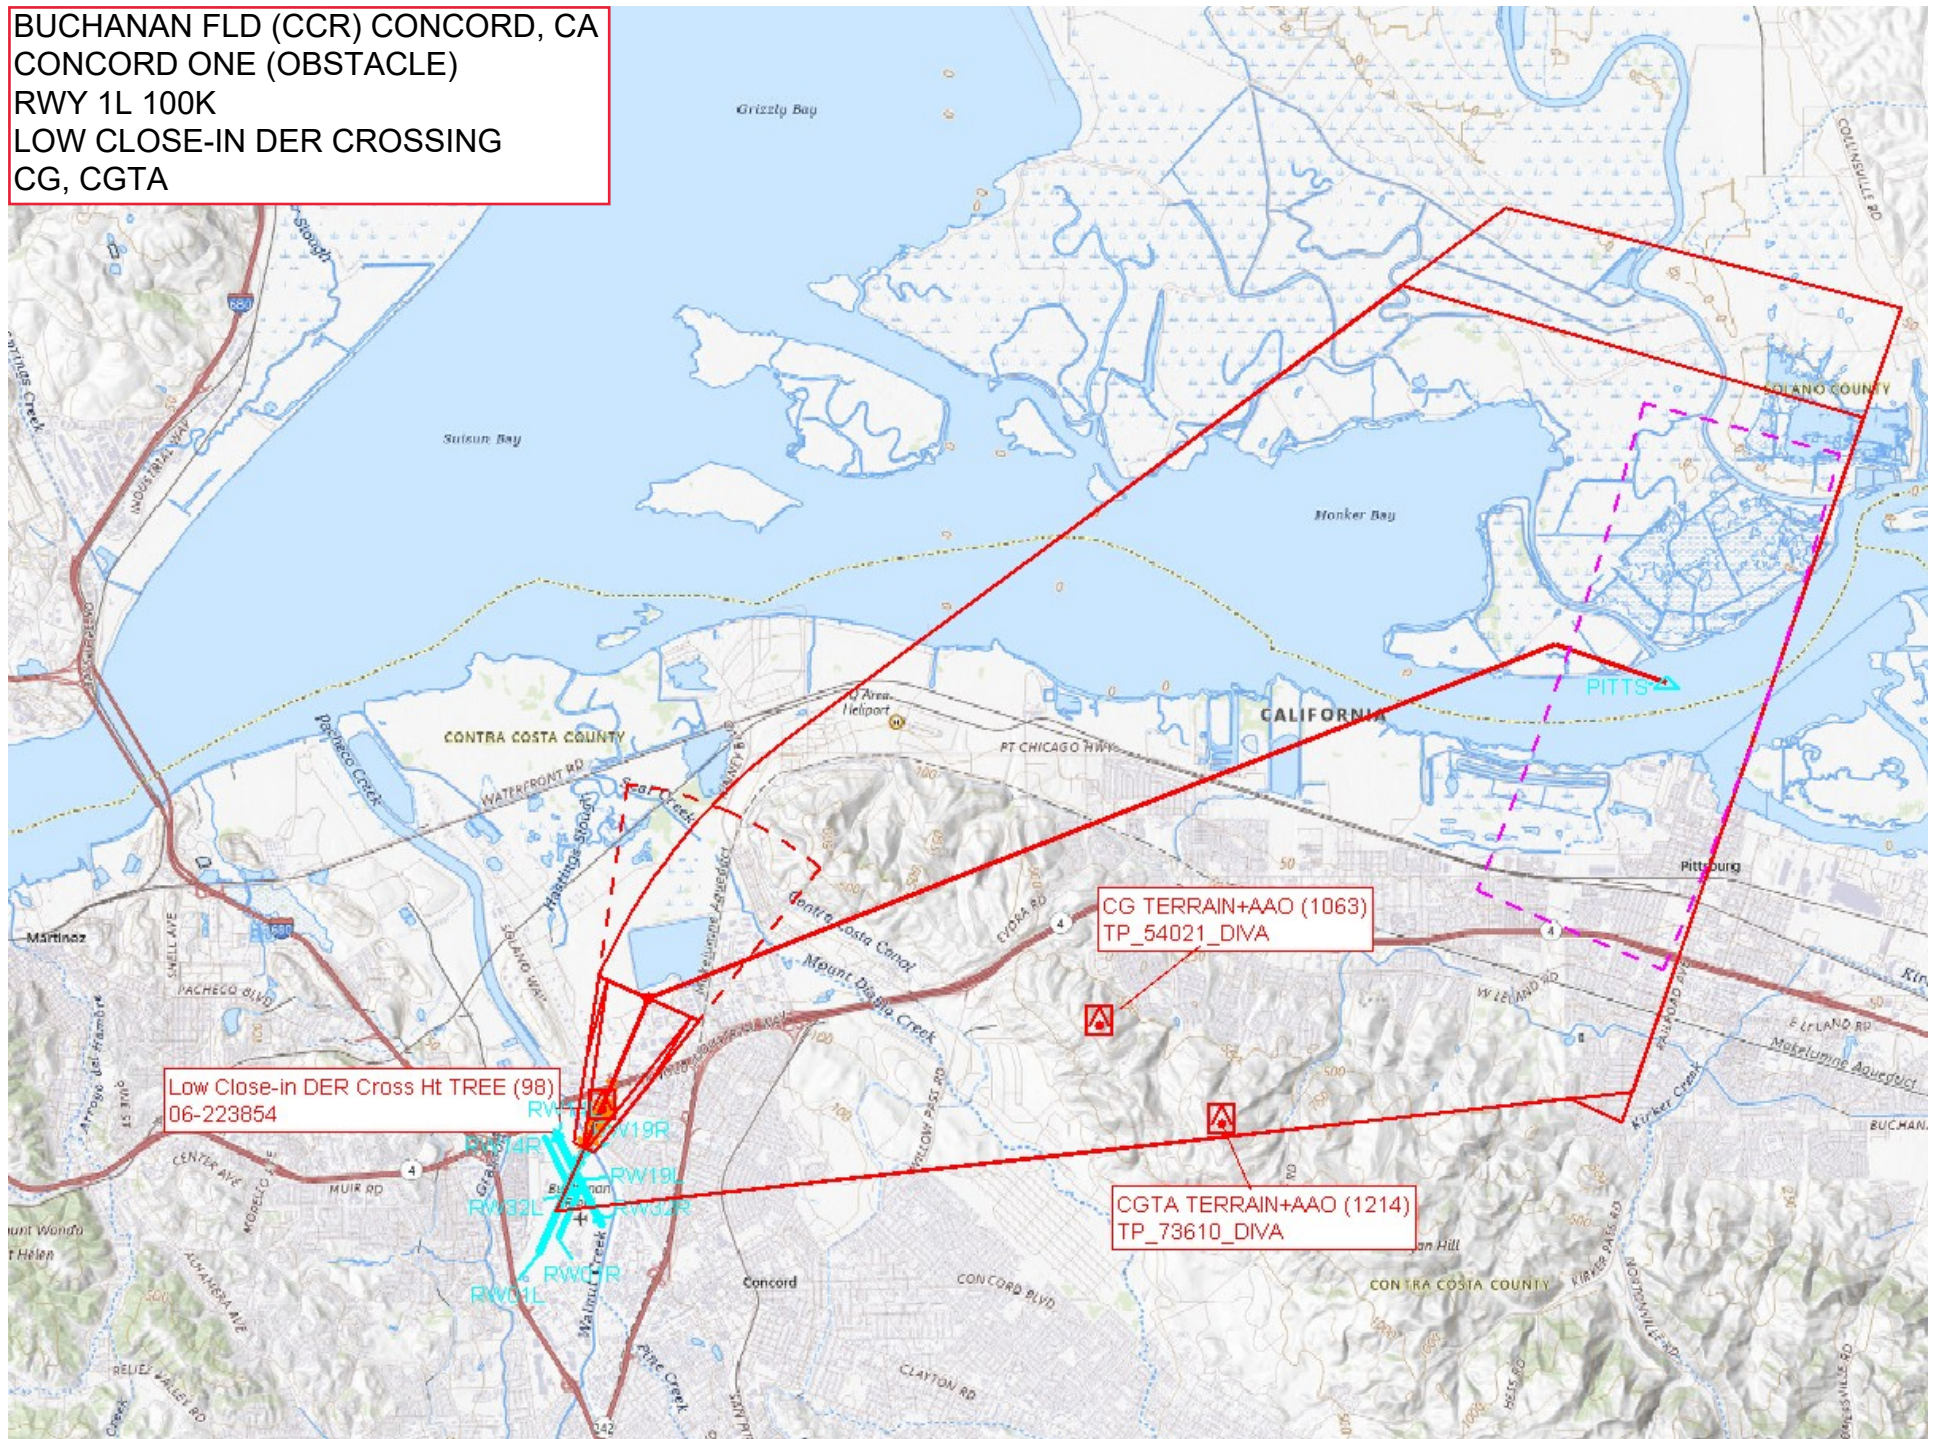


BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
RWY 1L 500K
LOW CLOSE-IN DER CROSSING
CG, CGTA

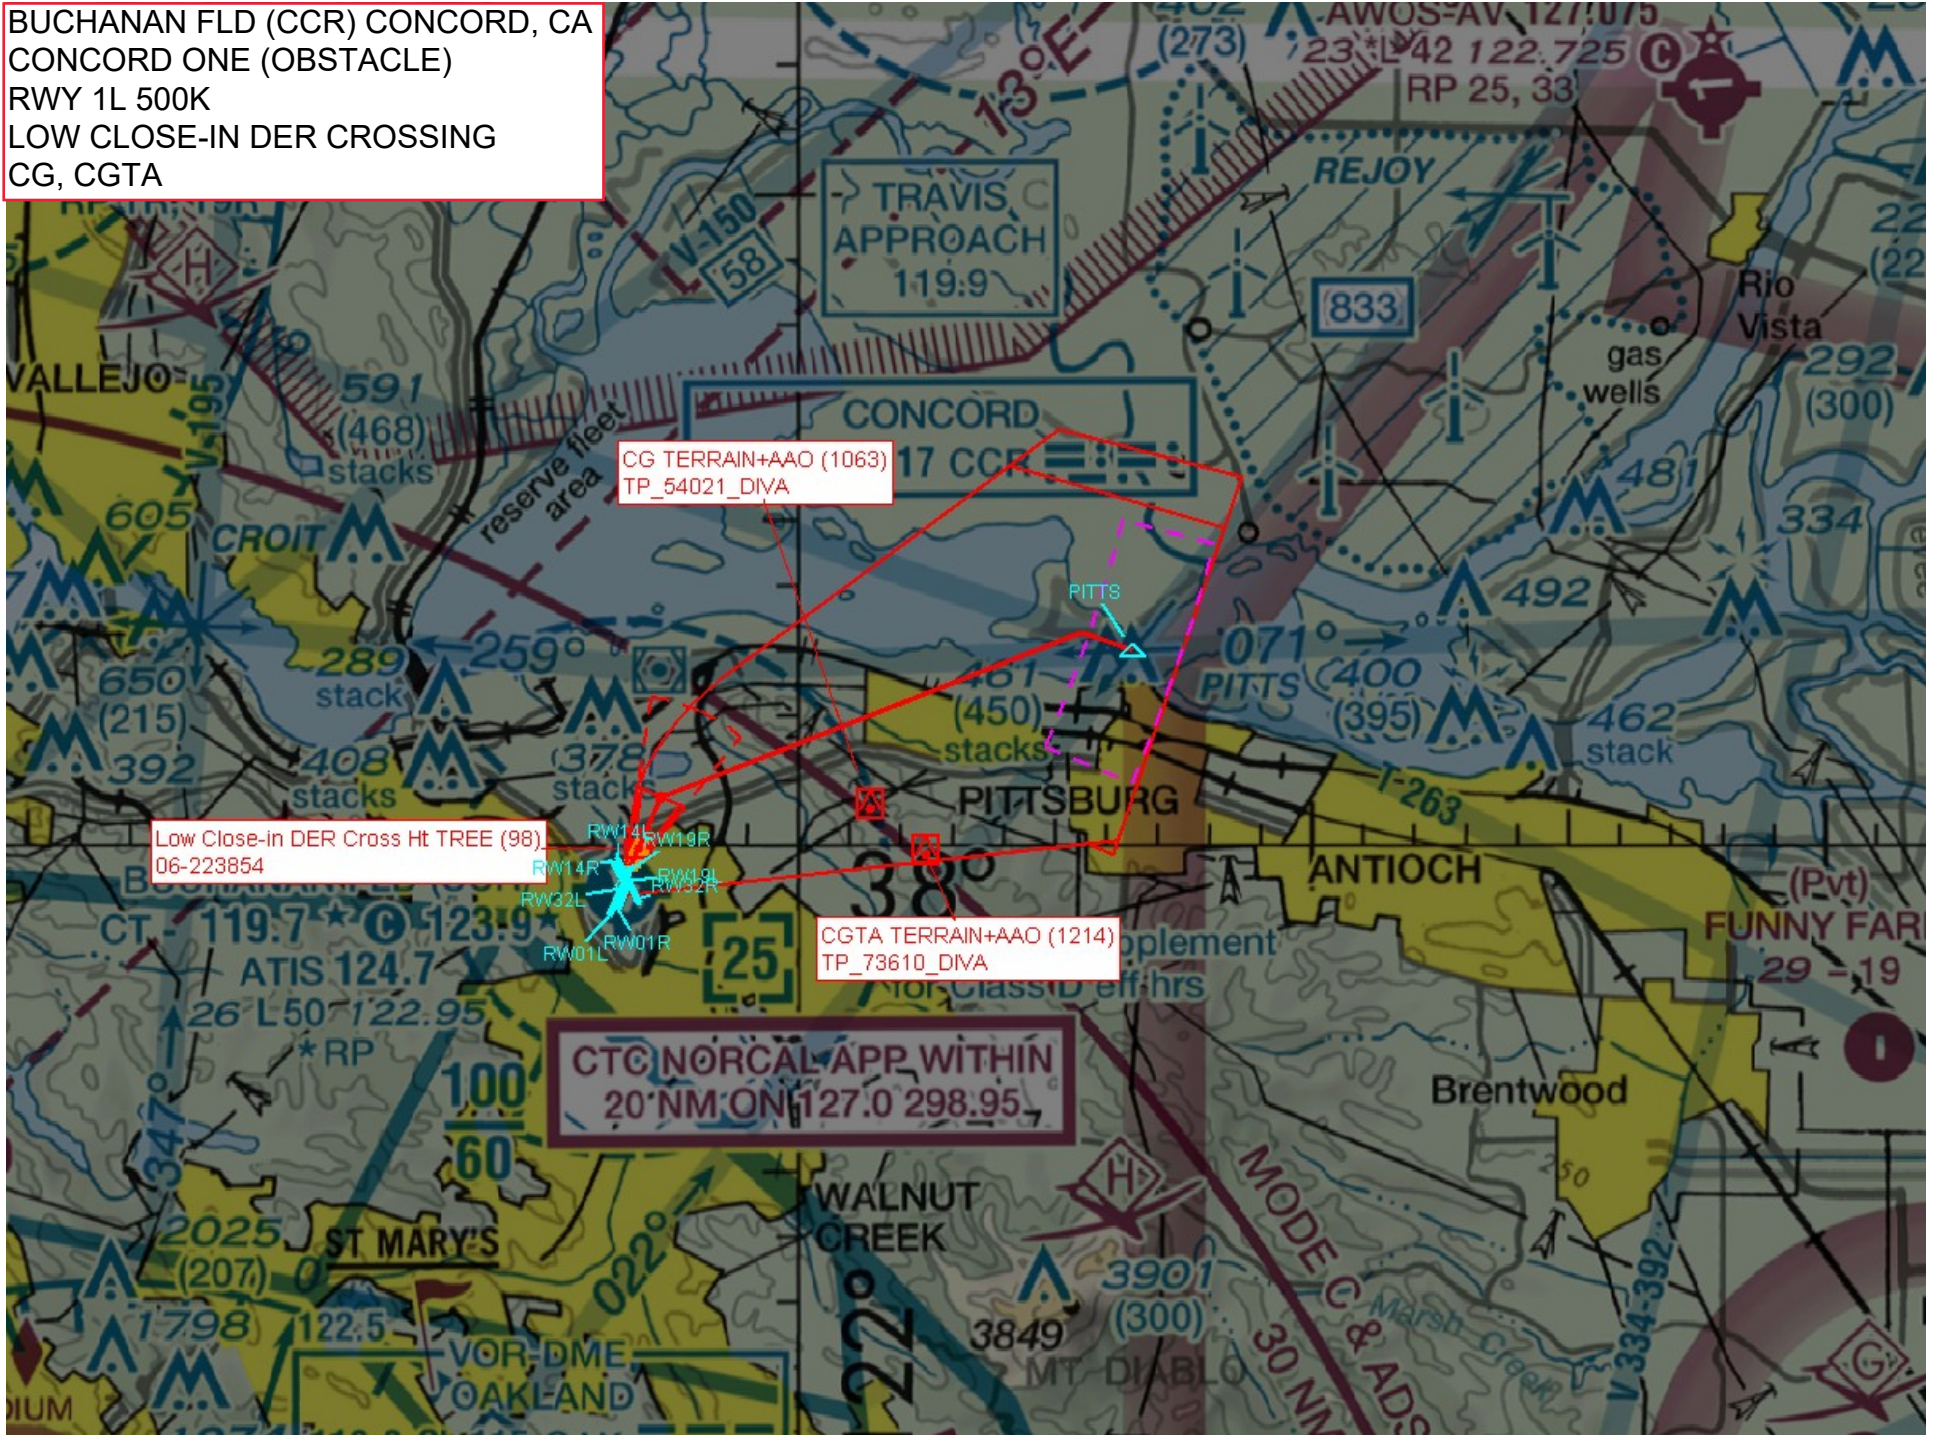

BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
RWY 1R 100K
LOW CLOSE-IN DER CROSSING
CG, CGTA

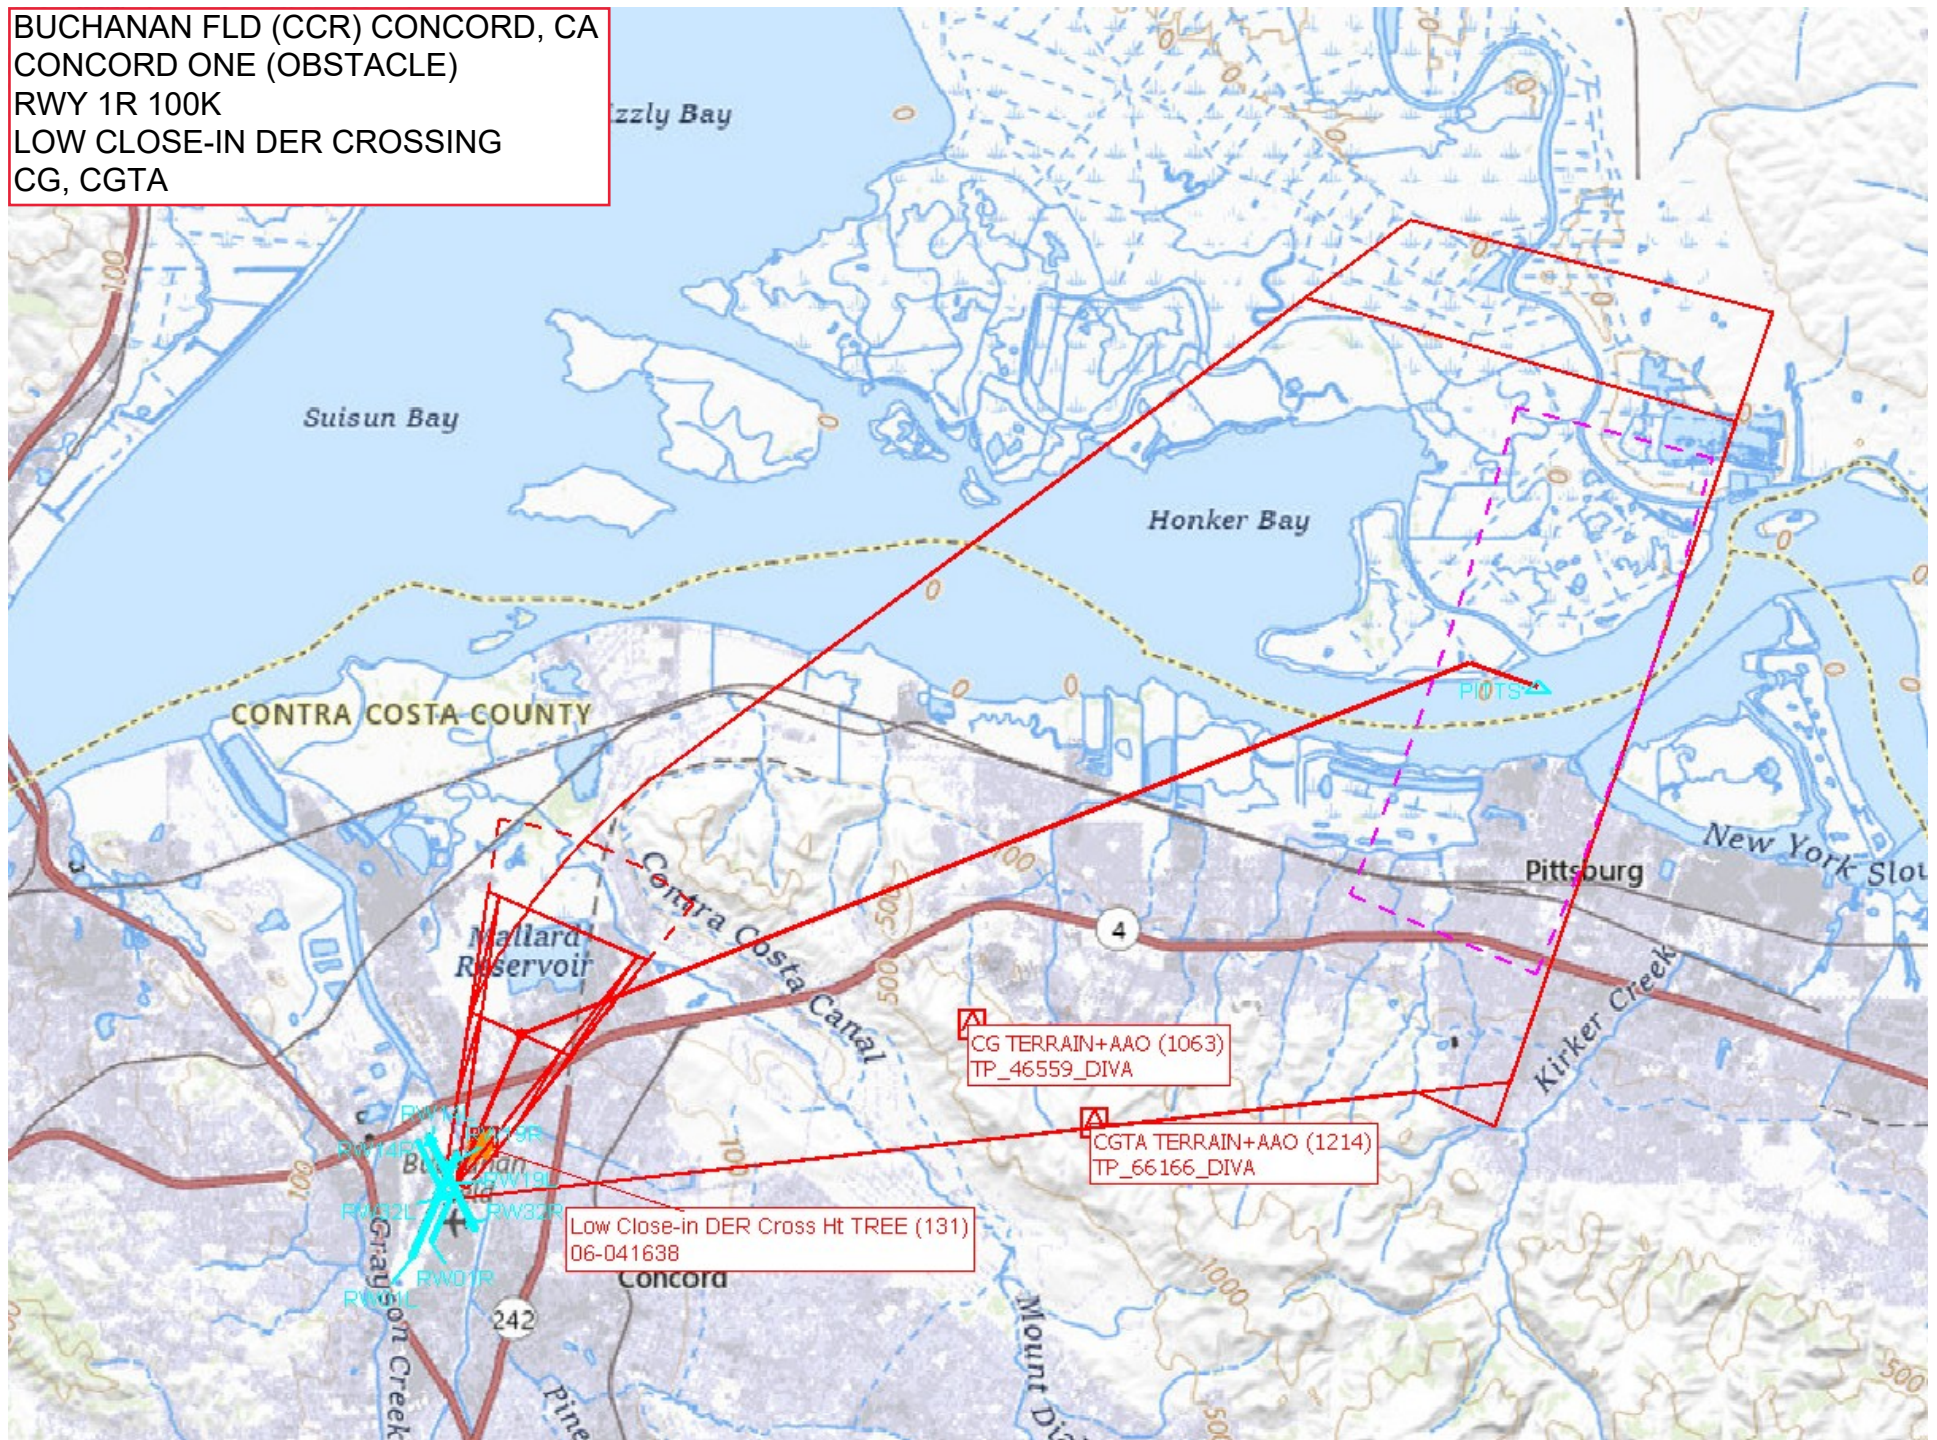

BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
RWY 1R 500K
LOW CLOSE-IN DER CROSSING
CG, CGTA

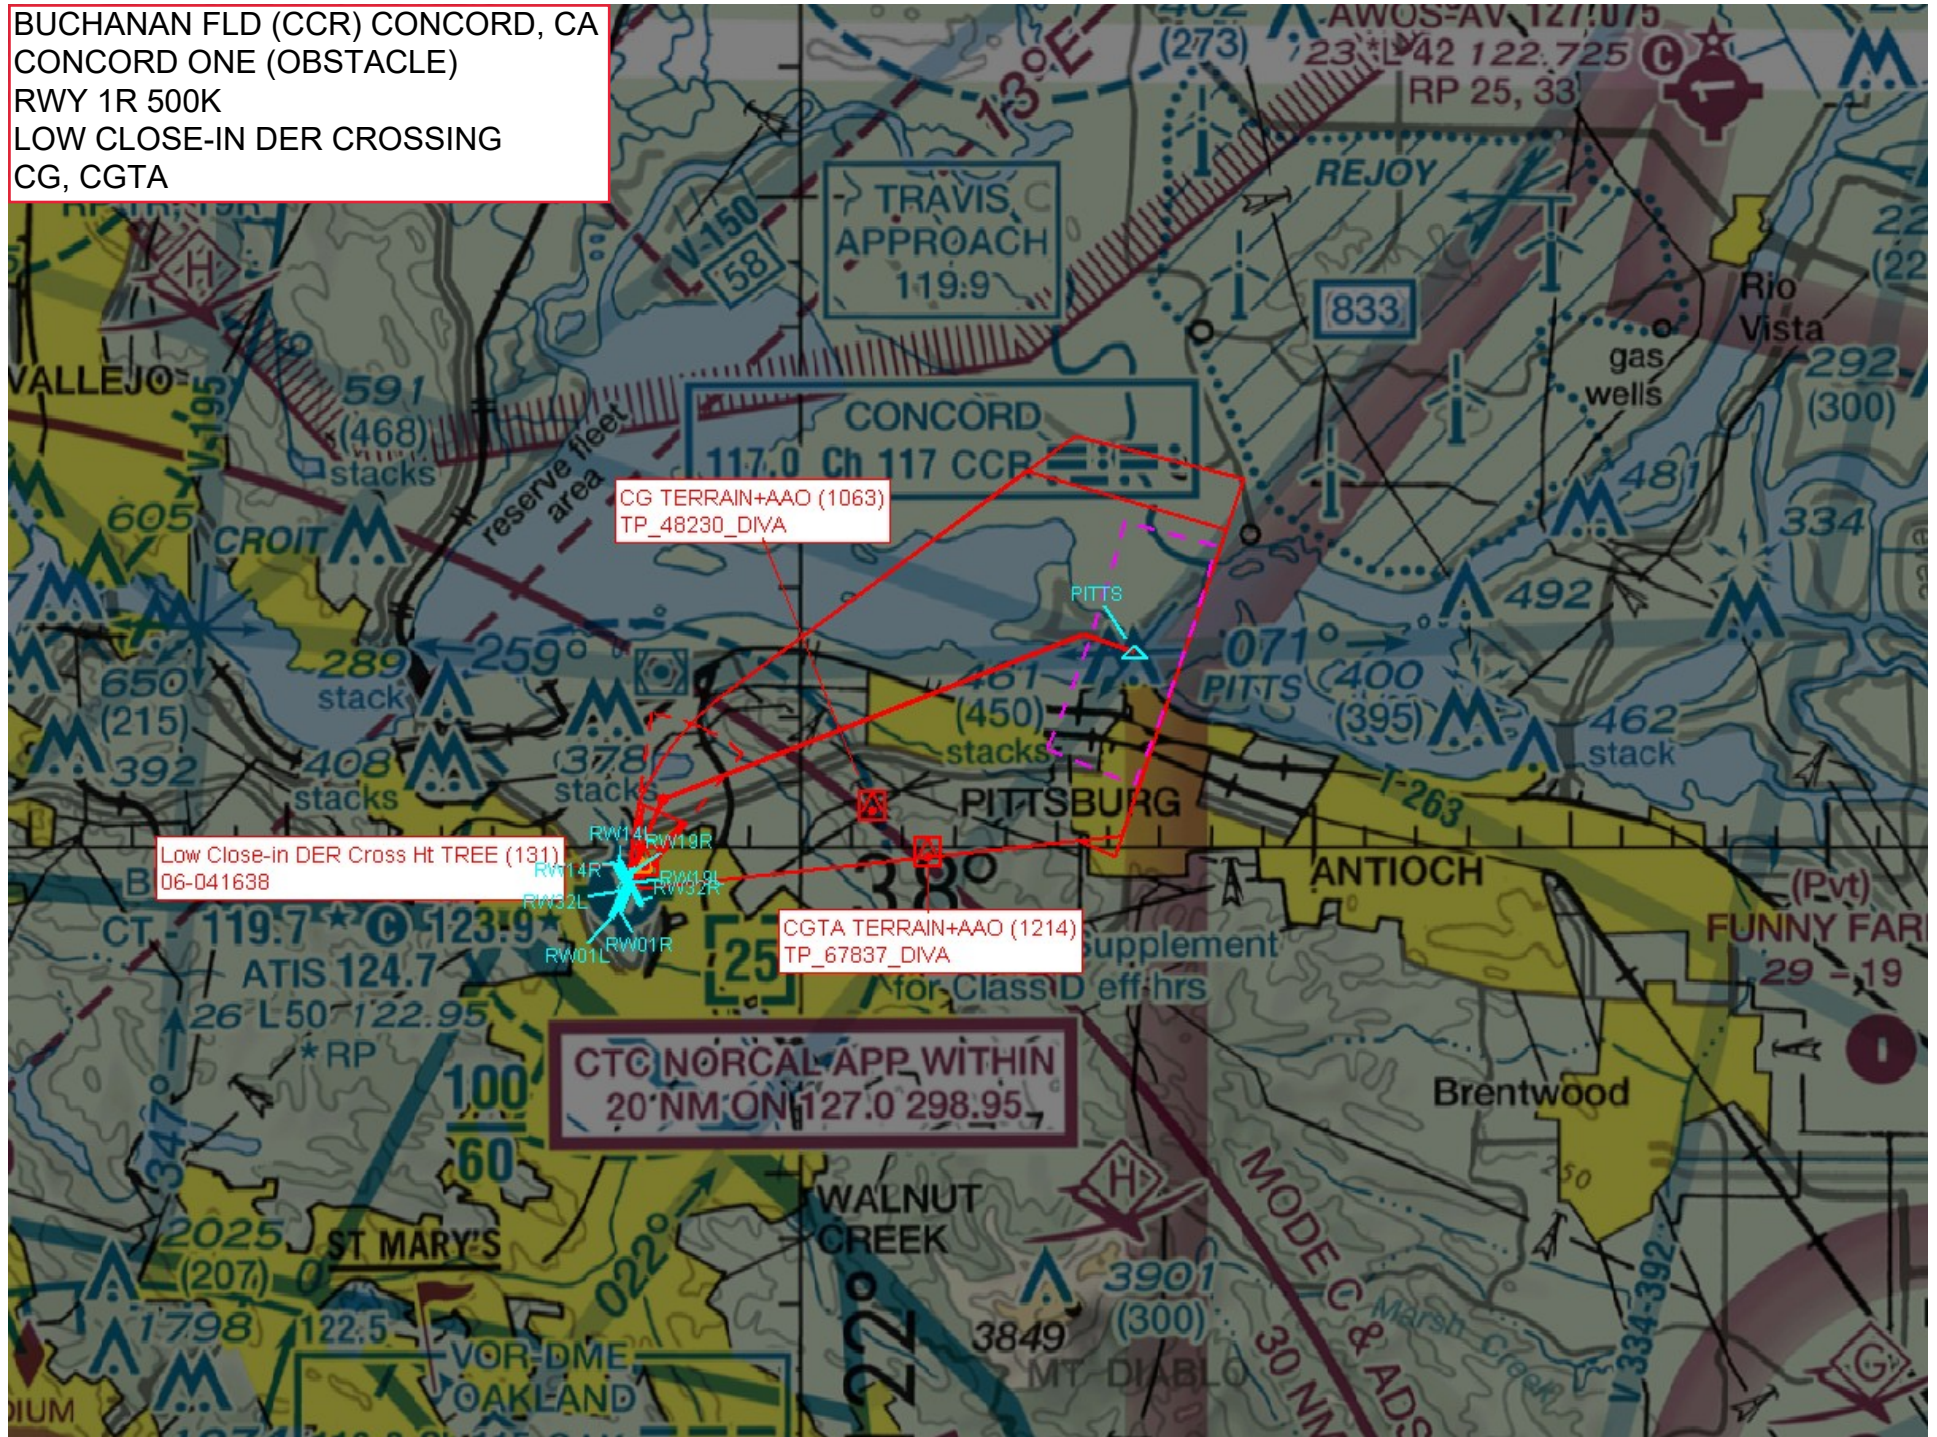

BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
RWY 32L 100K
LOW CLOSE-IN DER CROSSING
CG, CGTA

VIS REFINERY (322)
06-003208


CGTA TRANSMISSION_LINE (738)
06-001909

KCCR:CG STACK (368)
06-001065

CG/CEIL/TO Mins DER Cross Ht STACK (378)
06-000700

**Low Close-in DER Cross Ht TRAVERSE_WAY (40)
06-069990**

BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
RWY 32L 500K
LOW CLOSE-IN DER CROSSING
CG, CGTA

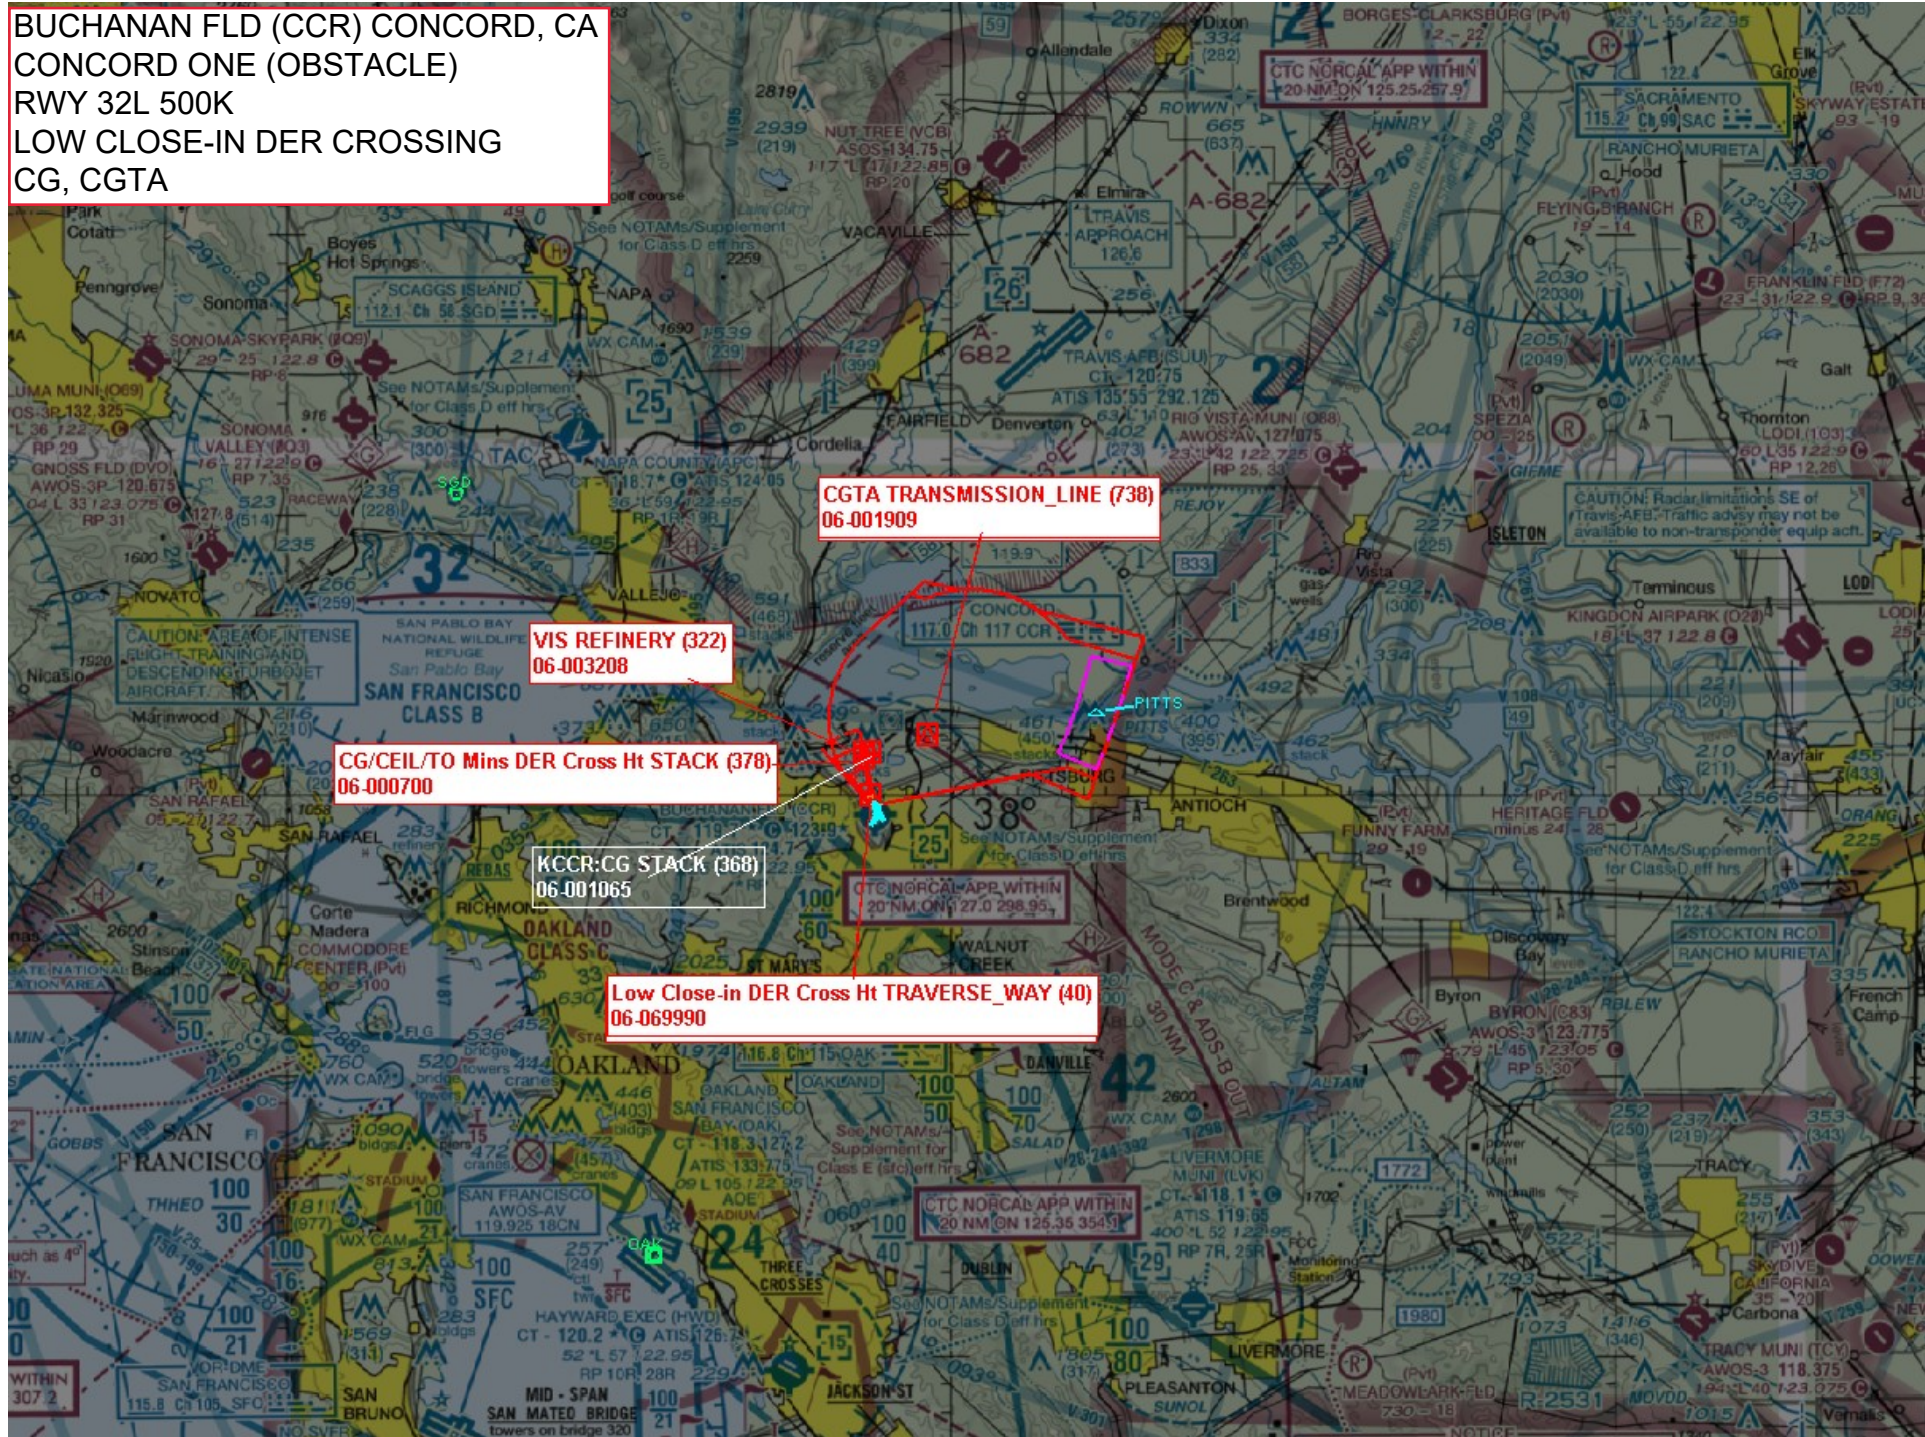

BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
RWY 32R 100K
LOW CLOSE-IN DER CROSSING
CG, CGTA

CG/CEIL/TO Mins DER Cross Ht STACK (378)
06-000700


CGTA TRANSMISSION_LINE (738)
06-001909

VIS REFINERY (322)
06-003208


CG STACK (368)
06-001065

**Low Close-in DER Cross Ht AG_EQUIP (99)
06-024499**

BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
RWY 32R 500K
LOW CLOSE-IN DER CROSSING
CG, CGTA

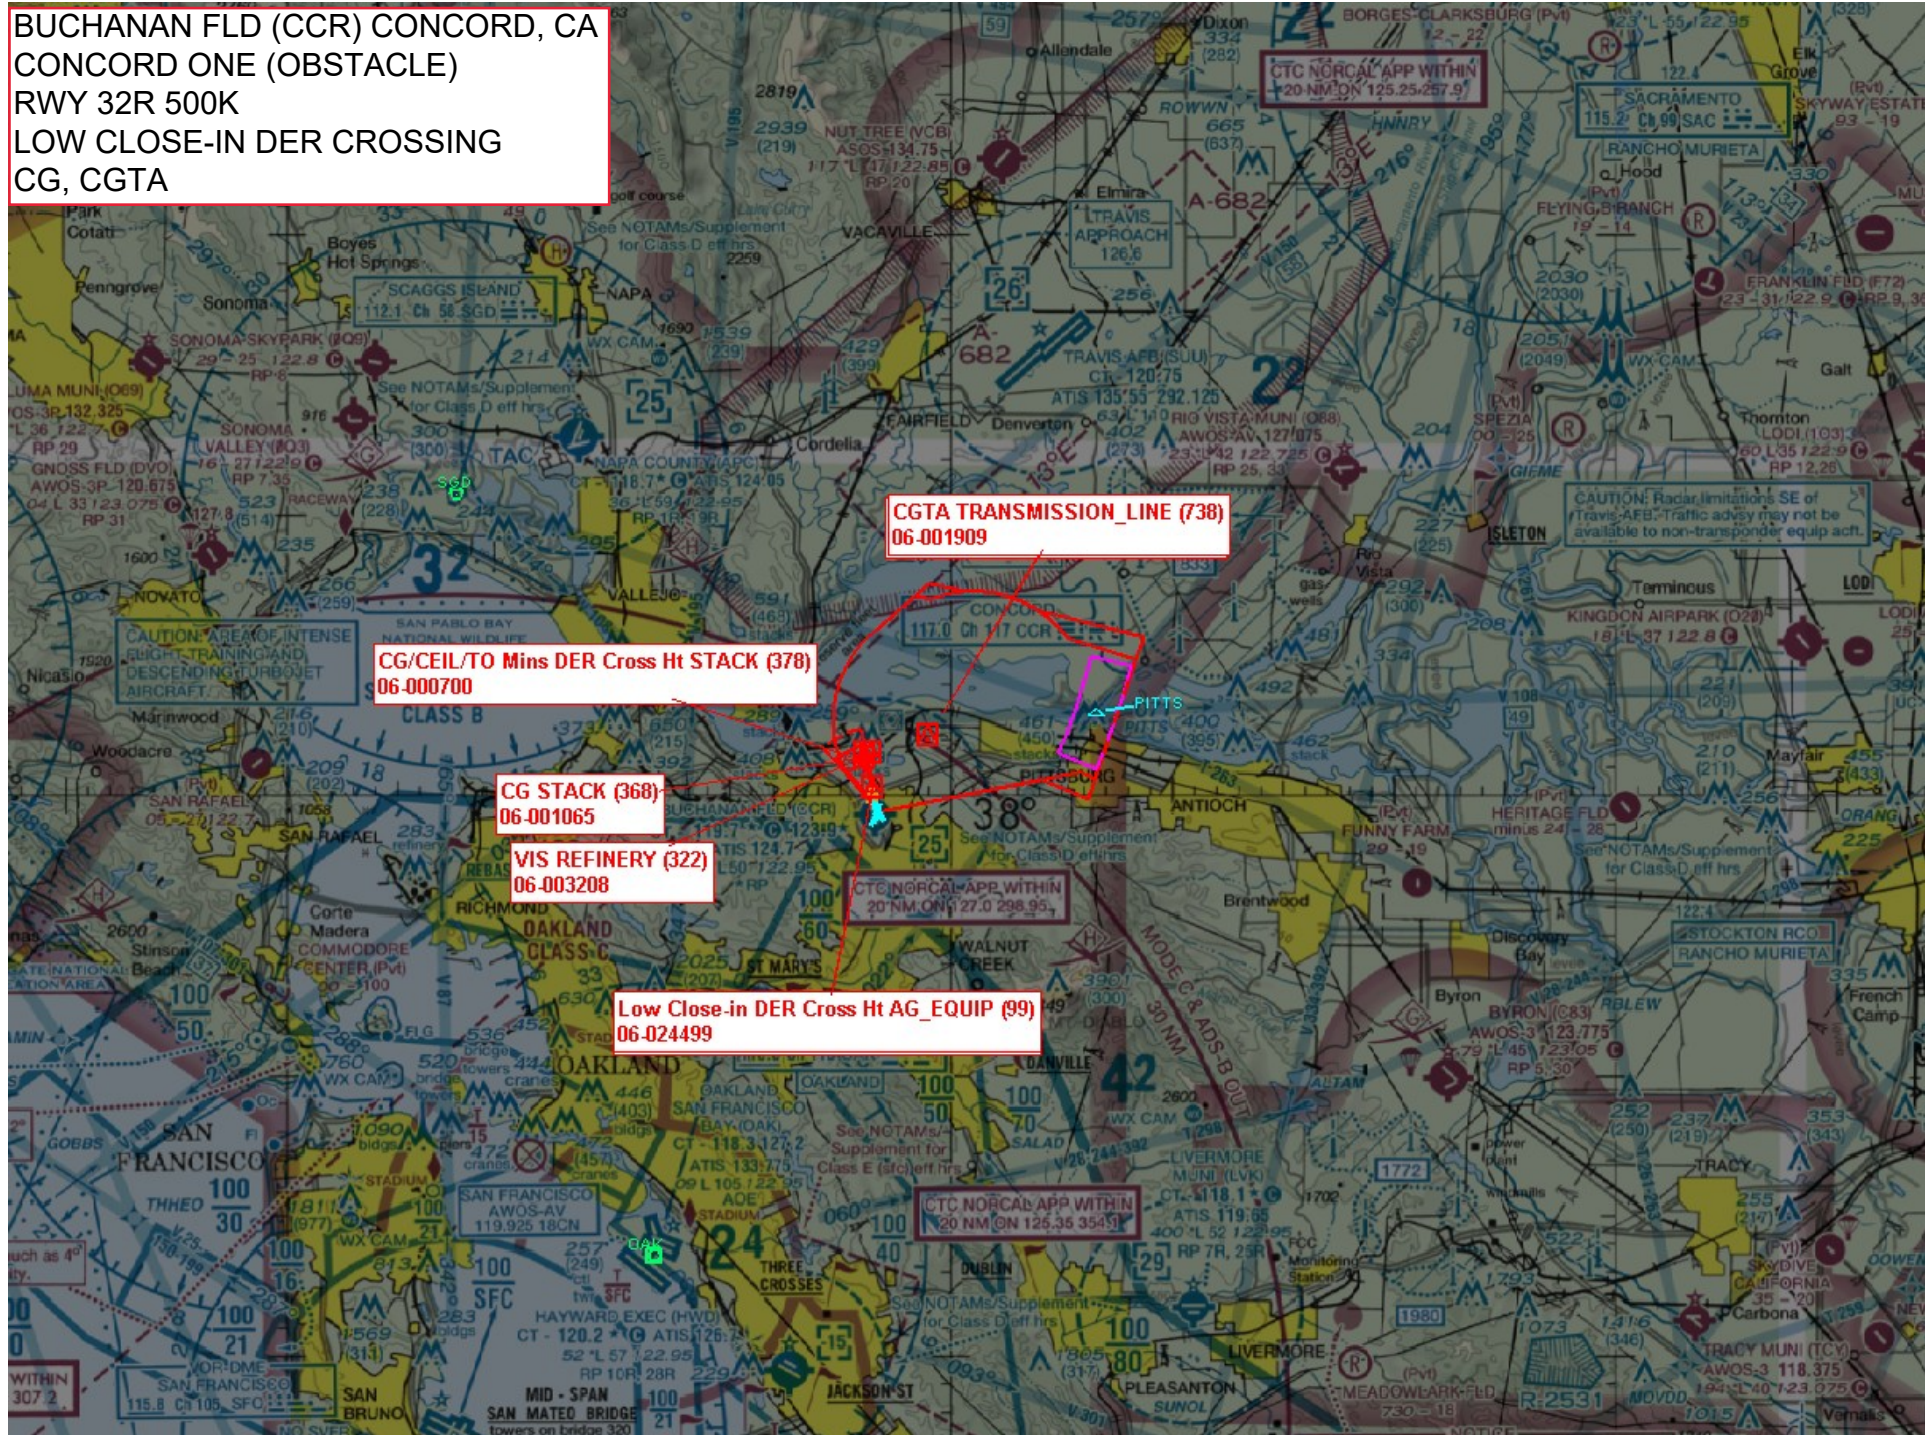

BUCHANAN FLD (CCR) CONCORD, CA
CONCORD ONE (OBSTACLE)
PITTS CLIMB IN HOLD 500K

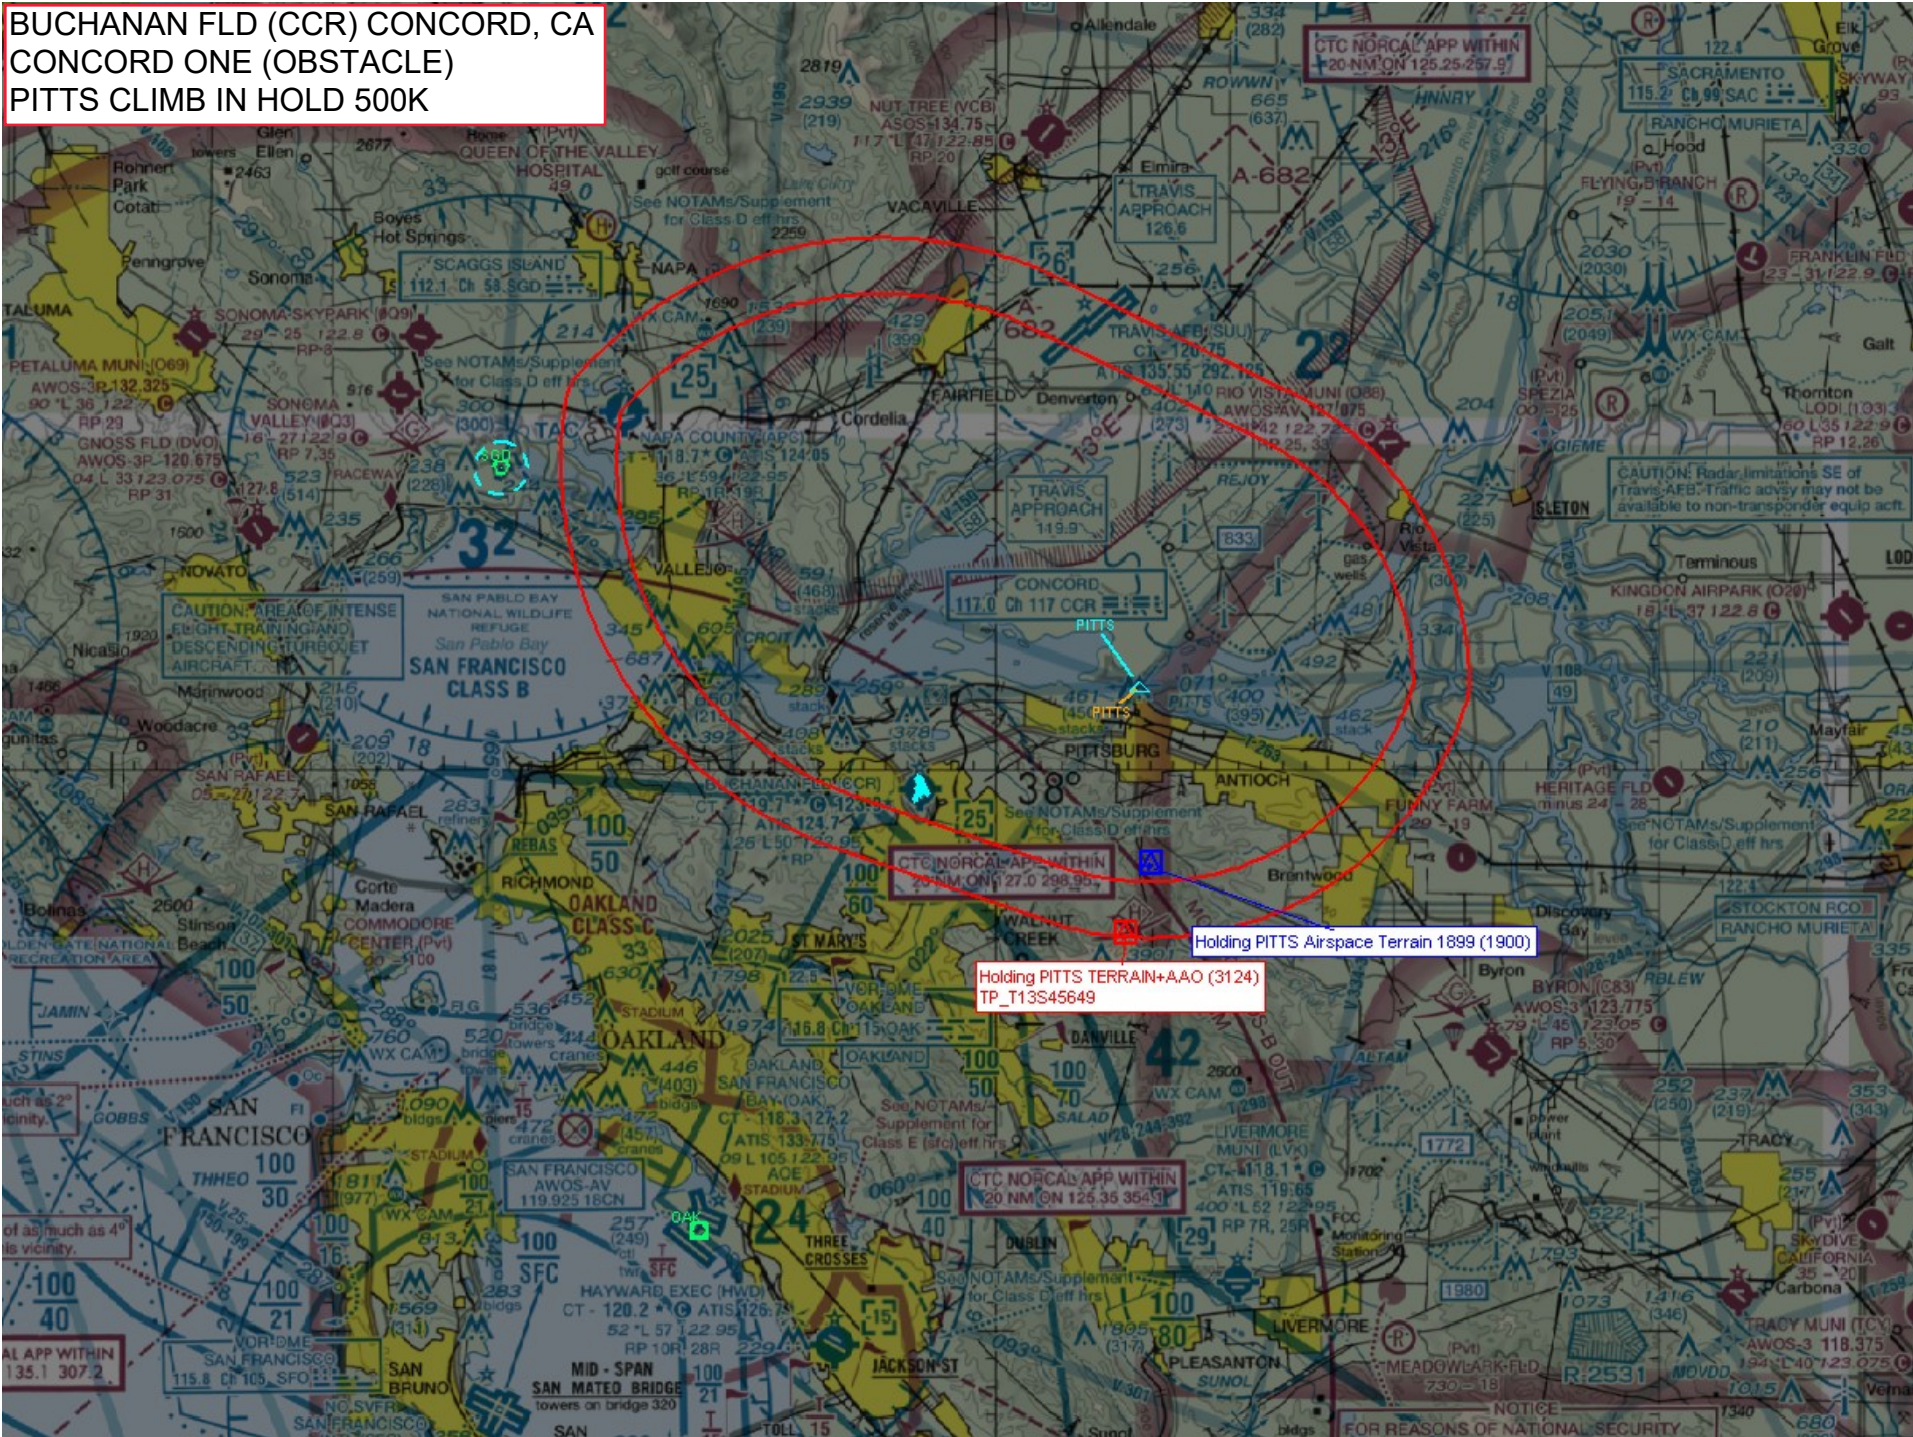

MSA OEA 1 TERRAIN+A.AO (4036)
TPMSA_1218399

