



Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 10/29/2026	APWS Task ID: 7181A86580104B6A8418EED1C45CA2B6	APWS Project ID: CFFDC84428324A5EA08A8C73B536DEFD
Procedure: ILS OR LOC RWY 32 AMDT 10		Enroute: NO	Specialist: Heiderstadt, Nicholas		Agreement Number:
Airport ID: KSBY			Airport City: SALISBURY		State: MD
Facility ID: SBY	Facility Type: ILS	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: PENDING AIRNAV DATA USED RUNWAY LENGTH CHANGE CLEARS FDC NOTAM 6/4497 CONTACT ROBERT HAMILTON 405-954-4608 QUALITY 41 CHECKED QUALITY 39 CHECKED					

LOC I-SBY 108.7	APP CRS 319°	Rwy Ldg TDZE Apt Elev	6400 53 53
---------------------------	------------------------	-----------------------------	---------------------------------------

ILS or LOC RWY 32
SALISBURY-OCEAN CITY WICOMICO RGNL (SBY)

DME required.	MALSR	MISSED APPROACH: Climb to 700 then climbing right turn to 3000 direct ATR VOR/DME and hold.
For inop ALS, increase S-LOC 32 Cat C and D visibility to 1½ SM. Simultaneous reception of I-SBY LOC and SBY DME required.		

ASOS 118.325	PATUXENT APP CON ★ 127.95 314.0	SALISBURY TOWER ★ 119.425 (CTAF)	GND CON 123.775	UNICOM 122.95
------------------------	---	--	---------------------------	-------------------------

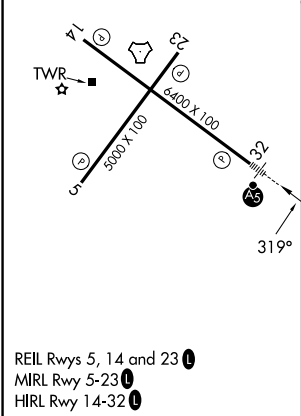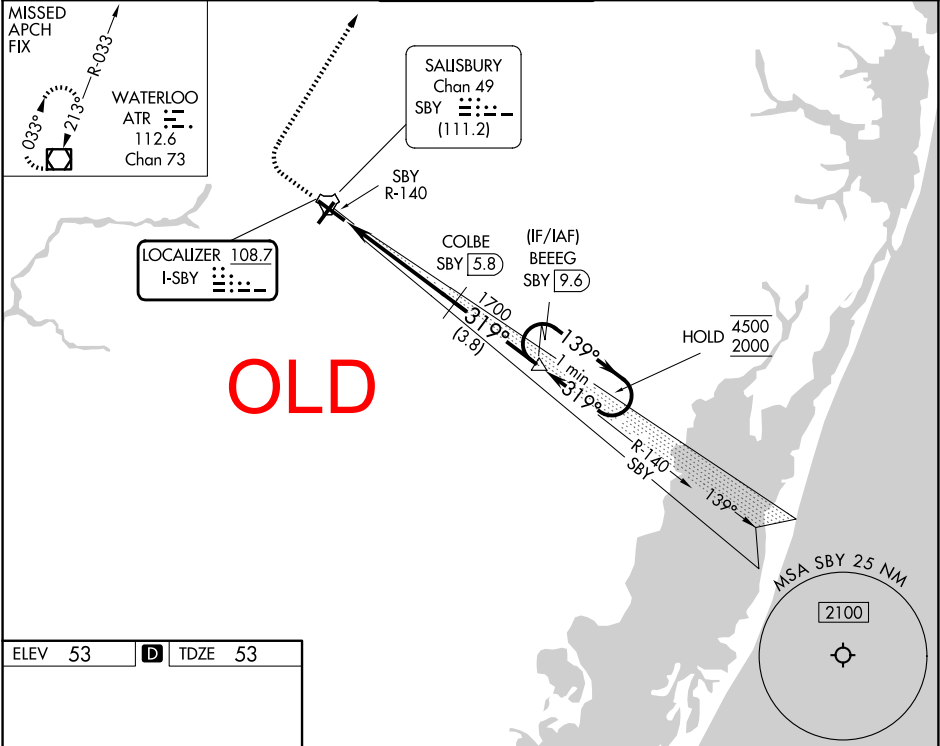

700	3000	ATR	One Minute Holding Pattern			
CATEGORY	A	B	C	D		
S-ILS 32	253-½ 200 (200-½)					
S-LOC 32	520-½	467 (500-½)	520-1	467 (500-1)		
CIRCLING	520-1	467 (500-1)	560-1½ 507 (600-1½)	700-2 647 (700-2)		

I-SBY LOC 108.7 Chan 49X	APP CRS 319°	Rwy ldg 7600 TDZE 54 APT Elev 54
---------------------------------------	------------------------	---

ILS OR LOC RWY 32

SALISBURY-OCEAN CITY WICOMICO RGNL (KSBY)

MISSED APPROACH:

PROTOTYPE-NOT FOR NAVIGATION

