

Flight Procedures Cover Page	Task Action: Abbreviated Amendment	Task Type: IAP	Estimated Chart Date: 08/07/2025	APWS Task ID: 74570182EDEA4A8397454F12F52DF0AB	APWS Project ID: C84B620AEBD4483AA5D5C063B64EE5B4
Procedure: RNAV (GPS) RWY 22 AMDT 2D		Enroute: NO	Specialist: Given, Cody		Agreement Number:
Airport ID: KTPF			Airport City: TAMPA		State: FL
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: ABBREVIATED AMENDMENT COMPLETED UTILIZING ACTIVE AIRNAV DATA FOR KTPF RWY 22. PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021, SUBJECT: GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION/VALIDATION. CONTACT: ROBERT HAMILTON (AJV-A433) 405-954-4608. QUALITY 41 CHECKED QUALITY 10 CHECKED					

APP CRS	Rwy Idg	3403
222°	TDZE	7
	Apt Elev	7


RNAV (GPS) RWY 22
PETER O KNIGHT (TPF)

RNP APCH.	MISSED APPROACH: Climbing left turn to 2700 direct LAL VORTAC and hold.
▼ Circling NA northwest of Rwy 4-22. Procedure NA at night. Rwy 22 helicopter visibility reduction below 1 SM NA. When local altimeter setting not received, use Tampa Init altimeter setting and increase all MDA 20 feet. Circling NA to Rwy 18.	


AWOS-3 118.925	TAMPA APP CON 119.9 290.3	CLNC DEL 119.8	UNICOM 122.725 (CTAF) 0
-------------------	------------------------------	-------------------	----------------------------

OLD


Procedure NA for arrivals at DADES on V7-521 northwest bound.

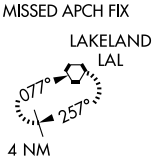

Procedure NA for arrival on PIE VORTAC airway radials 355 CW 157.


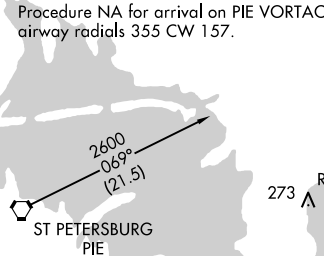


ELEV 7	D	TDZE 7
--------	---	--------

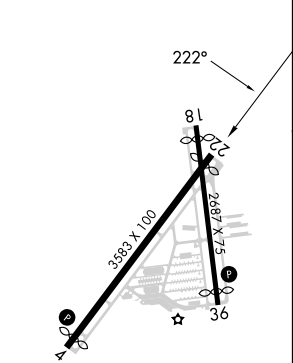

REIL Rwy 22 0
MIRL Rws 4-22 and 18-36 0

Procedure NA for arrival on LAL VORTAC airway radials 262 CW 350.

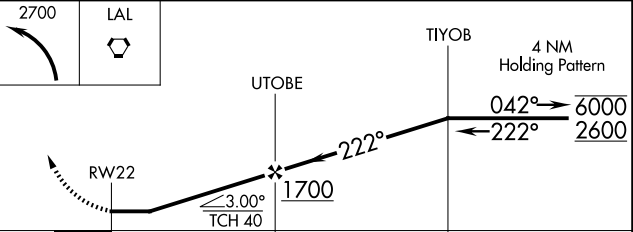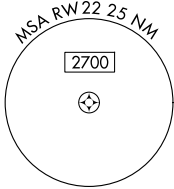

CATEGORY	A	B	C	D
LNAV MDA	580-1	573 (600-1)	NA	
CIRCLING	720-1	713 (800-1)	NA	