

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 07/09/2026	APWS Task ID: 7F6A740174954A899FDF45882E87DFC4	APWS Project ID: 9AAD52F4E72948B990356DA0D75AC759
Procedure: RNAV (GPS) RWY 29 AMDT 1		Enroute: NO	Specialist: Kenney, Taylor		Agreement Number:
Airport ID: KBED			Airport City: BEDFORD		State: MA
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			

Procedure Comments:  
ACTIVE AIRNAV DATA USED.

CANCELS NOTAM 5/2914: CHANGE TERMINAL ROUTE ONEIF TO BYLND (IF) MINIMUM ALTITUDE FROM 2000 TO AT OR BELOW 2000.

CRC REMAINDER CHANGED FROM DA167B89 TO C3D3223A.

POC: ROB HAMILTON, AJV-A433, (405) 954-4608.





WAAS CH <b>87047</b> <b>W29A</b>	APP CRS <b>290°</b>	Rwy Ldg TDZE Apt Elev	<b>7011</b> <b>128</b> <b>132</b>
--	------------------------	-----------------------------	---


**EXISTING**

**RNAV (GPS) RWY 29**  
LAURENCE G HANSCOM FLD (BED)

RNP APCH - GPS.


▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -19°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1½ SM and LNAV Cats C and D visibility to 1½ SM.

▲


MALSR 

MISSED APPROACH: Climb to 600 then climbing right turn to 2000 direct SOSYO and hold, continue climb-in-hold to 2000.

ATIS <b>124.6</b>	BOSTON APP CON <b>124.4 279.6</b>	HANSCOM TOWER★ <b>118.5 (CTAF) 257.2</b>	GND CON <b>121.7</b>	UNICOM <b>122.95</b>
----------------------	--------------------------------------	---	-------------------------	-------------------------

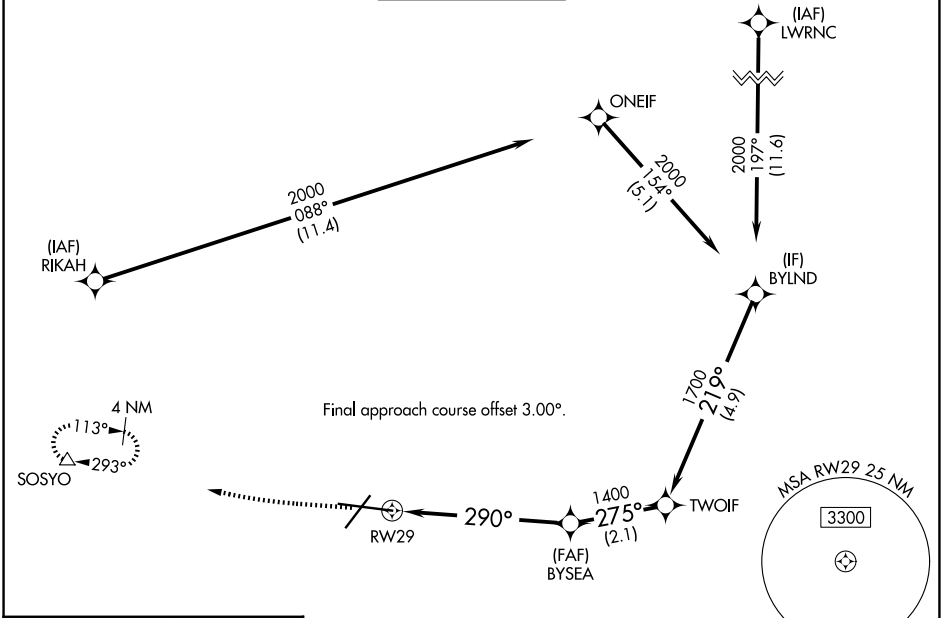

ELEV 132	<b>D</b>	TDZE 128
----------	----------	----------

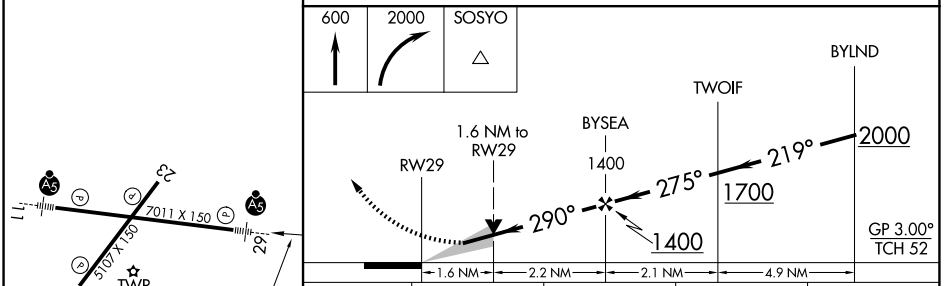

CATEGORY	A	B	C	D
LPV DA		378-½	250 (300-½)	
LNAV/VNAV DA		639-1	511 (600-1)	
LNAV MDA	700-½	572 (600-½)	700-¼	572 (600-¼)
CIRCLING	720-1	588 (600-1)	880-2¼ 748 (800-2¼)	920-2½ 788 (800-2½)

BEDFORD, MASSACHUSETTS  
Orig 27NOV25

42°28'N-71°17'W

LAURENCE G HANSCOM FLD (BED)  
**RNAV (GPS) RWY 29**

NE-1, 27 NOV 2025 to 25 DEC 2025

NE-1, 27 NOV 2025 to 25 DEC 2025