



Flight Procedures Cover Page	Task Action: P-NOTAM	Task Type: IAP	Estimated Chart Date: 09/03/2026	APWS Task ID: 835F7738FE4B45F9A3320DCA587BDDD7	APWS Project ID: 91166825AB1D48B8B231A9CADEB290CA
Procedure: RNAV (GPS) RWY 16 AMDT 1F		Enroute: NO	Specialist: Johnson, Timothy		Agreement Number:
Airport ID: KDAB			Airport City: DAYTONA BEACH		State: FL
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: Visibility Initiative (Garmin) - Update IAP visibility minimums IAW Order 8260.3, Chapter 3, Section 3-3. Visibility Minimums. PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021, SUBJECT: GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION/VALIDATION. CONTACT: CASEY HILL (405) 954-0624. QUALITY 6 SN 3/3/26 CHECKED QUALITY 41 CHECKED					

WAAS CH 45529 W16A	APP CRS 162°	Rwy Ldg TDZE 33 Apt Elev 34
--	------------------------	---

RNAV (GPS) RWY 16
DAYTONA BEACH INTL (DAB)

▼ Baro-VNAV NA below -15° C (5° F). DME/DME RNP-0.3 NA. Helicopter visibility reduction below ¾ SM NA.	MISSED APPROACH: Climb to 1700 direct KESLR and hold.
---	---

ATIS 132.875	DAYTONA APP CON 125.8 269.075	DAYTONA TOWER 120.7 257.8	GND CON 121.9 348.6
------------------------	---	-------------------------------------	-------------------------------

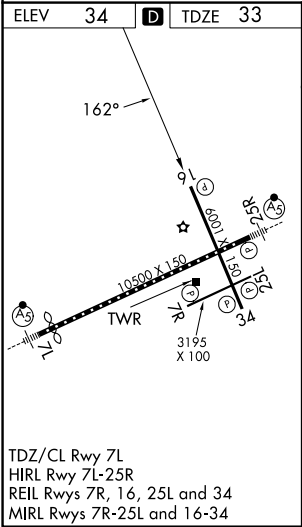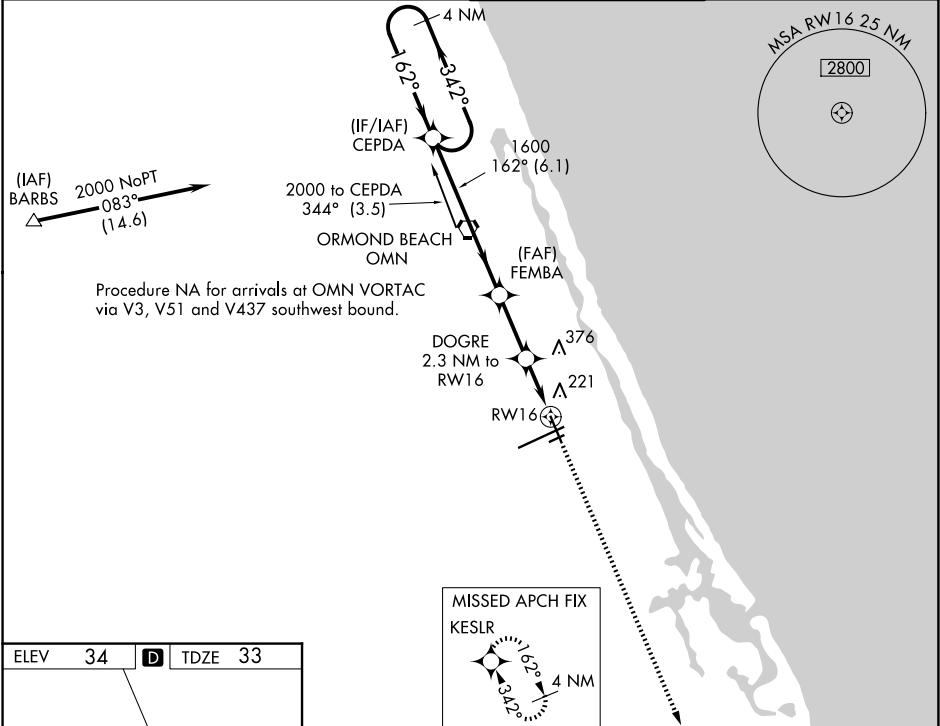

DAYTONA BEACH, FLORIDA
Amdt 1E 11AUG22

4 NM Holding Pattern CEPDA		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 50).		1700 KESLR
2000		162°		*LNAV only.
GP 3.00° TCH 45		162°		
1600		2.5 NM		
800		0.9 NM		
1.3 NM to RW16		1.3 NM		
CATEGORY	A	B	C	D
LPV DA	358-1¼		325 (400-1¼)	
LNAV/VNAV DA	479-1½		446 (500-1½)	
LNAV MDA	500-1	467 (500-1)	500-1¼ 467 (500-1¼)	500-1½ 467 (500-1½)
CIRCLING	540-1½	506 (600-1½)	680-1¾ 646 (700-1¾)	700-2 666 (700-2)

SE-3, 19 FEB 2026 to 19 MAR 2026

SE-3, 19 FEB 2026 to 19 MAR 2026