




GAVNN EIGHT ARRIVAL (RNAV) Transition Routes

COVINGTON, KENTUCKY

RNAV 1 - DME/DME/IRU or GPS.
RADAR required.

CINCINNATI APP CON
119.7 363.15 (090°-269°)
123.875 363.15 (270°-089°)
CVG D-ATIS
134.375
LUK ATIS
123.6

PROTOTYPE-NOT FOR NAVIGATION

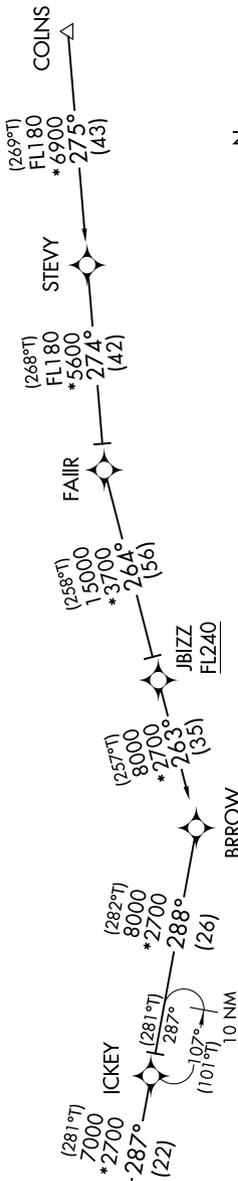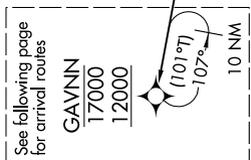

NOTE: Chart not to scale.

(CONTINUED ON FOLLOWING PAGE)

COLNS TRANSITION (COLNS.GAVNN8):
FAIR TRANSITION (FAIR.GAVNN8):

GAVNN EIGHT ARRIVAL (RNAV) Transition Routes

COVINGTON, KENTUCKY


GAVNN EIGHT ARRIVAL (RNAV) Arrival Routes

COVINGTON, KENTUCKY

CINCINNATI APP CON
 119.7 363.15 (090°-269°)
 123.875 363.15 (270°-089°)
 CVG D-ATIS
 134.375
 LUK ATIS
 123.6

NXHAL
 6000 210K
 006° (360°T)

RNAV 1 - DME/DME/IRU or GPS.
 RADAR required.

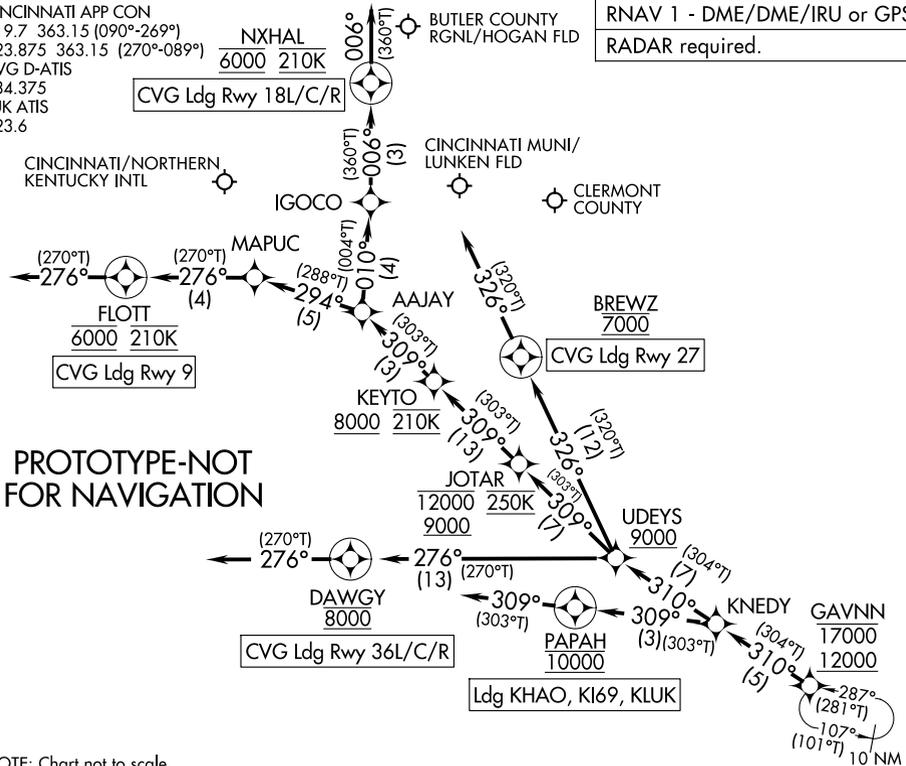

PROTOTYPE-NOT FOR NAVIGATION

NOTE: Chart not to scale.

ARRIVAL ROUTE DESCRIPTION

- CVG: From GAVNN on track 310° to KNEDY, then on track 310° to cross UDEYS at or above 9000.
- LANDING CVG RUNWAY 9: From UDEYS on track 309° to cross JOTAR between 9000 and 12000 and at 250K, then on track 309° to cross KEYTO at or above 8000 and at 210K, then on track 309° to AAJAY, then on track 294° to MAPUC, then on track 276° to cross FLOTT at 6000 and at 210K, then on track 276°. Expect RADAR vectors to final approach course for ILS, GPS, or RNP Rwy 9 approach.
- LANDING CVG RUNWAYS 18L/C/R: From UDEYS on track 309° to cross JOTAR between 9000 and 12000 and at 250K, then on track 309° to cross KEYTO at or above 8000 and at 210K, then on track 309° to AAJAY, then on track 010° to IGOCO, then on track 006° to cross NXHAL at 6000 and at 210K, then on track 006°. Expect RADAR vectors to final approach course for ILS, GPS, or RNP Rwy 18L/C/R approach.
- LANDING CVG RUNWAY 27: From UDEYS on track 326° to cross BREWZ at 7000, then on heading 340°. Expect RADAR vectors to final approach course for ILS, GPS, or RNP Rwy 27 approach.
- LANDING CVG RUNWAYS 36L/C/R: From UDEYS on track 276° to cross DAWGY at 8000, then on track 276°. Expect RADAR vectors to final approach course for ILS, GPS, or RNP Rwy 36L/C/R approach.
- LANDING I69/LUK/HAO: From GAVNN on track 310° to KNEDY, then on track 309° to cross PAPA at 10000, then on track 309°. Expect RADAR vectors to final approach course.