

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 09/03/2026	APWS Task ID: 878D298BB78D4B9DA1940D45210EE1EC	APWS Project ID: DB9D87FEE9B74029847D68C7E891972F
Procedure: RNAV (GPS) RWY 18 AMDT 3		Enroute: NO	Specialist: Denton, Hope		Agreement Number:
Airport ID: KIRK			Airport City: KIRKSVILLE		State: MO
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: UTILIZED ACTIVE DATA FOR KIRK AIRPORT AND RUNWAYS. CANCELS NOTAM FDC: 5/0478 REMOVED VDA, ADDED "CHART PROFILE NOTE: VISUAL SEGMENT - OBSTACLES", ADDED BACKUP ALTIMETER TO PROCEDURE. CONTACT CASIMIR TABAKA: AJV-A432, 405-202-7857. Digitally signed by TARA N MARTINELLI Jun 03, 2026 QUALITY 41 CHECKED QUALITY 37 CHECKED					

KIRKSVILLE, MISSOURI

AL-217 (FAA)

25275

APP CRS
177°

Rwy Ldg
TDZE
966

Apt Elev
966

RNAV (GPS) RWY 18

KIRKSVILLE RGNL (IRK)

RNP APCH.







Circling NA to Rwy 9 and 27.
Rwy 18 helicopter visibility reduction below $\frac{3}{4}$ SM

MISSED APPROACH: Climb to 3000 direct HOROK


ASOS
121.125

OLD

UNICOM
122.8 (CTAF) 0

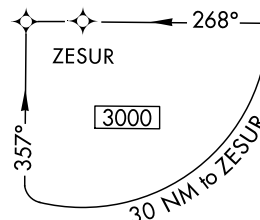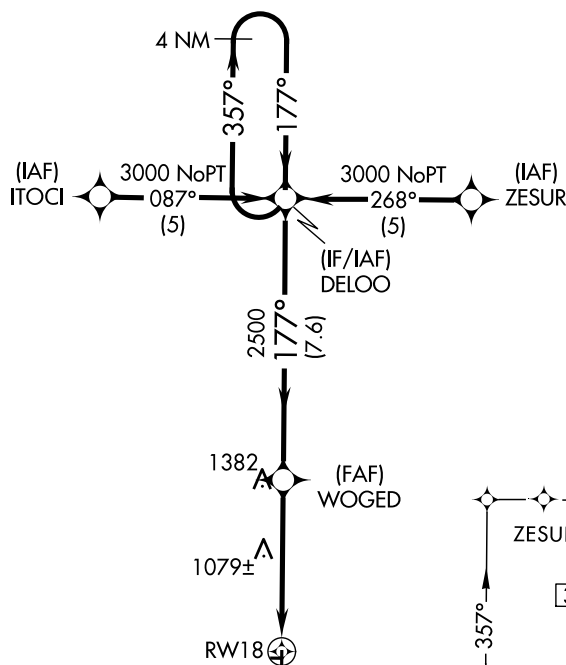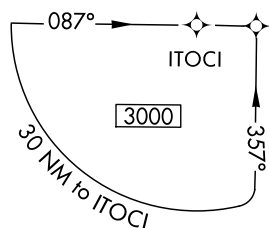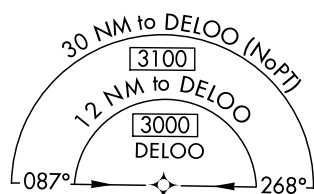


ELEV 966 **D** TDZE 966

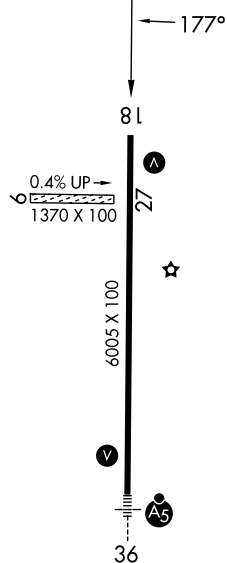


REIL Rwy 18 **0**
HIRL Rwy 18-36 **0**

MISSED APCH FIX



VGSI and descent angles not coincident
(VGSI Angle 3.00/TCH 33).

4 NM
Holding Pattern

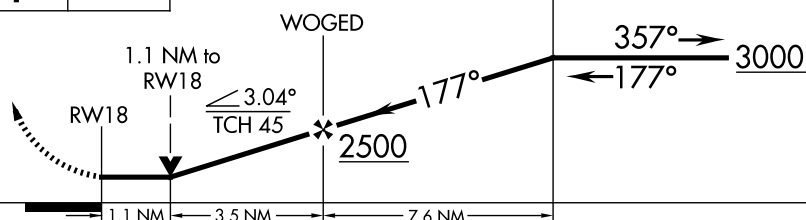

CATEGORY	A	B	C	D
LNAV MDA	1340-1	374 (400-1)	1340-1 $\frac{1}{4}$	374 (400-1 $\frac{1}{4}$)
CIRCLING	1400-1 434 (500-1)	1440-1 474 (500-1)	1460-1 $\frac{1}{2}$ 494 (500-1 $\frac{1}{2}$)	1540-2 574 (600-2)

KIRKSVILLE, MISSOURI

Amdt 2B 17JUN21

40°06'N-92°33'W

KIRKSVILLE RGNL (IRK)

RNAV (GPS) RWY 18

NC-3, 19 FEB 2026 to 19 MAR 2026

NC-3, 19 FEB 2026 to 19 MAR 2026