

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 09/05/2024	APWS Task ID: A1438A9DC59A4DCA87ED84B773469480	APWS Project ID: 2C7B00A8A3A34824B3F1563E2D8F71BB
Procedure: RNAV (RNP) X RWY 33L ORIG		Enroute: NO	Specialist: Tuttle, Judith		Agreement Number:
Airport ID: KBWI			Airport City: BALTIMORE		State: MD
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: ORIGINAL PROCEDURE. ACTIVE AIRPORT DATA USED FOR KBWI. CONTACT: ERIC SUSKI, 405.954.7331. Digitally signed by ERIC N SUSKI Jul 25, 2024 QUALITY 21 CHECKED QUALITY 9 CHECKED BEGUE					



[illegible]

APP CRS	Rwy Idg	8301
335°	TDZE	143
	Apt Elev	143

RNAV (RNP) X RWY 33L
BALTIMORE/WASHINGTON INTL THURGOOD MARSHALL (BWI)

RNP AR APCH - GPS, RF.		MALSR	MISSED APPROACH: Climb to 3000 direct BMORE and hold.	
▼ For uncompensated Baro-VNAV systems, procedure NA below -11°C or above 54°C.				

D-ATIS	119.0 127.8	POTOMAC APP CON (020°-100°) 119.7 290.475 (131°-180°) (101°-130°) 124.55 317.425 (181°-019°) 128.7 307.9	BALTIMORE TOWER	GND CON	CLNC DEL
			119.4 257.8	121.9	118.05

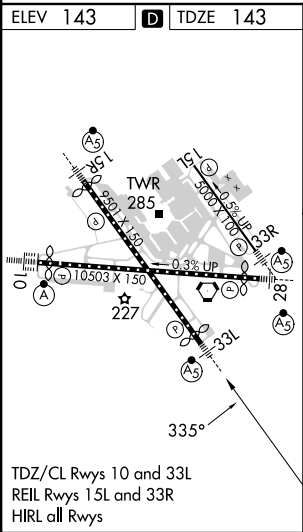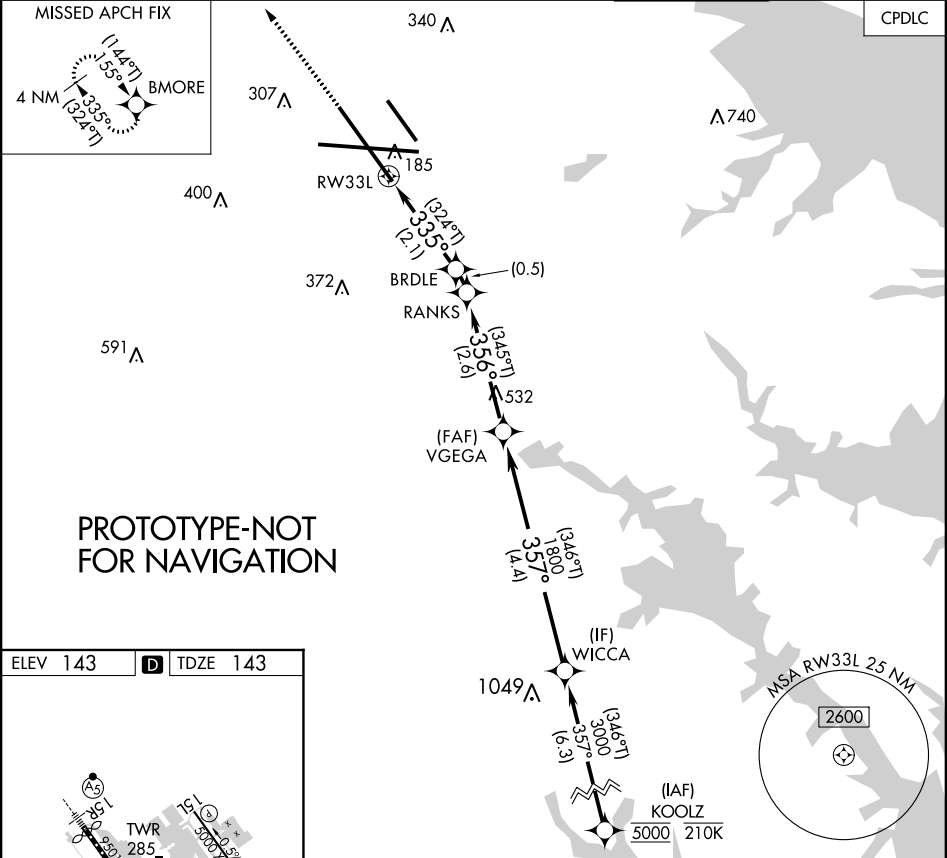

3000 ↑	BMORE 	VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 72).			WICCA
		BRDLE	RANKS	VGEA	3000
		839	986	1800	
		335°*	345°	356°	357°
		324°	345°	346°	
		2.1 NM	0.5 NM	2.6 NM	4.4 NM
CATEGORY	A	B	C	D	
RNP 0.30 DA*	479/26 336 (400-½)				
AUTHORIZATION REQUIRED					

BALTIMORE/WASHINGTON INTL THURGOOD MARSHALL (KBWI)
BALTIMORE, MD
RNAV RNP X RWY 33L ORIG
INITIAL, INTERMEDIATE, FINAL, MA, MA HOLDING
1:500K
FINAL ASC



BALTIMORE/WASHINGTON INTL THURGOOD MARSHALL (KBWI)
BALTIMORE, MD
RNAV RNP X RWY 33L ORIGINAL, MA
1:100K

