

Flight Procedures Cover Page	Task Action: P-NOTAM	Task Type: IAP	Estimated Chart Date: 05/14/2026	APWS Task ID: B6942E6BE8DF44A28F647638C0A35281	APWS Project ID: F7E039C4E34D49669E826FF4E2E0953D
Procedure: RNAV (GPS) RWY 18 AMDT 0C		Enroute: NO	Specialist: Johnson, Timothy		Agreement Number:
Airport ID: 1F4			Airport City: MADILL		State: OK
Facility ID:	Facility Type:	Flight Inspection Remark Type:			

Procedure Comments:

Visibility Initiative (Garmin) - Update IAP visibility minimums IAW Order 8260.3, Chapter 3, Section 3-3. Visibility Minimums.

PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021, SUBJECT: GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION/VALIDATION.

CONTACT: CASEY HILL (405) 954-0624.




APP CRS	Rwy Idg	3005
180°	TDZE	890
	Apt Elev	890

RNAV (GPS) RWY 18


MADILL MUNI (1F4)

RNP APCH.
 Use Ardmore Downtown Exec altimeter setting when not received, use Mc Alester Rgnl altimeter setting and increase all MDA 140 feet. Procedure NA at night. Rwy 18, helicopter visibility reduction below 1 SM NA.
 MISSED APPROACH: Climbing right turn to 2600 direct ADM VORTAC and hold.

1F0 AWOS-3 118.15	FORT WORTH CENTER 124.75 323.0	CTAF 122.9
-----------------------------	--	----------------------

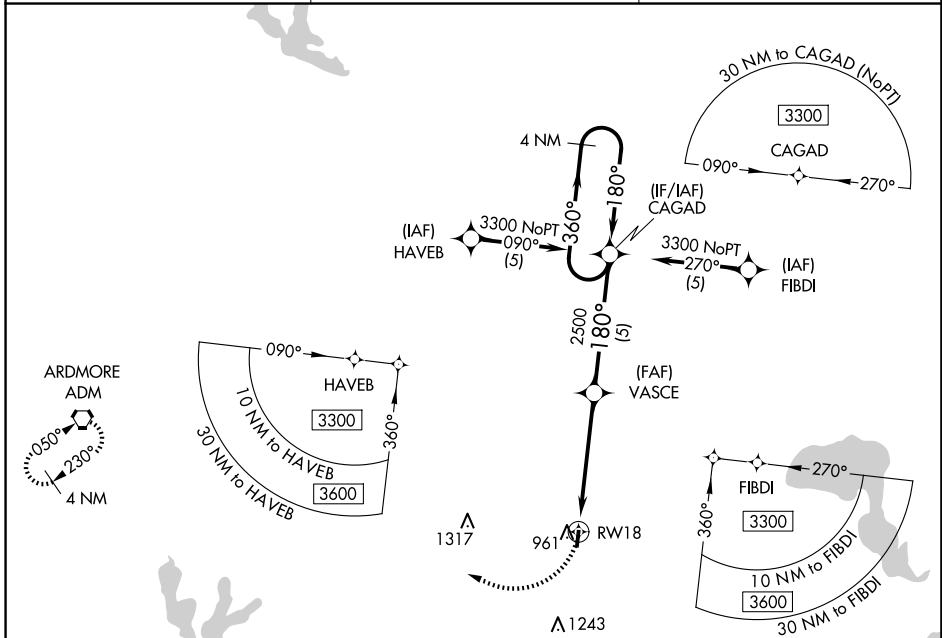

ELEV 890	TDZE 890
----------	----------

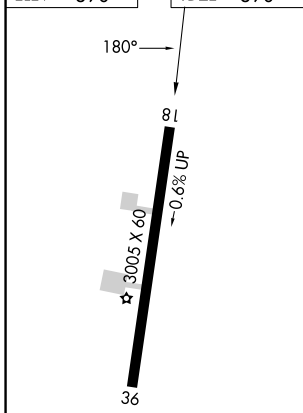

MIRL Rwy 18-36	REIL Rwy 18 and 36		
2600 ADM	CAGAD 4 NM Holding Pattern		
VASCE 2500	360° 180° 3300		
RWY 18	3.01° TCH 40		
5 NM	5 NM		
CATEGORY A	B	C	D
LNAV MDA	1320-1	430 (500-1)	
CIRCLING	1360-1 470 (500-1)	1500-1 610 (700-1)	NA

SC-1, 22 JAN 2026 to 19 FEB 2026

SC-1, 22 JAN 2026 to 19 FEB 2026