


Flight Procedures Cover Page	Task Action: Abbreviated Amendment	Task Type: IAP	Estimated Chart Date: 09/03/2026	APWS Task ID: E68702D16F8F458B9D451F80717B0DA4	APWS Project ID: C7402389ECC845D39189A9871D569CD3
Procedure: RNAV (RNP) Z RWY 24 AMDT 0B		Enroute: NO	Specialist: Johnson, Timothy		Agreement Number:
Airport ID: KROA			Airport City: ROANOKE		State: VA
Facility ID:	Facility Type:	Flight Inspection Remark Type:			
Procedure Comments: ACTIVE DATA USED. FIX NAME CHANGE FROM FUDDZ TO JFSOC. UPDATE RNP 0.30 VISIBILITY ALL CATS. PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021, SUBJECT: GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION/VALIDATION. CONTACT: CASEY HILL (405) 954-0624. QUALITY 23 CHECKED QUALITY 39 CHECKED					

APP CRS	Rwy Ldg	6010
238°	TDZE	1170
	Apt Elev	1175


RNAV (RNP) Z RWY 24
ROANOKE/BLACKSBURG RGNL (WOODRUM FLD) (R.O.A)

RNP AR APCH - GPS.	MISSED APPROACH: Climb to 4000 direct JAYYT and on track 149° to TPUCK and on track 107° to MONAT and hold. # Missed approach requires minimum climb of 230 feet per NM to 3200.
For uncompensated Baro-VNAV systems, procedure NA below -14°C or above 54°C.	

ATIS 132.375	ROANOKE APP CON 133.225 339.8	ROANOKE TOWER 118.3 257.8	GND CON 121.9 257.8
-----------------	----------------------------------	------------------------------	------------------------

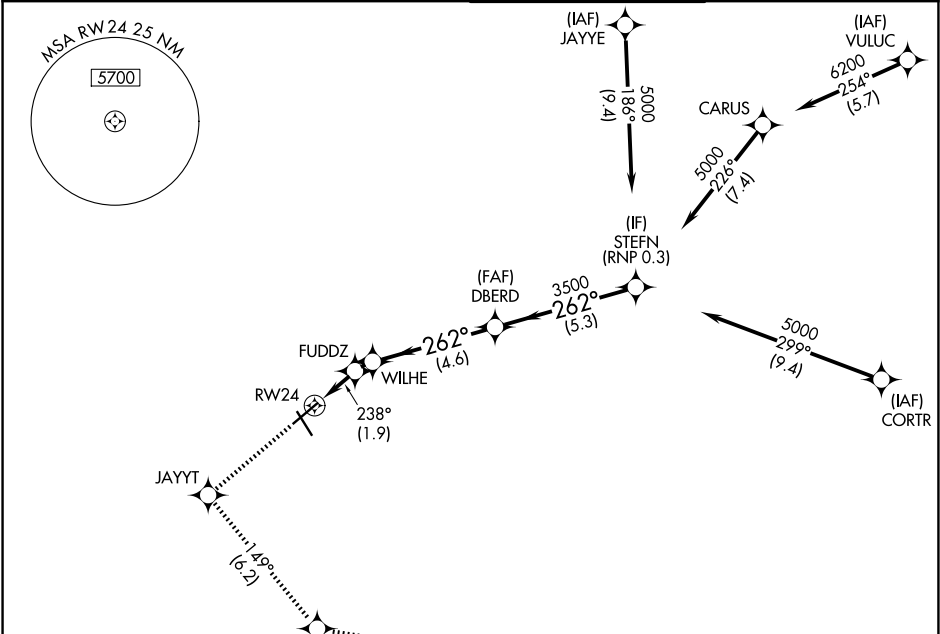

ELEV 1175	TDZE 1170
-----------	-----------

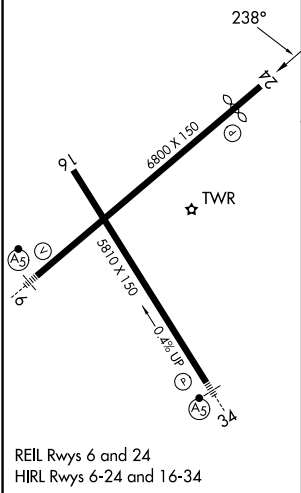

4000	JAYYT	tr 149°	TPUCK	tr 107°	MONAT
	FUDDZ	WILHE	DBERD	STEFN	
	1815	2045	3500	5000	
			3500		
	1.9 NM	0.7 NM	4.6 NM	5.3 NM	
CATEGORY	A	B	C	D	
# RNP 0.15 DA	1491-1	321 (400-1)			
RNP 0.30 DA	1633-1 1/8	463 (500-1 1/8)			
AUTHORIZATION REQUIRED					