

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 03/19/2026	APWS Task ID: F0860591CE8547ED90C37AEBF6165377	APWS Project ID: 2C3BEF9B12CD4BE3861FC640A194ADFA
Procedure: RNAV (GPS) RWY 36 AMDT 0A		Enroute: NO	Specialist: Dumar, Ralph		Agreement Number:
Airport ID: 61A			Airport City: CAMDEN		State: AL
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			

Procedure Comments:
 ABBREVIATED AMENDMENT
 PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021 GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION/VALIDATION

AIRPORT ACTIVE DATA USED.

REMARKS: PROJECT TO CLEAR FDC NOTAM 5/3461
 CONTACT RAKE MCGRAW (AJV-A422)- 405-954-8711

QUALITY
9
CHECKED
BEGUE

QUALITY
13
CHECKED

APP CRS	Rwy Idg	4303
002°	TDZE	142
	Apt Elev	143






RNAV (GPS) RWY 36

CAMDEN MUNI (61A)

▼ Helicopter visibility reduction below 1 SM NA. DME/DME RNP-0.3 NA.
▲ NA Procedure NA at night. Use Selma altimeter setting; when not received, use Marion altimeter setting and increase all MDA 20 feet.

MISSED APPROACH: Climb to 900 then climbing right turn to 3500 direct JOLUM and hold.

SEM AWOS-3PT 119.15	ATLANTA CENTER 120.55 270.25	CTAF 122.9 0
-------------------------------	----------------------------------------	------------------------

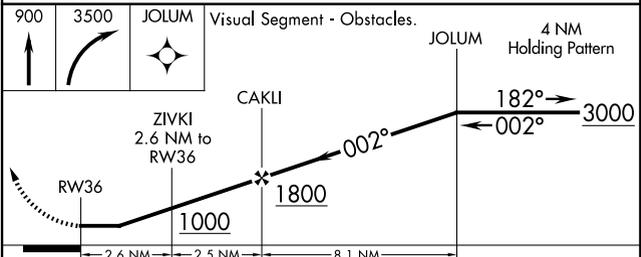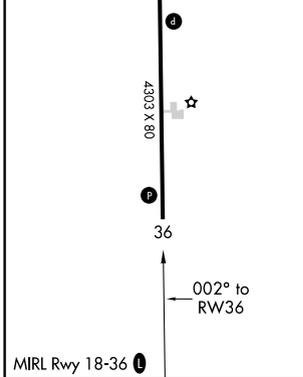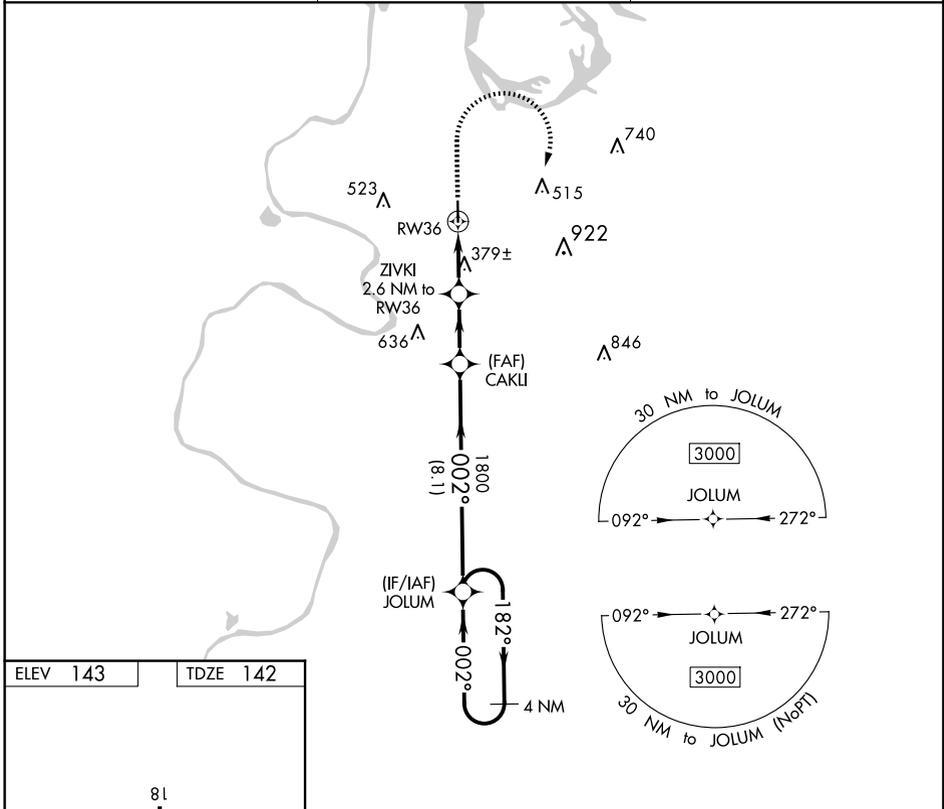

CATEGORY	A	B	C	D
LNAV MDA	700-1	558 (600-1)	700-1½	558 (600-1½)
C CIRCLING	720-1 577 (600-1)	780-1 637 (700-1)	900-2¼ 757 (800-2¼)	1060-3 917 (1000-3)