

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: IAP	Estimated Chart Date: 07/09/2026	APWS Task ID: FA6F0E079A614E1AB91A11CB8157AD37	APWS Project ID: 26E9DDB8187D4A1B8B657A587849854E
Procedure: VOR-A AMDT 8		Enroute: NO	Specialist: Gorman, Barbara		Agreement Number:
Airport ID:			Airport City: PRINCETON/ROCKY HILL		State: NJ
Facility ID: SBJ	Facility Type: VOR_DME	Flight Inspection Remark Type: New FC Slot			
Procedure Comments: ACTIVE DATA USED FOR AIRPORT AND RUNWAYS. CONTACT: CASIMIR TABAKA 405.954.7931 05/11/2026: THIS IS A CORRECTED COPY OF THE FORM APPROVED ON 04/27/2026. 8260-3: PROFILE LINE 4: ADDED SBJ VOR/DME 2300, DFRTZ INT/7.20 DME 1800.					






VOR/DME SBJ	APP CRS	Rwy Idg TDZE	N/A
112.9	171°	Apt Elev	N/A
Chan 76			128

VOR-A
PRINCETON (39N)

DME required.	MISSED APPROACH: Climbing left turn to 2300 direct SBJ VOR/DME and hold.
NA Circling Rwy 28 NA at night. Use Trenton altimeter setting; when not received, use Somerville altimeter setting.	

TTN ASOS 126.775	NEWARK APP CON 132.8 379.9	UNICOM 122.725 (CTAF)	123.05 0
---------------------	-------------------------------	--------------------------	----------

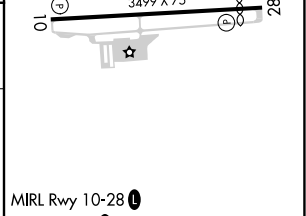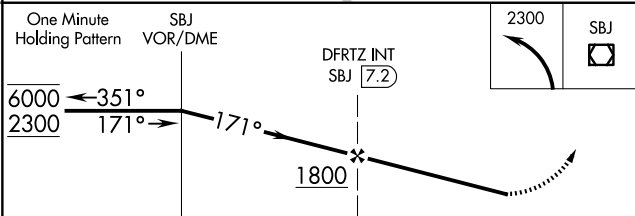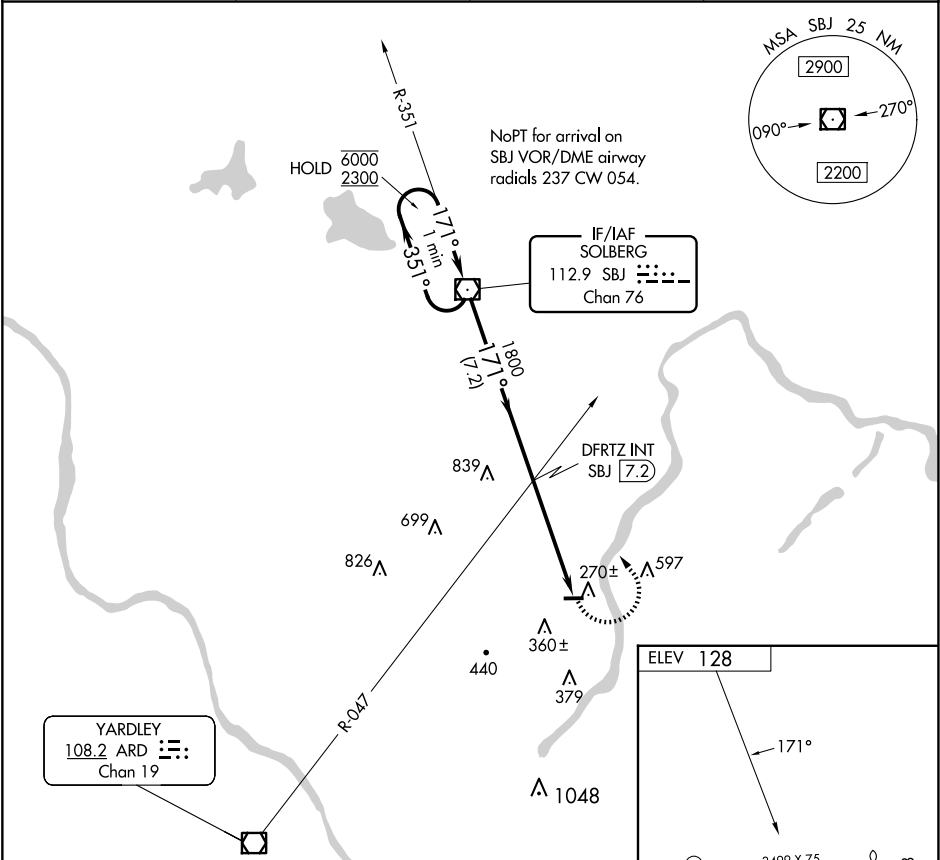

CATEGORY	A	B	C	D	FAF to MAP 4.4 NM
CIRCLING	1040-1 1/4	912 (1000-1 1/4)	NA		Knots 60 90 120 150 180 Min:Sec 4:24 2:56 2:12 1:46 1:28