



Flight Procedures Cover Page	Task Action: Abbreviated Amendment	Task Type: IAP	Estimated Chart Date: 12/26/2024	APWS Task ID: FDEDB73D14A34CF39DCF7A915421AEC8	APWS Project ID: 529F816CAFBC4E1194E765A95729C679
Procedure: NDB RWY 4 AMDT 0B		Enroute: NO	Specialist: Feronti, Tia		Agreement Number:
Airport ID: KCJR			Airport City: CULPEPER		State: VA
Facility ID: MSQ	Facility Type: NDB	Flight Inspection Remark Type:			
Procedure Comments: PROCESSED IAW TECHNICAL SUPPORT GROUP (AJF-17) MEMO DATED 07/07/2021 GUIDANCE FOR PROCEDURAL CHANGES REQUIRING FLIGHT INSPECTION/VALIDATION. DAVID DANNER, AJV-A420: 405-954-5077.					



NDB MSQ	APP CRS	Rwy Idg	5000
351	037°	TDZE	316
		Apt Elev	316

NDB RWY 4
CULPEPER RGNL (CJR)

T A		MISSED APPROACH: Climbing left turn to 3000 direct CSN VORTAC and hold, continue climb-in-hold to 3000.	
AWOS-3 119.325	POTOMAC APP CON 128.525 306.925	CLNC DEL 121.6	UNICOM 123.075 (CTAF) L

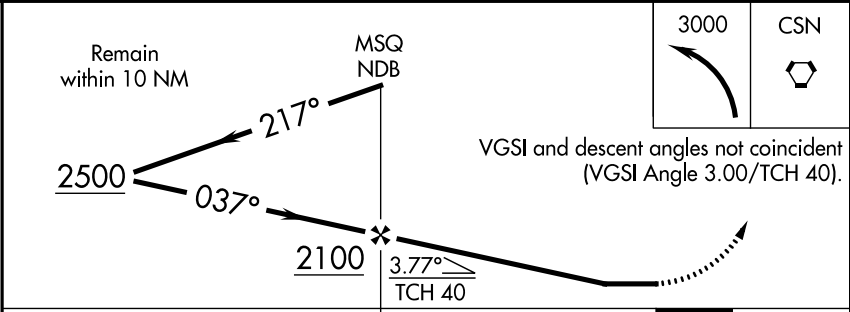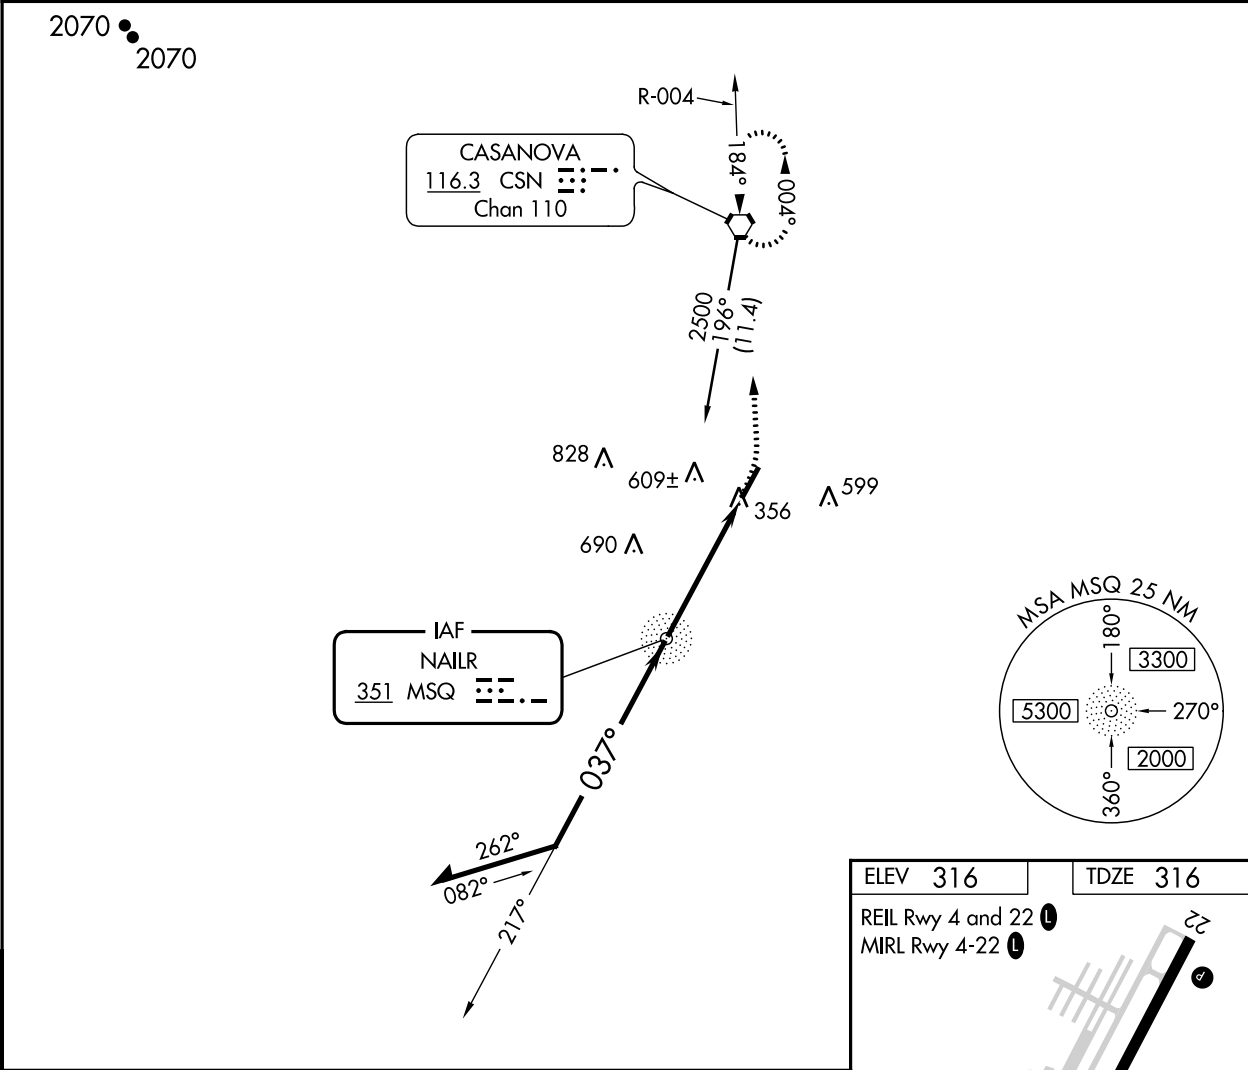

ELEV 316	TDZE 316
REIL Rwy 4 and 22 L	
MIRL Rwy 4-22 L	
FAF to MAP 4.4 NM	
Knots	60 90 120 150 180
Min:Sec	4:24 2:56 2:12 1:46 1:28

CATEGORY	A	B	C	D
S-4	920-1 604 (700-1)	920-1 3/4 604 (700-1 3/4)	NA	
CIRCLING	920-1 604 (700-1)	960-1 644 (700-1)	960-1 3/4 644 (700-1 3/4)	NA