


| | | |
|--------------------------------------|------------------------|---|
| LOC I-LCH 109.1 Chan 28 | APP CRS 332° | Rwy Idg TDZE 11 Apt Elev 15 |
|--------------------------------------|------------------------|---|

LOC BC RWY 33

LAKE CHARLES RGNL (LCH)



| | | |
|---|------------------|--|
| ASR For inop MALSF, increase S-33 Cat D visibility to 1¼ mile. For inop MALSF, increase ZEGUP Fix Minimums S-33 Cats C and D visibility to 7/8 mile. | MALSF | MISSED APPROACH: Climb to 1000 then climbing right turn to 2000 direct LCH VORTAC and hold. |
|---|------------------|--|

| | | | | | |
|------------------------------|--|---|--------------------------------|----------------------------------|--------------------------------|
| ATIS 118.75 | LAKE CHARLES APP CON* 119.35 353.75 | LAKE CHARLES TOWER* 120.7 (CTAF) 257.8 | GND CON 121.8 | CLNC DEL 126.25 | UNICOM 122.95 |
|------------------------------|--|---|--------------------------------|----------------------------------|--------------------------------|

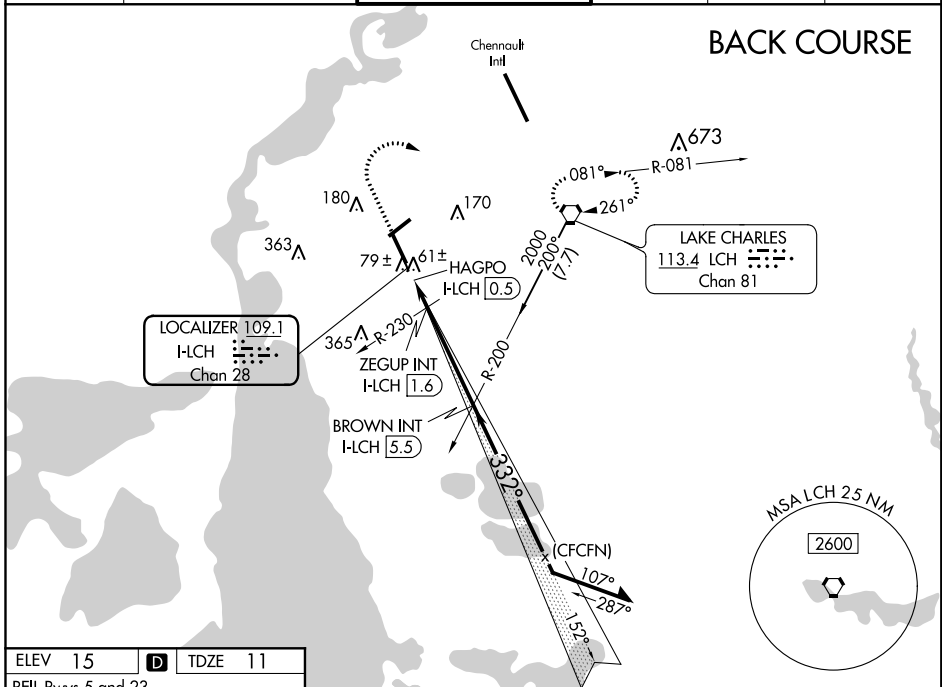

| | | |
|---------|----------|---------|
| ELEV 15 | D | TDZE 11 |
|---------|----------|---------|

REIL Rwy 5 and 23
MIRL Rwy 5-23
HIRL Rwy 15-33

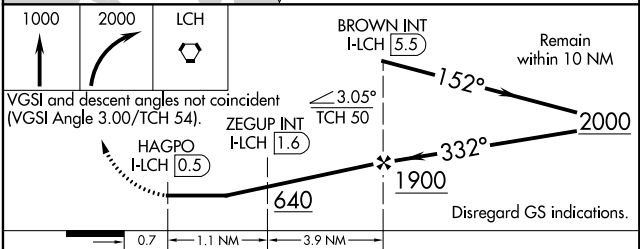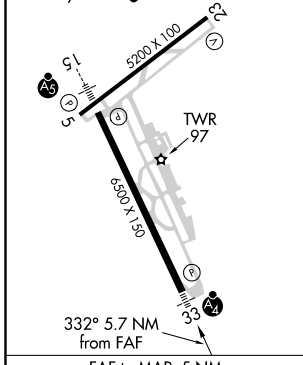

| CATEGORY | A | B | C | D |
|--|-------------|-------------|--------------|--------------|
| S-33 | 640-¾ | 629 (700-¾) | 640-1½ | 629 (700-1½) |
| C CIRCLING | 640-1 | 625 (700-1) | 640-1¾ | 680-2 |
| | | | 625 (700-1¾) | 665 (700-2) |
| ZEGUP FIX MINIMUMS (DUAL VOR RECEIVERS OR DME REQUIRED) | | | | |
| S-33 | 320-¾ | | 309 (400-¾) | |
| C CIRCLING | 440-1 | 480-1 | 580-1½ | 680-2 |
| | 425 (500-1) | 465 (500-1) | 565 (600-1½) | 665 (700-2) |

SC-4, 16 JUL 2020 to 13 AUG 2020

SC-4, 16 JUL 2020 to 13 AUG 2020