


LOC/DME I-CLL
110.55
Chan **42**(Y)

APP CRS
166°

Rwy Idg
TDZE
Apt Elev
7000
321
321

LOC BC RWY 17
EASTERWOOD FLD (CLL)

DME required.		MISSED APPROACH: Climb to 2000 on heading 166° and CLL R-127 to HEDIX/CLL 14 DME and hold.				
▼ ▲ Rwy 17 helicopter visibility reduction below ¾ SM NA.						
ATIS 126.85	HOUSTON APP CON 134.3 360.85	EASTERWOOD TOWER ★ 118.5 (CTAF) 284.7	GND CON 128.7 284.7	CLNC DEL 128.7	CLNC DEL 120.4 (when twr closed)	UNICOM 122.95

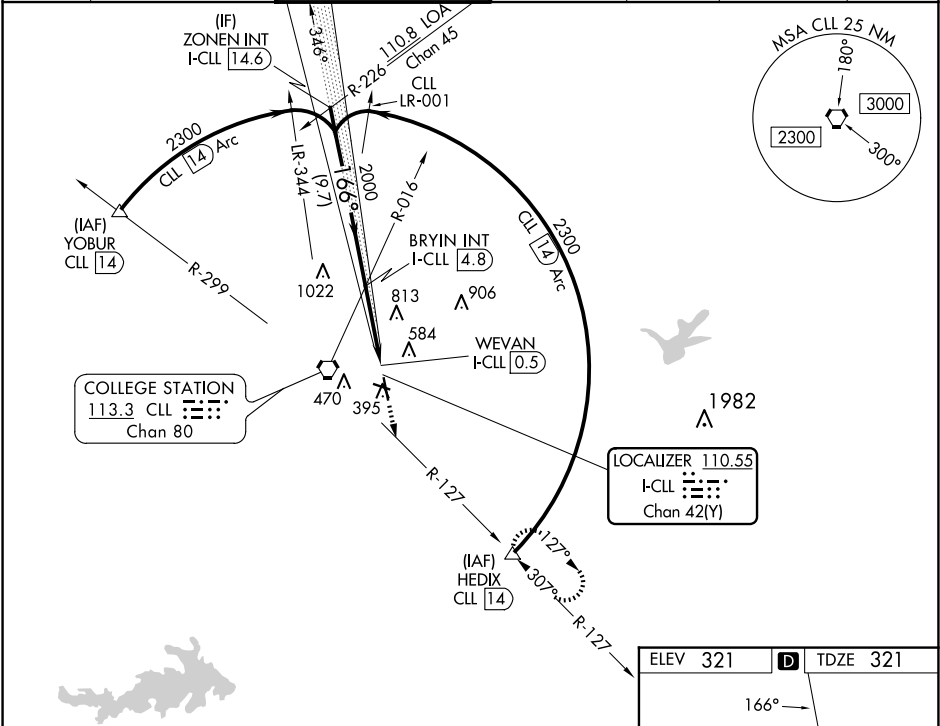

BACK COURSE

Use I-CLL DME when on the localizer course.

2300

166°

2000

Disregard glideslope indications.

9.7 NM

3.3 NM

1 NM

0.7

2000

hdg 166° and CLL R-127

HEDIX

WEVAN I-CLL 0.5

I-CLL 1.5

3.04° TCH 51

BRYIN INT I-CLL 4.8

ZONEN INT I-CLL 14.6

CATEGORY	A	B	C	D	E
S-LOC 17	940-1	619 (700-1)	940-1¾	619 (700-1¾)	
CIRCLING	940-1	619 (700-1)	1000-2 679 (700-2)	1180-2¾ 859 (900-2¾)	1180-3 859 (900-3)

ELEV 321

D

TDZE 321

REIL Rwy 29

MIRL Rwy 11-29

HIRL Rwy 17-35

FAF to MAP 4.3 NM

Knots	60	90	120	150	180
Min:Sec	4:18	2:52	2:09	1:43	1:26