


25051


ILS or LOC RWY 27R
HARTSFIELD/JACKSON ATLANTA INTL (ATL)

MISSED APPROACH: Climb to 1500 then climbing left turn to 4000 on heading 265° and RMG VORTAC R-165 to DUTIE/RMG 31.3 DME/RADAR and hold.


1154 R R161 Chen	MISSED APCH FIX	MSA ATL 25 NM	CLNC DEL 118.1	CPDLC
------------------------	--------------------	---------------	-----------------------------	-------

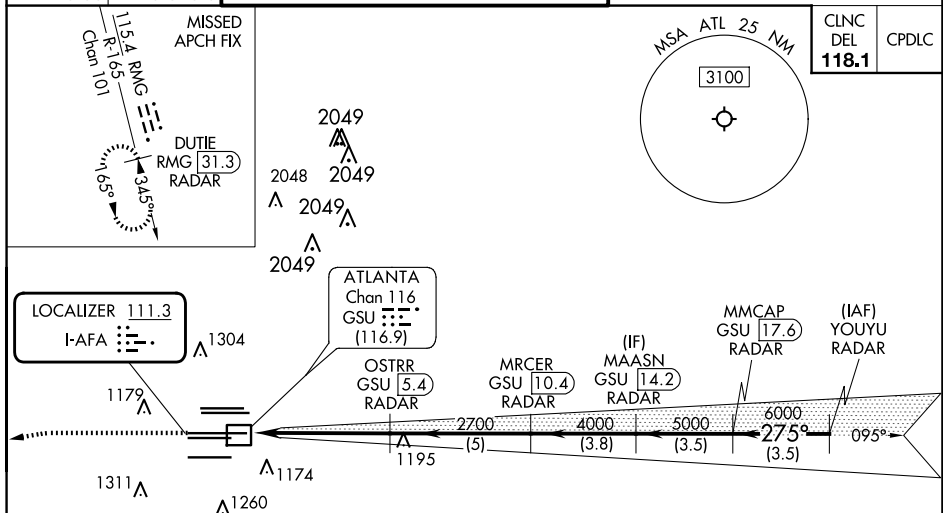

1500 ↑	4000 hdg 265°	RMG R-165	DUTIE RMG 31.3
-----------	---------------------	--------------	----------------------

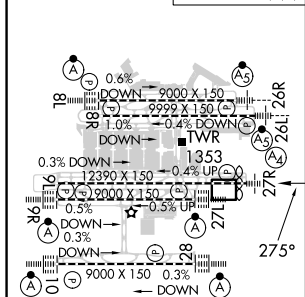

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 72).

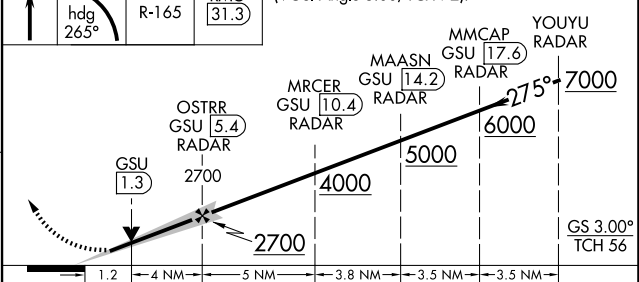

CATEGORY	A	B	C	D
S-ILS 27R	1185/40 200 (200-¾)			
S-LOC 27R	1420/40 435 (400-¾)	1420/50 435 (400-1)		
SIDESTEP 27L	1420/55 421 (400-1)			1420-1½ 421 (400-1½)

HARTSFIELD/JACKSON ATLANTA INTL (ATL)

33°38'N-84°26'W

ILS or LOC RWY 27R

SE-4. 17 APR 2025 to 15 MAY 2025