


ILS or LOC RWY 36R
CHARLOTTE/DOUGLAS INTL (CLT)

MISSED APPROACH: Climb to 1320 then climbing right turn to 4000 on CLT VOR/DME R-093 to LOCAS INT/24.9 DME and hold.

CHARLOTTE
115.0 CLT 
Chan 97

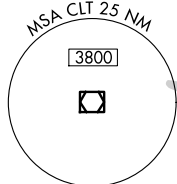

RADAR REQUIRED

VGS and ILS glidepath not coincident (VGS Angle 3.00/TCH 74).

CLT R-093 LOCAS CLT 24.9

HAYOU I-BQC 6.9 RADAR

CIKDU I-BQC 8.5 RADAR

JENDA I-BQC 17.9 RADAR

HEKAM I-BQC 14.8 RADAR

003°

6000

5000

4000

3000

2500

2500

GS 3.00° TCH 55

1 NM 4.4 NM 1.6 NM 3.2 NM 3.2 NM 3.2 NM

CATEGORY

A B C D

S-ILS 36R 927/18 200 (200-½)

S-LOC 36R 1120/24 393 (400-½) 1120/35 393 (400-¾)

CIRCLING 1380-1 632 (700-1) 1500-2¼ 752 (800-2¼) 1500-2½ 752 (800-2½)

SE-2, 17 APR 2025 to 15 MAY 2025