
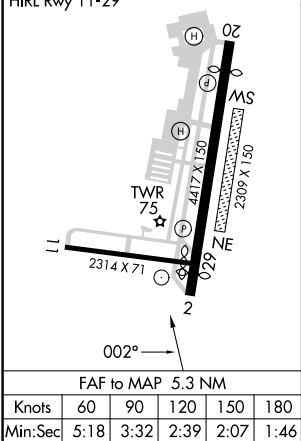


LOC I-HFD 109.7	APP CRS 002°	Rwy Idg TDZE Apt Elev 4006 17 18
---------------------------	------------------------	--

LDA RWY 2
HARTFORD-BRAINARD (HF'D)

▼ ▲	Helicopter visibility reduction below 1 SM NA. Night landing: Rwy 11, 20, 29 NA. Night landing: Rwy 2 operational VGSI required, remain on or above VGSI glidepath until threshold.	MISSED APPROACH: Climbing right turn to 2500 on heading 090° and PUT VOR/DME R-265 to RAMBO INT and hold.
--------	---	---

ATIS 126.45	BRADLEY APP CON 127.8 269.325	BRAINARD TOWER ★ 119.6 (CTAF) 0 248.2	GND CON 121.6	CLNC DEL 121.6	UNICOM 122.95
-----------------------	---	---	-------------------------	--------------------------	-------------------------

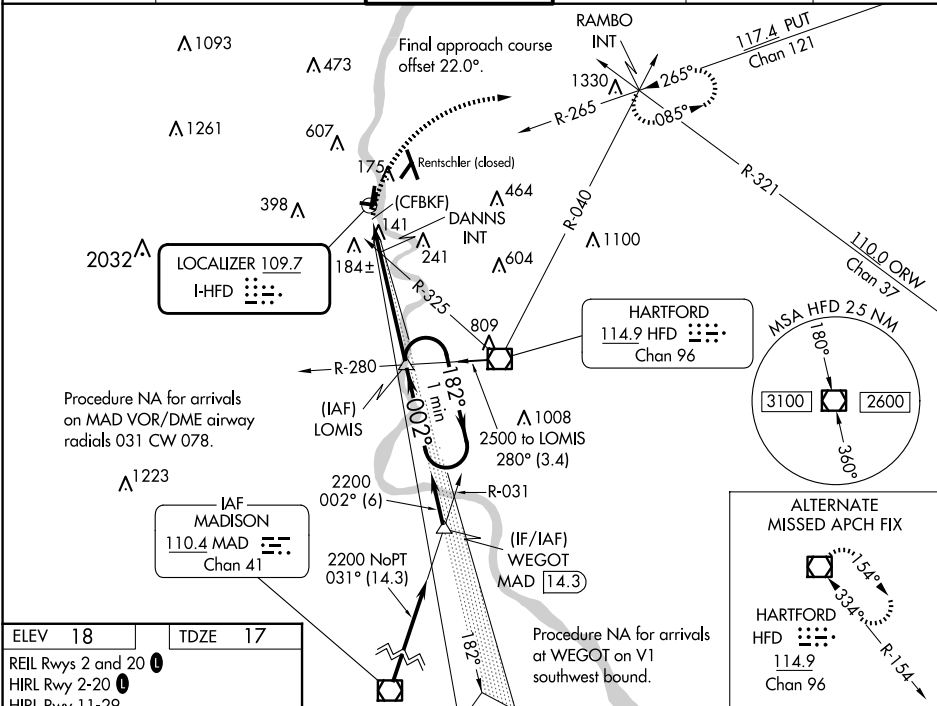

2500	PUT R-265	RAMBO INT	VGSI and descent angles not coincident (VGSI Angle 4.00/TCH 42).	One Minute Holding Pattern
LOMIS				
DANNIS INT				
(CFBKF)				
2200				
182°				
002°				
3.47°				
TCH 45				
0.5 1.2 NM 4.1 NM				
CATEGORY	A	B	C	D
S-2	680-1	663 (700-1)	680-1 7/8	663 (700-1 7/8)
CIRCLING	680-1	900-1 1/4	920-2 3/4	920-3
	662 (700-1)	882 (900-1 1/4)	902 (1000-2 3/4)	902 (1000-3)
DANNIS FIX MINIMUMS (DUAL VOR RECEIVERS REQUIRED)				
S-2	460-1	443 (500-1)	460-1 1/8	443 (500-1 1/8)
CIRCLING	580-1	900-1 1/4	920-2 3/4	920-3
	562 (600-1)	882 (900-1 1/4)	902 (1000-2 3/4)	902 (1000-3)