


APP CRS	Rwy Idg	10000
116°	TDZE	9
	Apt Elev	9


RNAV (RNP) Z RWY 12
SAN FRANCISCO BAY OAKLAND INTL (OAK)

RNP AR APCH.	MALSR	MISSED APPROACH: Climb direct HISIS to cross HISIS at or below 1600 then climb to 5400 on track 116° to YICPU and on track 103° to DECOT and hold, continue climb-in-hold to 5400.
For uncompensated Baro-VNAV systems, procedure NA below 0°C or above 54°C. For inop ALS increase RNP 0.15 visibility all Cats to RVR 4500, RNP 0.30 visibility all Cats to RVR 5500.		


D-ATIS	NORCAL APP CON	OAKLAND TOWER	GND CON	CLNC DEL	CPDLC
133.775	125.35 263.15	118.3 291.65 (Rwys 10L/R-28L/R, 15-33) 127.2 256.9 (Rwy 12-30)	121.9 (Rwys 10L/R-28L/R, 15-33) 121.75 (Rwy 12-30)	121.1	

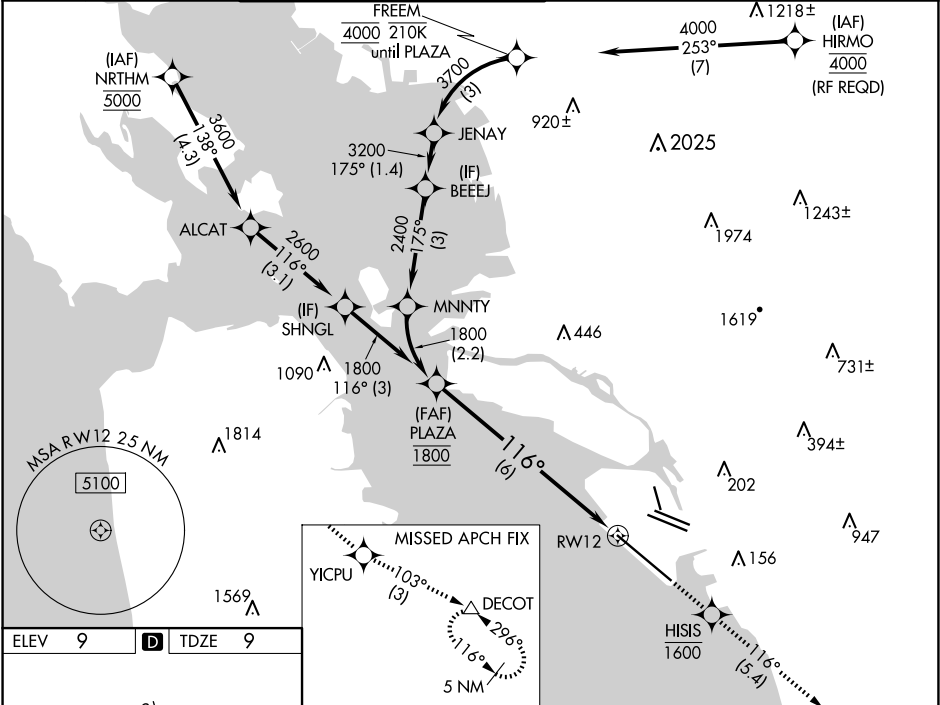

ELEV	9	TDZE	9
------	---	------	---

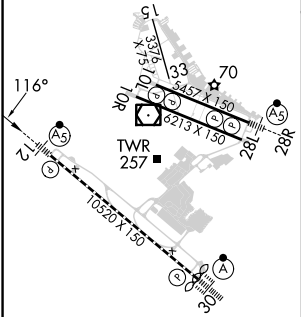

REIL Rwy 10R
TDZ/CL Rwy 30
MIRL Rwy 15-33
HIRL Rwys 12-30, 10L-28R, 10R-28L

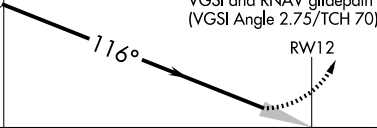See planview for multiple IF locations.																													
PLAZA					1800					1600					tr 116°					tr 103°									
VGSI and RNAV glidepath not coincident (VGSI Angle 2.75/TCH 70).																													
<u>1800</u>																													
GP 2.75° TCH 55																													
CATEGORY					A					B					C					D									
RNP 0.15 DA					289/24 280 (300-½)																								
RNP 0.30 DA					386/35 377 (400-⅔)																								
AUTHORIZATION REQUIRED																													

SW-2, 17 APR 2025 to 15 MAY 2025

SW-2, 17 APR 2025 to 15 MAY 2025