

ILS or LOC RWY 35
GREELEY-WELD COUNTY (GXY)



MISSED APPROACH: Climb to 5300 then climbing right turn to 7000 on heading 120° and GLL VOR/DME R-136 to CEDUK INT/GLL 16 DME and hold.

Diagram illustrating a radio navigation fix involving three stations:


- LOCALIZER 110.3** (I-DCI) on Chan 40
- GILL 114.2** (GLL) on Chan 89
- KROMM CYS 26.3**

The diagram shows the relative positions and distances between these stations, including bearings (e.g., 154°, 334°) and distances (e.g., 5016 A, 4742 ± A, 4882 A, 7000, 177° (17.5), 4685 ±). A note indicates "ALTERNATE MISSED APCH FIX".

DME or RADAR REQUIRED

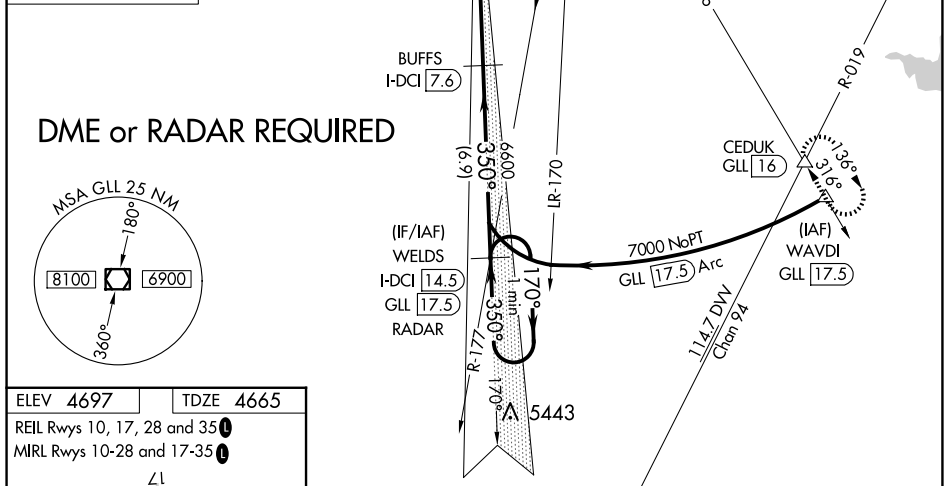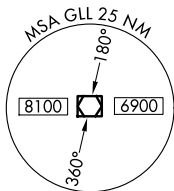

REIL Rwys 10, 17, 28 and 35 
MIRL Rwys 10-28 and 17-35 

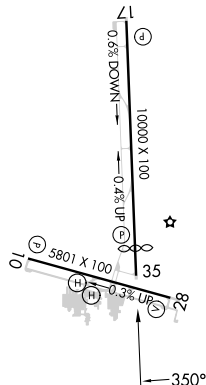

5300  7000  hdg 120° GLL R-136 CEDUK 	Use I-DCI DME when on the localizer course. WELDS I-DCI 14.5 One Minute Holding Pattern RADAR			
LOC only ARTSS I-DCI 3.7 I-DCI 1.6 I-DCI 2.9 5360 6600 6600 170° 350° GS 3.00° TCH 51'	BUFFS I-DCI 7.6 6600 350° 170° 7000 6.9 NM 3.9 NM 0.8 1.2			
CATEGORY	A		B	C
S-ILS 35	4865- ³ / ₄ 200 (200- ³ / ₄)			
S-LOC 35	5100-1 435 (500-1)		5100-1 ¹ / ₄ 435 (500-1 ¹ / ₄)	
C CIRCLING	5120-1 423 (500-1)	5200-1 503 (600-1)	5200-1 ¹ / ₂ 503 (600-1 ¹ / ₂)	5380-2 ¹ / ₄ 683 (700-2 ¹ / ₄)

SW-1, 17 APR 2025 to 15 MAY 2025