

HOQUIAM, WASHINGTON

AL-889 (FAA)

24305

WAAS CH 86902 W24A	APP CRS 241°	Rwy Idg 5000 TDZE 16 Apt Elev 18
--	------------------------	---

RNAV (GPS) RWY 24

BOWERMAN FLD (HQM)


T For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -6°C (22°F) or above 43°C (109°F). When local altimeter setting not received, procedure NA. Circling NA northwest of Rwy 6-24. DME/DME RNP-0.3 NA. For inoperative MALSR, increase LPV Cat C visibility to ¾ mile and LNAV Cat C visibility to 2½ miles.

MALSR




MISSED APPROACH:
Climb to 2600 direct
ZUNAD and hold.

ASOS 135.775	SEATTLE CENTER 128.3 269.0	UNICOM 122.7 (CTAF) 0
------------------------	--------------------------------------	---------------------------------

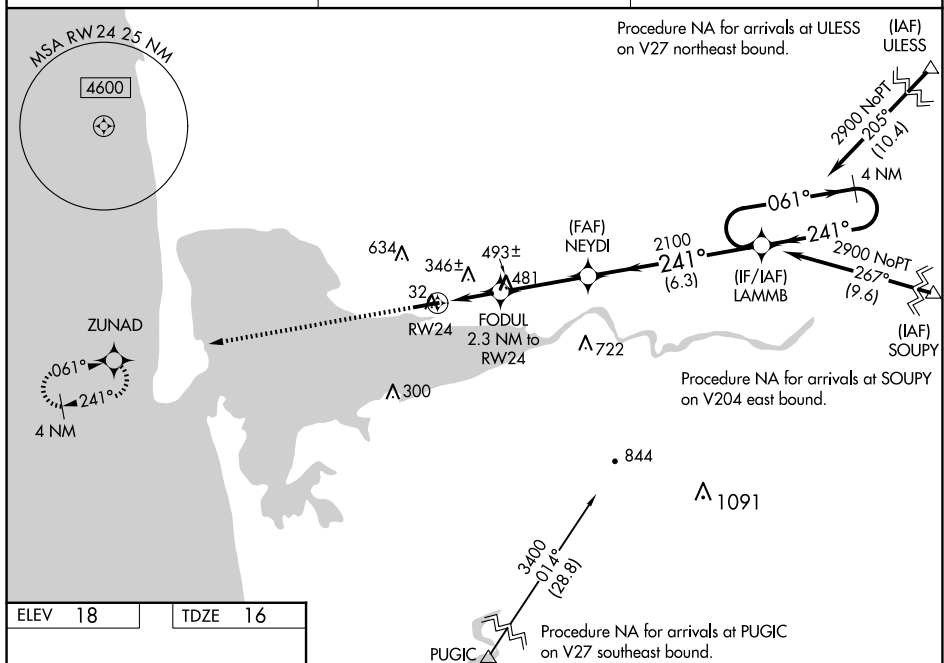

ELEV	18		TDZE	16
------	----	--	------	----

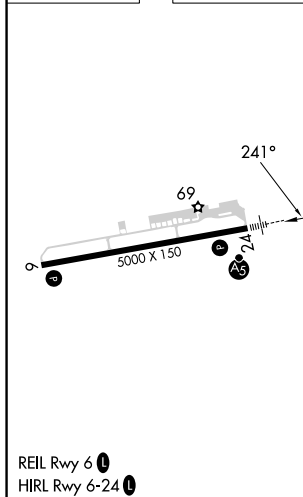[illegible]

HOQUIAM, WASHINGTON
Amdt 2E 07OCT21

46°58'N-123°56'W

BOWERMAN FLD (HQM)

RNAV (GPS) RWY 24

NW-1, 17 APR 2025 to 15 MAY 2025

NW-1, 17 APR 2025 to 15 MAY 2025