

LOC I-MSS	APP CRS	Rwy Idg	5601
108.7	045°	TDZE	205
		Apt Elev	221

ILS or LOC RWY 5

MASSENA INTL-RICHARDS FLD (MSS)


ADF required. ADF and RADAR required for procedure entry.

NA

Circling Rwy 9, 23, 27 NA at night. When local altimeter setting not received, use Potsdam altimeter setting and increase DA to 528 feet and all visibilities ¼ SM; increase all MDAs 80 feet, visibility Cat C and D ½ SM and Circling visibility Cat C and Cat D ¼ SM.

MISSED APPROACH:
Climb to 1200 then climbing left turn to 2300 direct MISSE LOM and hold.

ASOS 128.075	BOSTON CENTER 135.25 377.1	UNICOM 123.0 (CTAF) 0
-----------------	-------------------------------	--------------------------

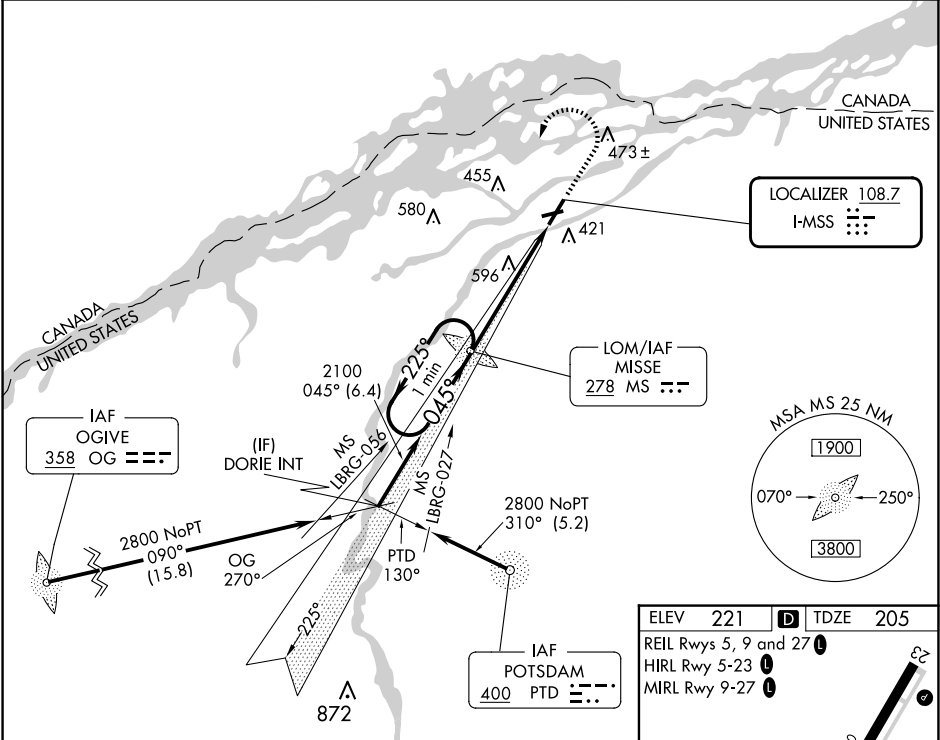

One Minute Holding Pattern

MISSE LOM 1994

1200 2300 MS

2300 225° 045° 2100

GS 3.00° TCH 54

VGSI and ILS glideslope not coincident (VGSI Angle 3.00/TCH 55).

5.4 NM

CATEGORY	A	B	C	D
S-ILS 5		455-¾	250 (300-¾)	
S-LOC 5	800-1	595 (600-1)	800-1¾	595 (600-1¾)
CIRCLING	800-1	579 (600-1)	880-1¾ 659 (700-1¾)	900-2¼ 679 (700-2¼)

ELEV 221 D TDZE 205

REIL Rwys 5, 9 and 27 0

HIRL Rwy 5-23 0

MIRL Rwy 9-27 0

4000 X 100

5601 X 100

0.3% UP

045°

FAF to MAP 5.4 NM

Knots	60	90	120	150	180
Min:Sec	5:24	3:36	2:42	2:10	1:48