




WAAS CH 51874 W07A	APP CRS 101°	Rwy Idg 4000 TDZE 140 Apt Elev 143
--	------------------------	---

RNAV (GPS) Z RWY 7
MERRILL FLD (MRI) (PAMR)

RNP APCH - GPS.			MISSED APPROACH: Climbing left turn to 2000 direct BQG VORTAC and hold.	
RADAR required for procedure entry.				
When local altimeter setting not received, use Ted Stevens Anchorage Intl altimeter setting and increase all MDAs 20 feet. Circling Rwy 16, 34, 5 and 23 NA at night. Helicopter visibility reduction below 1 SM NA.				
ATIS 124.25	ANCHORAGE APP CON 119.1 363.2	MERRILL TOWER★ 126.0 (CTAF) 0	GND CON 121.7	UNICOM 122.95

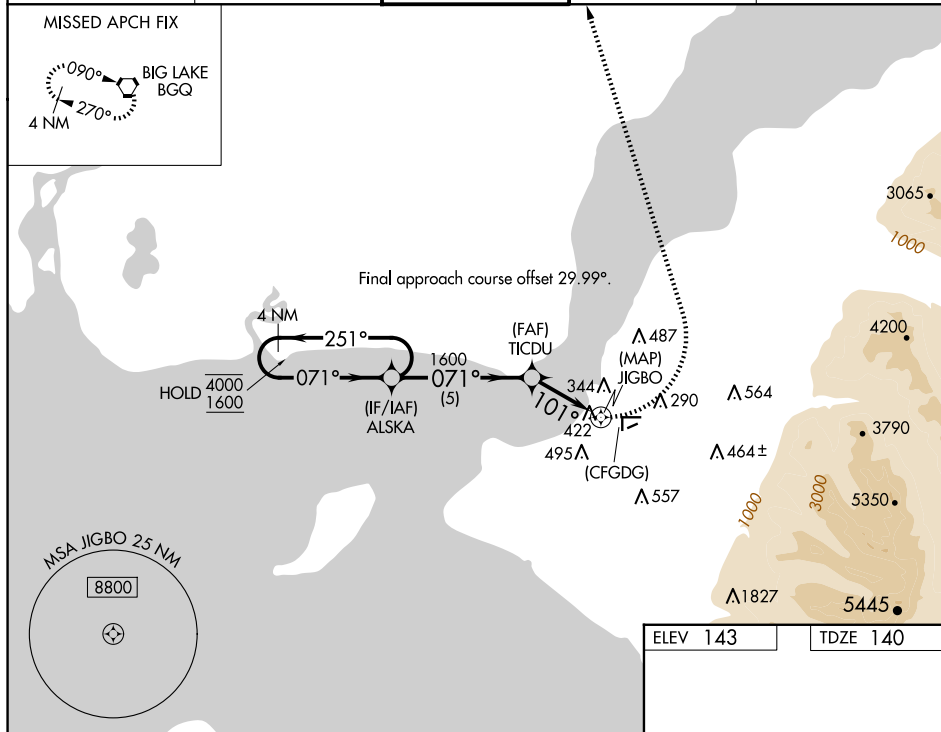

ELEV 143		TDZE 140
----------	--	----------

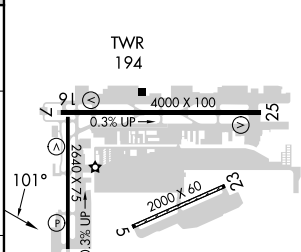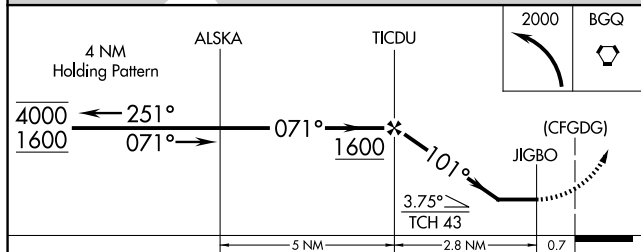

CATEGORY	A	B	C	D
LP MDA	660-1	520 (600-1)	NA	
LNAV MDA	680-1	540 (600-1)	NA	
CIRCLING	740-1 597 (600-1)	800-1 657 (700-1)	NA	

REIL Rwys 7, 16, 25, and 34 **L**
MIRL Rwys 7-25 and 16-34 **L**