
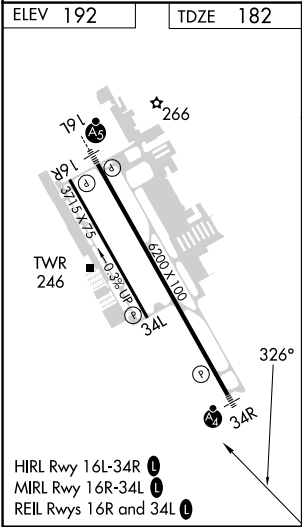


WAAS CH 56239 W34B	APP CRS 326°	Rwy Idg TDZE 182 Apt Elev 192
--	------------------------	---

RNAV (GPS) RWY 34L

MANASSAS RGNL/HARRY P DAVIS FLD (HEF)

	DME/DME RNP-0.3 NA. When local altimeter setting not received, use Washington Dulles Intl altimeter setting and increase all MDA 60 feet; increase LNAV Cat C/D and Circling Cat C and D visibility ¼ mile. Helicopter visibility reduction below ¾ SM NA.		MISSED APPROACH: Climbing left turn to 3000 direct CSN VORTAC and hold.	
ATIS 125.175	POTOMAC APP CON 128.525 306.925	MANASSAS TOWER ★ 133.1 (CTAF) 0 360.75	GND CON 121.8	CLNC DEL 120.2

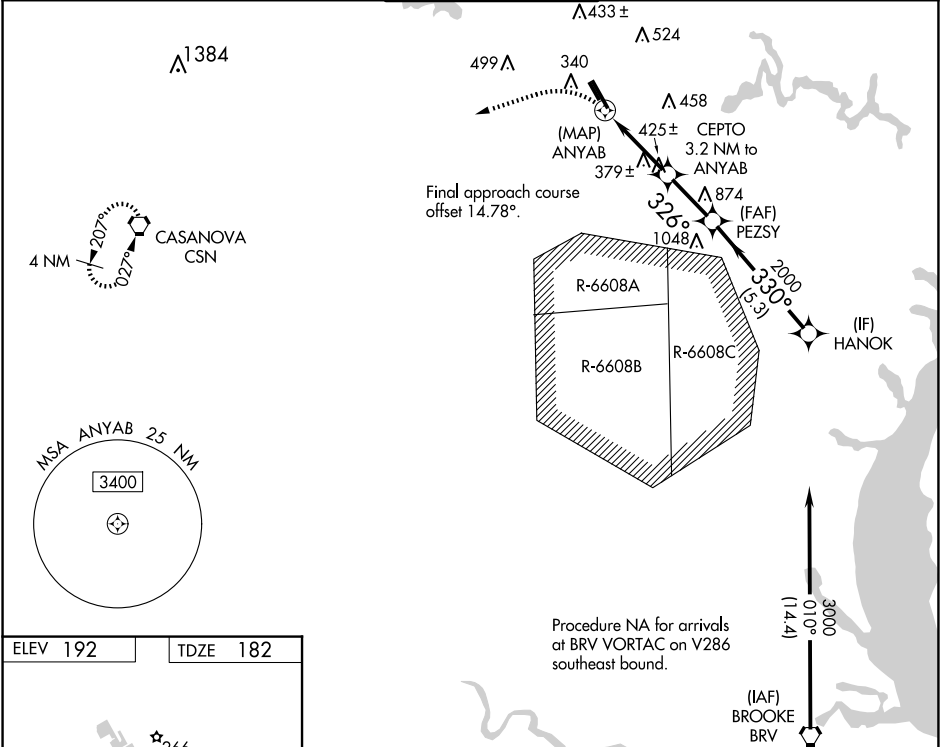

3000 CSN		VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 43).		HANOK	
CEPTO 3.2 NM to ANYAB		PEZSY		3000	
0.9 NM to ANYAB		326°		2000	
ANYAB		1260		2.79°	
TCH 40		0.4		0.9	
2.4 NM		2.3 NM		5.3 NM	
CATEGORY	A	B	C	D	
LP MDA	640-1	458 (500-1)	640-1 3/8	458 (500-1 3/8)	
LNAV MDA	680-1	498 (500-1)	680-1 3/8	498 (500-1 3/8)	
CIRCLING	720-1	740-1	840-1 3/4	880-2 1/4	
	528 (600-1)	548 (600-1)	648 (700-1 3/4)	688 (700-2 1/4)	