
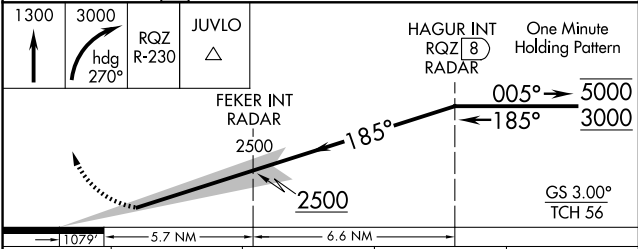


DME required. RADAR required for procedure entry.			ALSIF-2		MISSED APPROACH: Climb to 1300 then climbing right turn to 3000 on heading 270° and RQZ R-230 to JUVLO/RQZ 28.7 DME and hold.
Simultaneous approach authorized. DME from RQZ VORTAC. DME use requires simultaneous reception of I-HSV and RQZ DME.					
ATIS	HUNTSVILLE APP CON ★	HUNTSVILLE TOWER ★	GND CON	CLNC DEL	UNICOM
121.25	125.6 354.1	127.6 (CTAF) 350.35	121.9 269.525	120.35	122.95

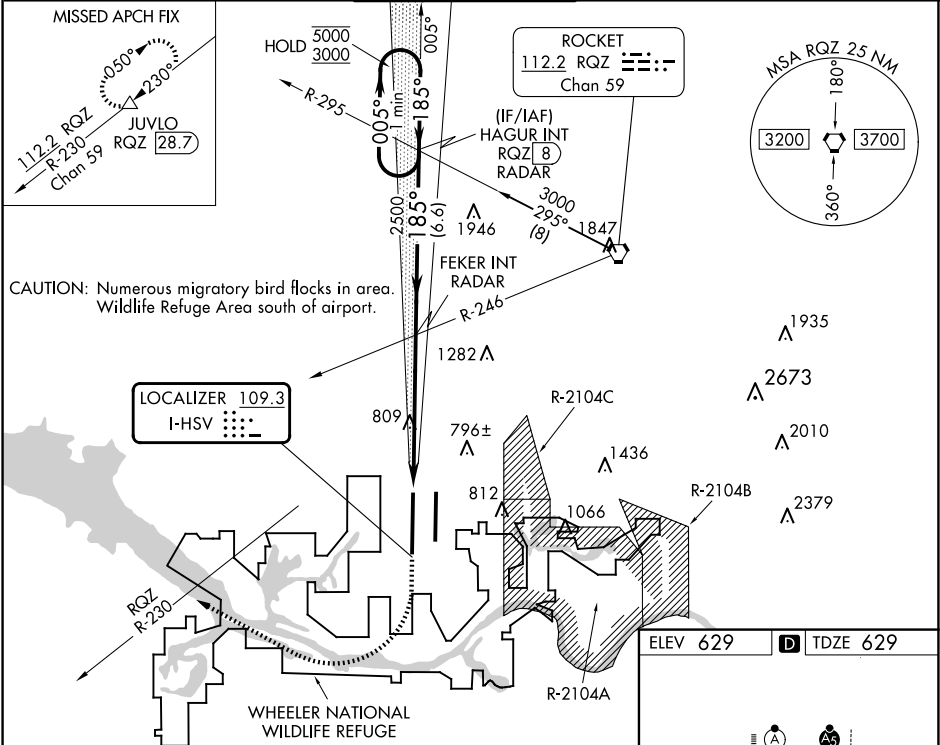


CATEGORY	A	B	C	D
S-ILS 18R				

RA 105/12 100 DA 729

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

ELEV 629 TDZE 629

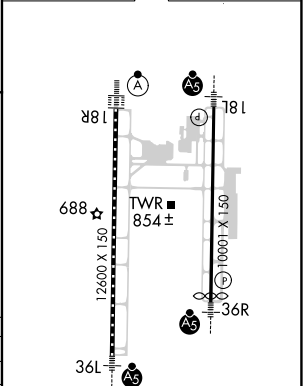

TDZ/CL Rws 18R and 36L
HIRL Rws 18L-36R and 18R-36L