

LOM BU	APP CRS	Rwy Idg	5500
230	038°	TDZE	904
		Apt Elev	904

NDB RWY 4
BOLTON FLD (TZR)


RADAR required for procedure entry.

⚠ For inop ALS, increase S-4 Cats A/B visibility to 1 SM and S-4 Cats C/D visibility to 1½ SM.

MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 2700 direct BU LOM and hold.

AWOS-3PT 135.925	COLUMBUS APP CON 134.0 279.6	BOLTON TOWER★ 128.1 (CTAF) 0	GND CON 121.8
---------------------	---------------------------------	---------------------------------	------------------

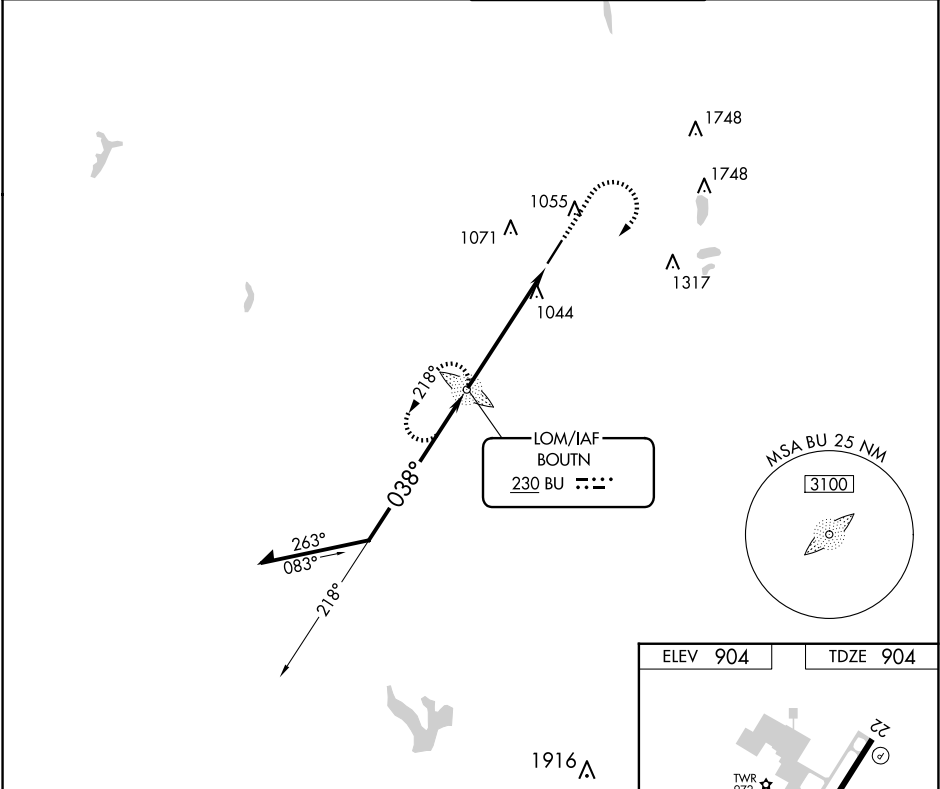

Remain within 10 NM

2700

218°

038°

BU LOM

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 25).

3.08°

TCH 40

5.4 NM

CATEGORY	A	B	C	D
S-4	1400-¾ 496 (500-¾)		1400-1 496 (500-1)	1400-1¼ 496 (500-1¼)
CIRCLING	1400-1 496 (500-1)		1400-1½ 496 (500-1½)	1500-2 596 (600-2)

ELEV 904 TDZE 904

TWR 972

5500 X 100

1027

038°

REIL Rwy 22

MRL Rwy 4-22

FAF to MAP 5.4 NM

Knots	60	90	120	150	180
Min:Sec	5:24	3:36	2:42	2:10	1:48

EC-2, 17 APR 2025 to 15 MAY 2025

EC-2, 17 APR 2025 to 15 MAY 2025