

WAAS CH 56236 W23A	APP CRS 234°	Rwy Idg 5500 TDZE 270 Apt Elev 270
--	------------------------	---

RNAV (GPS) RWY 23
COLUMBIA/MARION COUNTY (OR)


RNP APCH - GPS.



For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C.
Rwy 23 helicopter visibility reduction below $\frac{3}{4}$ SM NA.

MISSED APPROACH:
Climb to 2400 direct
HULNA and hold.

AWOS-3PT 120.675	HOUSTON CENTER 126.8 327.8	UNICOM 122.8 (CTAF) 0
----------------------------	--------------------------------------	---------------------------------

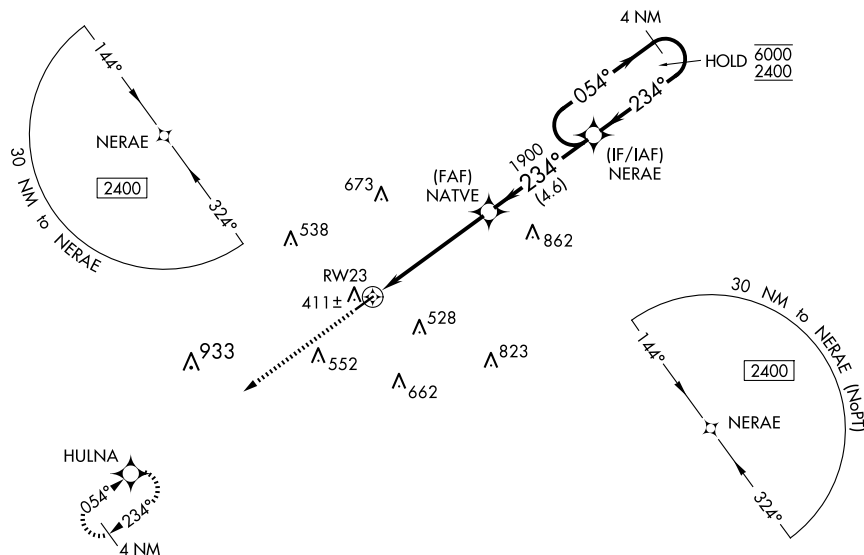

ELEV 270		TDZE 270
----------	--	----------

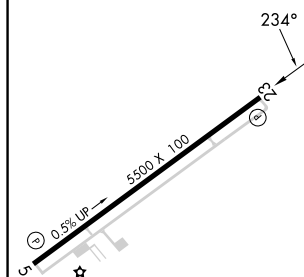


Diagram illustrating the NAVAID RW23 holding pattern. The pattern is a series of turns around a fix labeled RW23. The pattern includes a 1.7 NM leg to RW23, a 1.7 NM leg, a 3.3 NM leg, and a 4.6 NM leg. The pattern is labeled NATIVE and NERAE. The holding pattern is a 4 NM Holding Pattern. The diagram also shows the 2400 and HULNA frequencies and the GP 3.00° TCH 45.

REIL Rwy 5 and 23 **L**
MIRL Rwy 5-23 **L**

COLUMBIA, MISSISSIPPI
Amdt 2A 10AUG23

COLUMBIA/MARION COUNTY (ØRØ)
RNAV (GPS) RWY 23

31°18'N-89°49'W