


LOC/DME I-TWJ	APP CRS	Rwy Idg	8300
111.95	007°	TDZE	21
Chan 56 (Y)		Apt Elev	26

LOC RWY 1R


TAMPA INTL (TPA)

DME required.				MISSED APPROACH: Climb to 500 then climbing right turn to 2000 direct LAL VORTAC and hold.			

ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45	128.475		118.5 307.175	119.5 269.4	121.7 269.4	133.6	

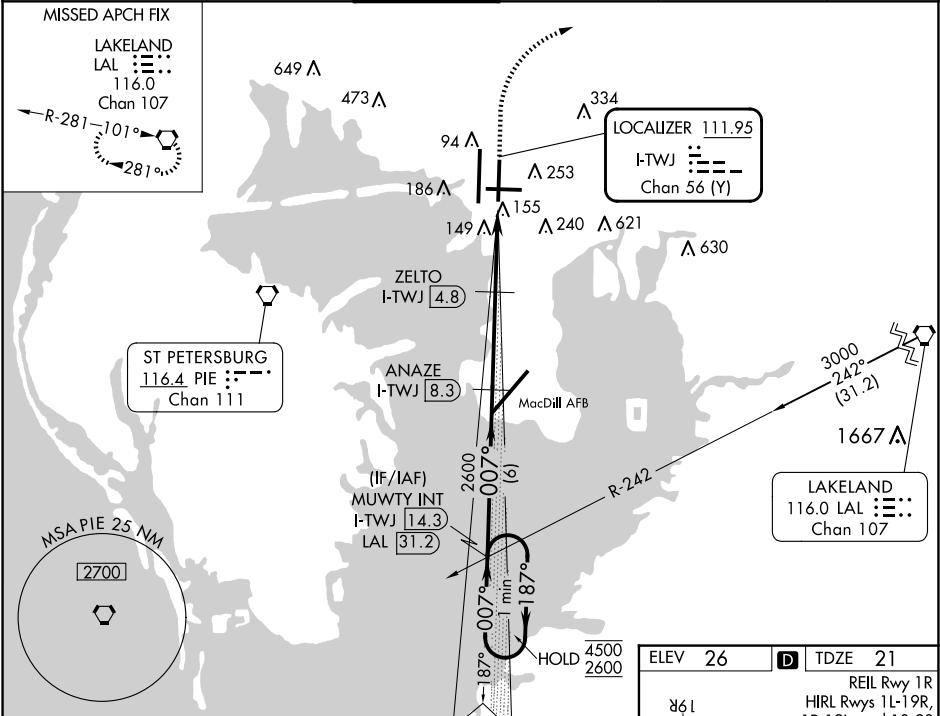

VGSi and descent angle not coincident (VGSi Angle 3.00/TCH 71).				500	2000	LAL
One Minute Holding Pattern						

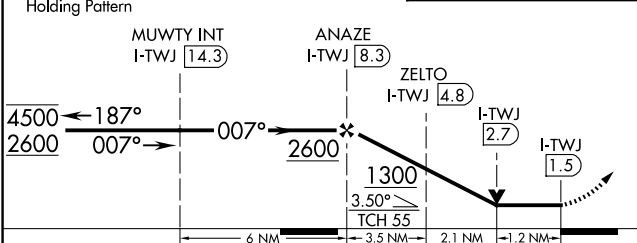

CATEGORY	A	B	C	D
S-LOC 1R	460/55	439 (500-1)	460-1¼	439 (500-1¼)
CIRCLING	600-1	574 (600-1)	680-1¾ 654 (700-1¾)	980-3 954 (1000-3)

