

TAMPA, FLORIDA

AL-416 (FAA)

25135

WAAS CH 87105 W01B	APP CRS 007°	Rwy Idg 8300 TDZE 21 Apt Elev 26
--	------------------------	---

APP CRS
007°

Rwy Idg	8300
TDZE	21
Apt Elev	26

RNAV (GPS) Y RWY 1R
TAMPA INTL (TPA)

RNP APCH - GPS.

T For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 4°C or above 54°C.
A Simultaneous approach authorized with Rwy 1L. LNAV procedure NA during simultaneous operations. Use of FD or AP required during simultaneous operations.

MISSED APPROACH: Climb to 2000 direct COBOX and hold.

ARR	D-ATIS	DEP
126.45		128.475


TAMPA APP CON
118.5 307.175

TAMPA TOWER
119.5 269.4


GND CON
121.7 269.4

CLNC DE
133.6

CPDLC

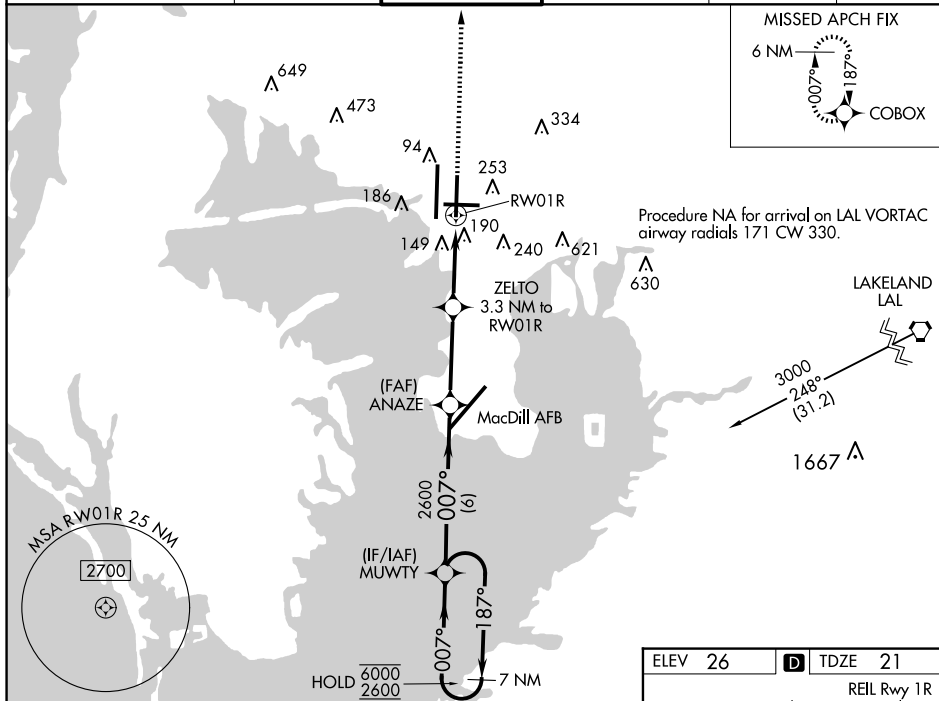

CATEGORY	A	B	C	D	E
LPV DA	291/45	270 (300-%)			NA
LNAV/ VNAV DA	440/60	419 (500-1¼)			NA
LNAV MDA	440/55	419 (500-1)	440/60	419 (500-1¼)	
CIRCLING	600-1	574 (600-1)	680-1¾ 654 (700-1¾)	980-3	954 (1000-3)

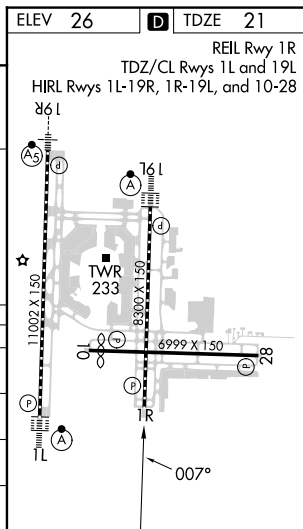

TAMPA, FLORIDA
Amdt 3C 15MAY25

27°59'N-82°32'W

TAMPA INTL (TPA)

RNAV (GPS) Y RWY 1R

SE-3, 15 MAY 2025 to 12 JUN 2025