
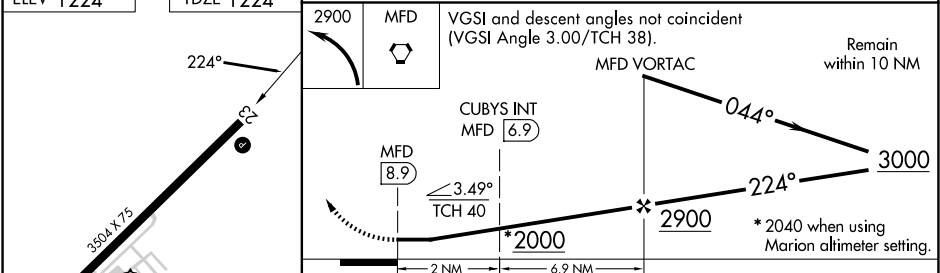


VORTAC MFD 108.8 Chan 25	APP CRS 224°	Rwy Idg TDZE Apt Elev 3504 1224 1224
--	------------------------	--

VOR RWY 23
GALLION MUNI (GQQ)

RADAR required for procedure entry.		MISSED APPROACH: Climbing left turn to 2900 direct MFD VORTAC and hold.
Procedure NA at night. Use Mansfield altimeter setting; when not received, use Marion altimeter setting and increase all MDAs 40 feet, increase CUBYS fix minimums S-23 all Cats visibility ½ SM and Circling Cat C ¼ SM. Rwy 23 helicopter visibility reduction below 1 SM NA.		

CLEVELAND APP CON ★ 128.35 360.65	CLNC DEL 126.8	UNICOM 122.8 (CTAF) 0
---	--------------------------	---------------------------------

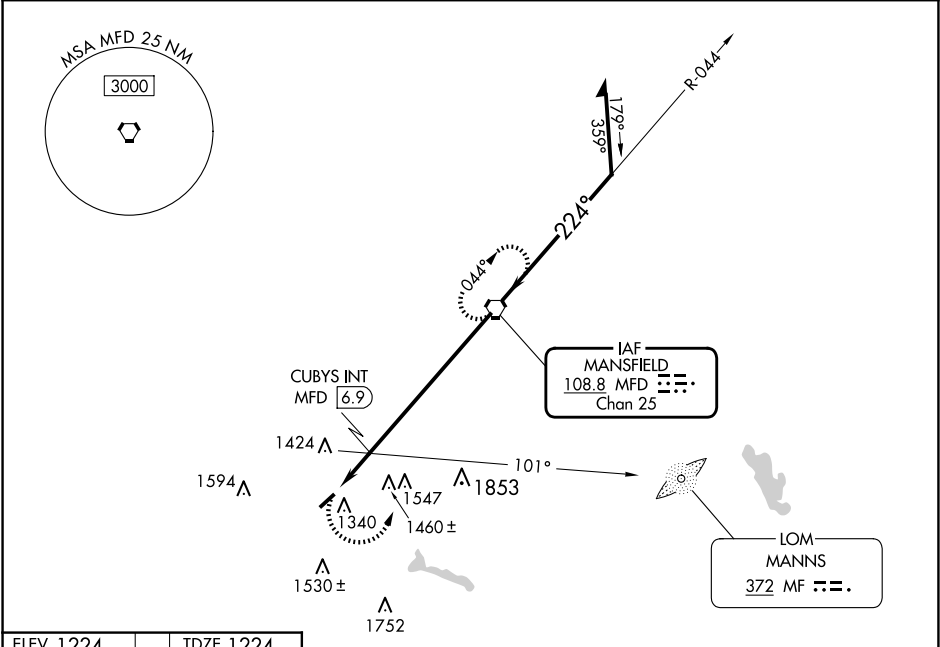

CATEGORY	A	B	C	D
S-23	2000-1 776 (800-1)	2000-1¼ 776 (800-1¼)	2000-2½ 776 (800-2½)	NA
CIRCLING	2000-1 776 (800-1)	2000-1¼ 776 (800-1¼)	2000-2½ 776 (800-2½)	NA
CUBYS FIX MINIMUMS				
S-23	1760-1	536 (600-1)	1760-1½ 536 (600-1½)	NA
CIRCLING	1800-1 576 (600-1)	1960-1 736 (800-1)	1960-2 736 (800-2)	NA

REIL Rwys 5 and 23

MIRL Rwy 5-23

FAF to MAP 8.9 NM

Knots	60	90	120	150	180
Min:Sec	8:54	5:56	4:27	3:34	2:58