

LOC/DME I-HRJ	APP CRS	Rwy Idg	5005
108.35	048°	TDZE	196
Chan 20(Y)		Apt Elev	202


LOC RWY 5

HARNETT RGNL JETPORT (HRJ)

DME required.

MISSED APPROACH: Climb to 700 then climbing left turn to 2000 on heading 290° and RDU R-194 to LANHO INT/RDU 21.2 DME and hold.

AWOS-3 119.025	FAYETTEVILLE APP CON 125.175 285.575	UNICOM 122.7 (CTAF) 0
-------------------	---	--------------------------

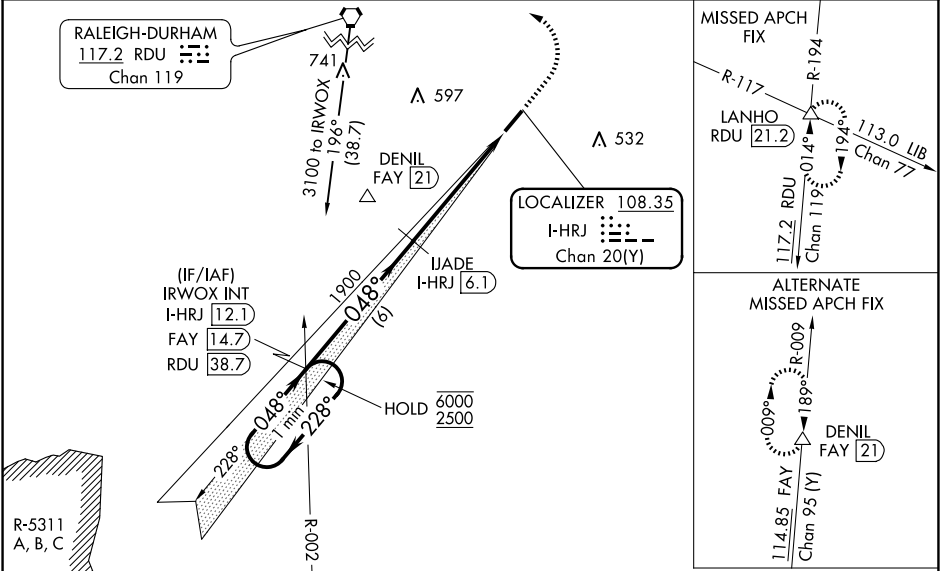

MSA HQT 25 NM

3400

Δ 1049

2500 NoPT
(14.7)

IAF
FAYETTEVILLE
114.85 FAY
Chan 95 (Y)

VGSI and descent angles not coincident
(VGSI Angle 3.00/TCH 39).

700

2000

RDU R-194

LANHO

hdg
290°

IRWOX INT
I-HRJ [12.1]

IADE
I-HRJ [6.1]

6000

2500

←228°

048°→

048°

1900

3.04°

TCH 35

6 NM

3.9 NM

1.3

CATEGORY	A	B	C	D
S-5	640-1 444 (500-1)	640-1 444 (500-1½)	NA	NA
CIRCLING	660-1 458 (500-1)	720-1 518 (600-1)	780-1½ 578 (600-1½)	NA