


APP CRS	Rwy Idg	7569
055°	TDZE	708
	Apt Elev	727

RNAV (RNP) Z RWY 5
BUFFALO NIAGARA INTL (BUF)

For uncompensated Baro-VNAV systems, procedure NA below -18°C (0°F) or above 54°C (130°F). GPS required. For inoperative MALS, increase RNP 0.10 all Cnts visibility to 1¼. For inoperative MALS, increase RNP 0.30 all Cnts visibility to 1½.				MALS	MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to TRAVA and hold.
D-ATIS	BUFFALO APP CON	BUFFALO TOWER	GND CON	CLNC DEL	CPDLC
135.35	126.15 263.125	120.5 257.8	133.2 257.8	124.7 257.8	

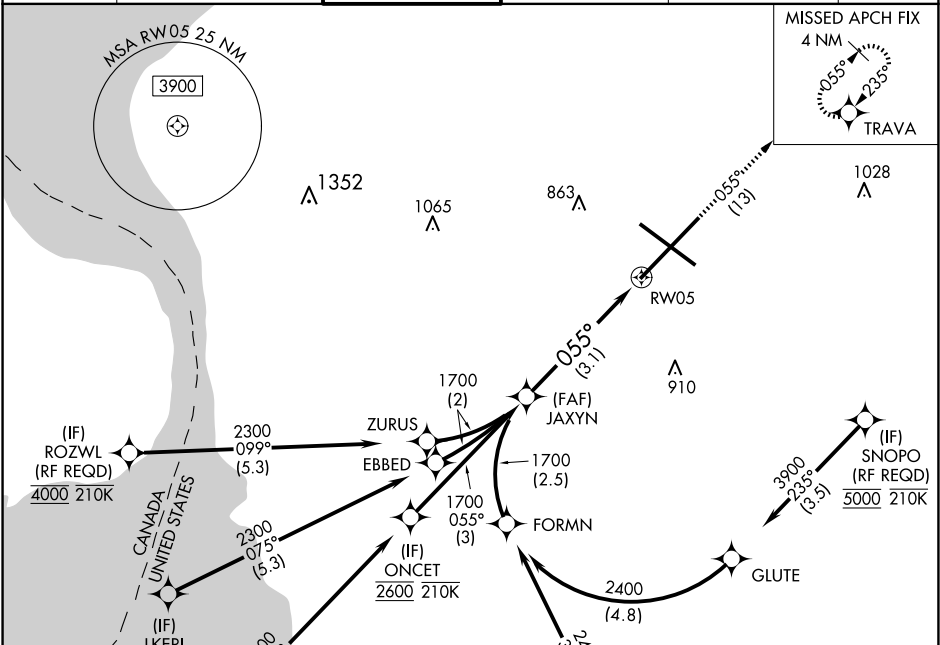

ELEV 727		D TDZE 708		
CATEGORY	A	B	C	D
RNP 0.10 DA	1065/45 357 (400-¾)			
RNP 0.30 DA	1159/60 451 (500-1¼)			
AUTHORIZATION REQUIRED				

REIL Rwy 14
TDZ/CL Rws 5 and 23
HIRL Rws 5-23 and 14-32