


LOC I-OPF 110.5	APP CRS 093°	Rwy Ldg TDZE Apt Elev	8002 8 8
---------------------------	------------------------	-----------------------------	-------------------------------------

ILS or LOC RWY 9L
MIAMI-OPA LOCKA EXEC (OPF)

RADAR required.			MALSR 	MISSED APPROACH: Climb to 2000 on heading 093° and DHP VORTAC R-069 to JANUS INT/DHP 42.5 DME and hold.		
T A Inop table does not apply to S-ILS 9L all Cats. Rwy 9L helicopter visibility reduction below ¾ SM NA. For inop ALS, increase S-LOC 9L Cats A and B visibility to 1 SM and Cats C and D visibility to 1 ¾ SM. ZOLTA Fix Minimums, for inop ALS, increase S-LOC 9L all Cats visibility to 1 SM. Autopilot coupled approach NA below 400 feet. Caution: Lights on highway 0.7 NM north may be mistaken for runway.						
ATIS 125.9	MIAMI APP CON 128.6 306.975	OPA LOCKA TOWER ★ 134.675 (CTAF) 0	GND CON 120.025	CLNC DEL 119.2	GCO 119.45	

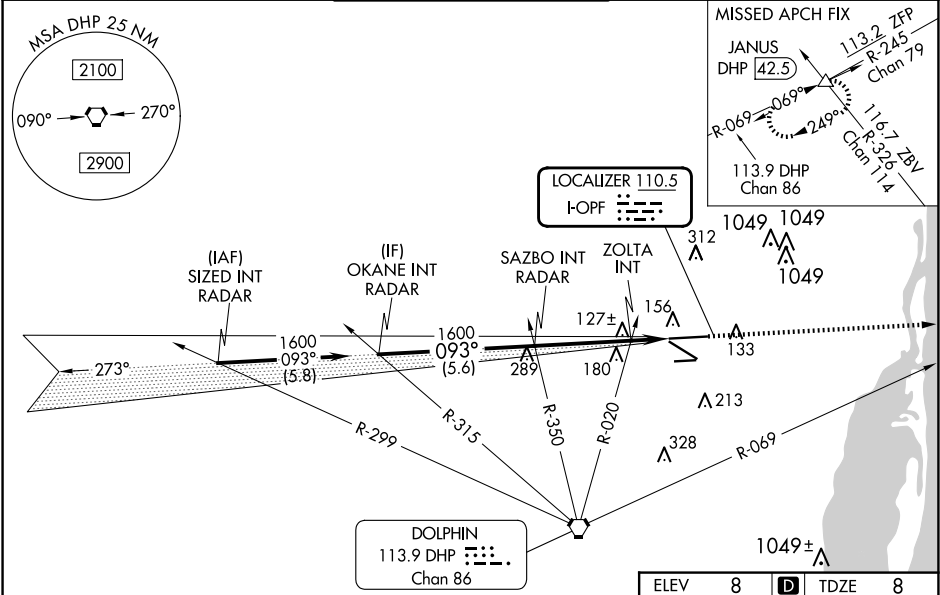

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 55).		2000 hdg 093°	DHP R-069	JANUS
OKANE INT RADAR		SAZBO INT RADAR	ZOLTA INT	
1600		1600	480	
GS 3.00° TCH 51		5.6 NM	3.3 NM	1.5 NM
CATEGORY	A	B	C	D
S-ILS 9L	258-¾		250 (300-¾)	
S-LOC 9L	480-¾	472 (500-¾)	480-1	472 (500-1)
CIRCLING	480-1 472 (500-1)	520-1 512 (600-1)	620-1¾ 612 (700-1¾)	740-2¼ 732 (800-2¼)
ZOLTA FIX MINIMUMS				
S-LOC 9L	380-¾		372 (400-¾)	
CIRCLING	480-1 472 (500-1)	520-1 512 (600-1)	620-1¾ 612 (700-1¾)	740-2¼ 732 (800-2¼)

ELEV	8	TDZE	8
MIRL Rwy 9R-27L HIRL Rwy 9L-27R and 12-30			
FAF to MAP 4.8 NM			
Knots	60	90	120 150 180
Min:Sec	4:48	3:12	2:24 1:55 1:36

SE-3, 12 JUN 2025 to 10 JUL 2025

SE-3, 12 JUN 2025 to 10 JUL 2025