

LOC/DME I-IDA <u>111.1</u> Chan 48	APP CRS 026°	Rwy Idg 9002 TDZE 4744 Apt Elev 4744
--	------------------------	---


LOC BC RWY 3
IDAHO FALLS RGNL (IDA)

DME required.



MISSED APPROACH: Climb to 7000 on I-IDA localizer
NE course 026° to YAGUP/I-IDA 13.8 DME and hold.

ATIS 135.325	SALT LAKE CENTER 128.35 239.25	IDAHO FALLS TOWER ★ 118.5 (CTAF) 0 257.8	GND CON 121.7	CLNC DEL 121.7	GCO 121.725	UNICOM 122.95
-----------------	-----------------------------------	---	------------------	-------------------	----------------	------------------

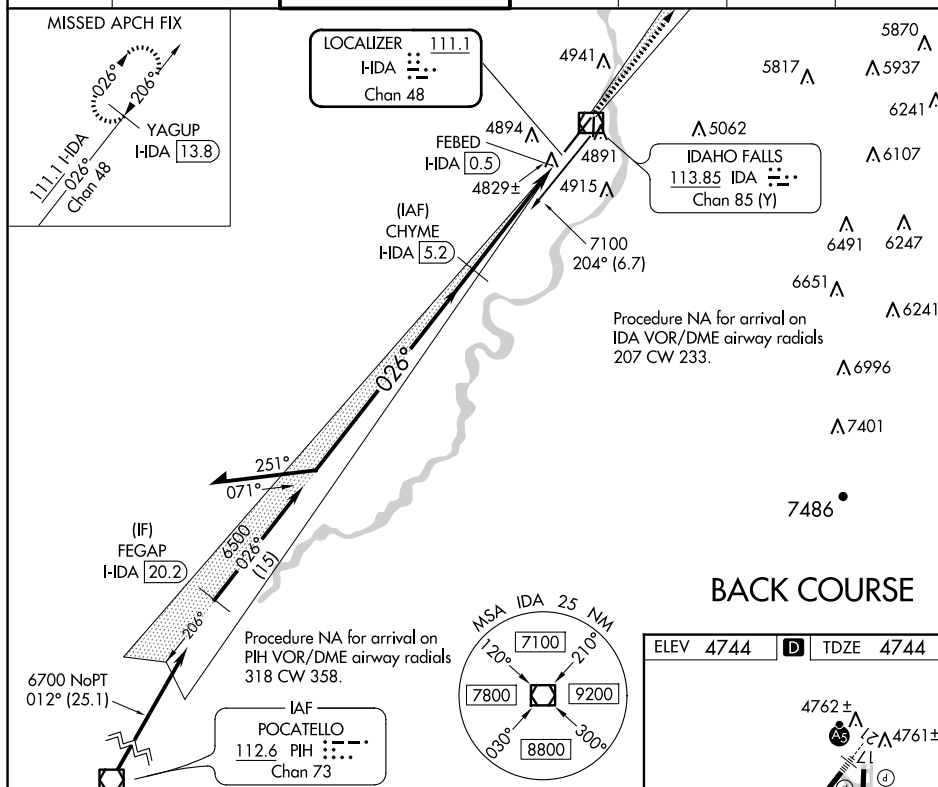

Disregard glide slope indications.

Remain
within 1.5 N

I-IDA 5.2

Remain within 15 NM

6500 $\xleftarrow{206^\circ}$ $\xrightarrow{026^\circ}$ 6500

VGSI and descent angles not coincident
(VGSI Angle 3.00/TCH 35).

700

↑

YAGUP
USA

1

I-DA NE c
0248

026°

FEBED

HIDA (0.5)

1

1

0.7

D	
---	--

--	--

120-214	
---------	--

$$(700 - 2\frac{1}{4}) A$$

(700-274)	C
-----------	---

.....

-112°04'W

IDAHO FALLS, IDAHO

Amdt 7 03JAN19

43°31'N-112°04'W

IDAHO FALLS RGNL (IDA)
LOC BC RWY 3

REIL Rwy 3 **L**
HIRL Rwy 3-21 **L**
MIRL Rwy 17-35