

ILS RWY 18 (SA CAT I & II)
ST PETE-CLEARWATER INTL (PIE)

MALSR



MISSED APPROACH: Climb to 600 then climbing right turn to 1700 on heading 330° and PIE VORTAC R-276 to LAFAL INT/PIE 8 DME and hold, continue climb-in-hold to 1700.


ALTERNATE MISSED APCH FIX

116.0 LAL
R-232
Chan 107


117.0 SRQ
R-353
Chan 117

JRGAL
SRQ 11

173°
353°

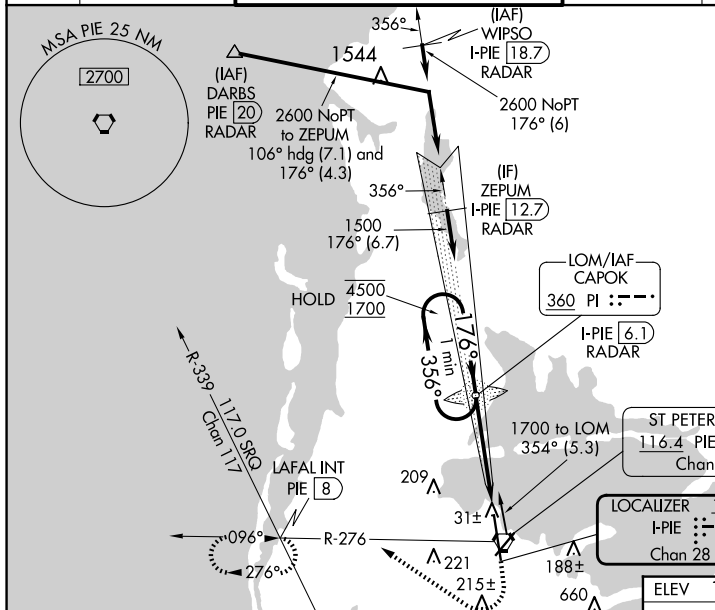


One Minute Holding Pattern

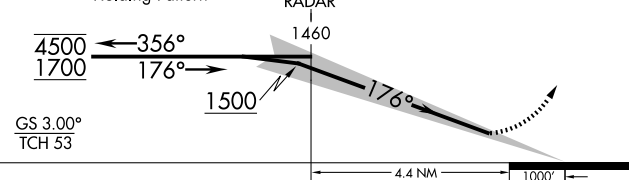

CATEGORY	A	B	C	D
S-ILS 18	SA CAT I	RA 157/14	150	DA 157
S-ILS 18	SA CAT II	RA 107/12	100	DA 107

SA CATEGORY I & II ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

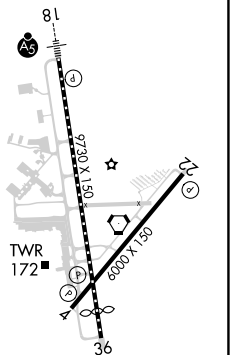

TDZ/CL Rwy 18 **L**
HIRL Rwy 18-36 **L**
MIRL Rwy 4-22 **L**
REIL Rwy 4 and 22