



WAAS CH 97306 W30A	APP CRS 306°	Rwy Idg TDZE Apt Elev	30L 7614 57 62	30R 7597 55 62
--	------------------------	-----------------------------	--	--

RNAV (GPS) Y RWY 30L
NORMAN Y MINETA SAN JOSE INTL (SJC)

RNP APCH-GPS. ▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 1°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1½ SM. * RVR 1800 authorized with use of FD or AP or HUD to DA.				MALSR Rwy 30L A5	MISSED APPROACH: Climb to 2300 direct MUSSK and hold.	
D-ATIS 126.95	NORCAL APP CON 120.1 290.25	SAN JOSE TOWER ★ 124.0 (CTAF) 0 257.6	GND CON 121.7	CLNC DEL 118.0	CPDLC	UNICOM 122.95

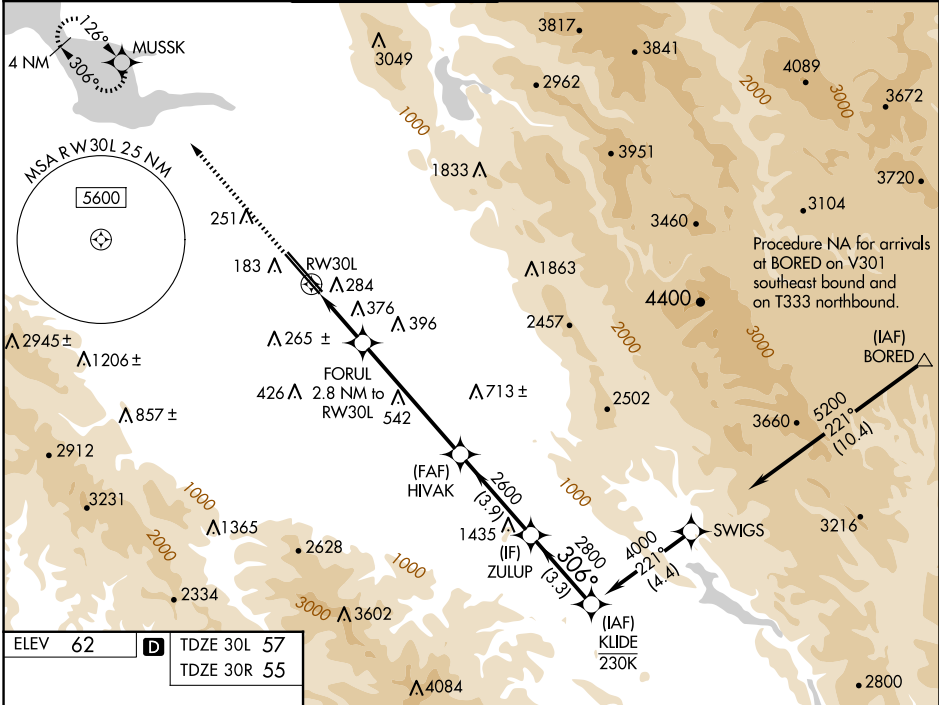

ELEV 62	D	TDZE 30L 57
		TDZE 30R 55

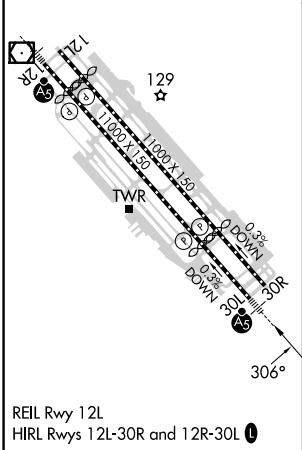

2300 ↑ MUSSK		VGSi and RNAV glidepath not coincident (VGSi Angle 3.00°/TCH 70°).			
FORUL 2.8 NM to RW30L		HIVAK 2600		ZULUP	KLIDE
1.6 NM to RW30L		2600		2800	4000
RW30L		1000		2600	GP 3.00° TCH 54
1.6 NM		1.2 NM	5.3 NM	3.9 NM	3.3 NM
CATEGORY	A	B	C	D	
LPV DA*	257/24		200 (200-½)		
LNAV/ VNAV DA	540/50		483 (500-1)		
LNAV MDA	640/24 583 (600-½)		640-1¼ 583 (600-1¼)		
SIDESTEP 30R	640-1 585 (600-1)				

SW-2, 12 JUN 2025 to 10 JUL 2025

SW-2, 12 JUN 2025 to 10 JUL 2025