

VORTAC CLL 113.3 Chan 80	APP CRS 100°	Rwy Idg 5158 TDZE 319 Apt Elev 321
--	------------------------	---

VOR or TACAN RWY 11
EASTERWOOD FLD (CLL)


DME required for procedure entry.

T Procedure turn NA for Cat E.

A Rwy 11 helicopter visibility reduction below $\frac{3}{4}$ SM NA.


MISSED APPROACH: Climb to 3100 on CLL VORTAC R-101 to JUDDY INT/CLL 15 DME and hold.

ATIS 126.85	HOUSTON APP CON 134.3 360.85	EASTERWOOD TOWER★ 118.5 (CTAF) 0 284.7	GND CON 128.7 284.7	CLNC DEL 128.7	CLNC DEL 120.4 (when twr closed)	UNICOM 122.95
-----------------------	--	--	-------------------------------	--------------------------	---	-------------------------

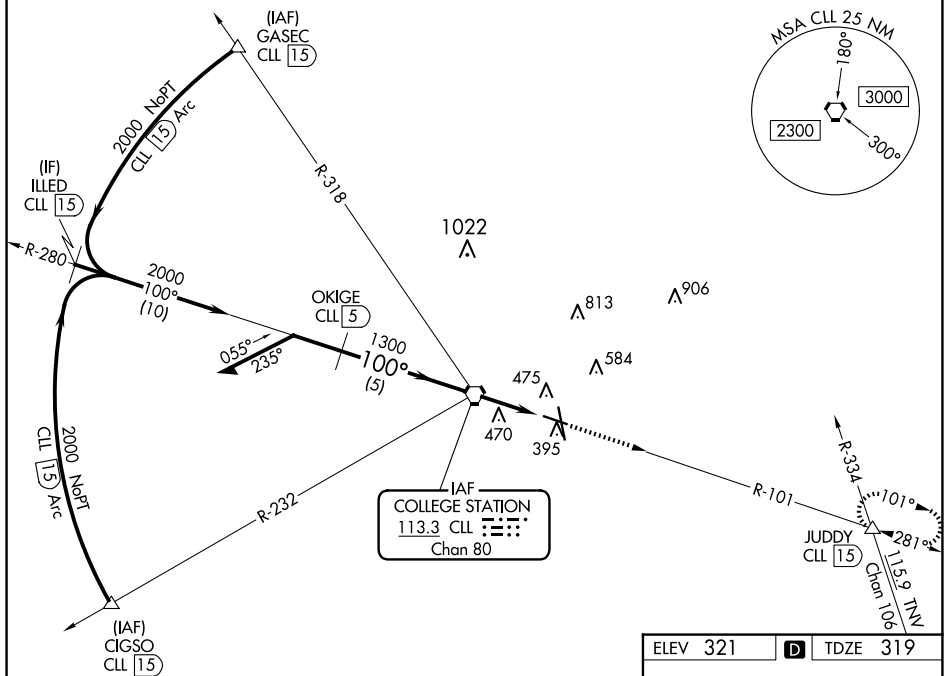

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 50).

Remain
within 10 NM

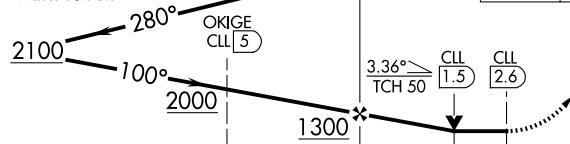

CATEGORY	A	B	C	D	E	MIRL Rwy 11-29 HIRL Rwy 17-35	35
S-11	740-1	421 (500-1)	740-1½	421 (500-1½)			
CIRCLING	860-1 539 (600-1)	880-1 559 (600-1)	1000-2 679 (700-2)	1180-2¾ 859 (900-2¾)	1180-3 859 (900-3)	FAF to MAP 2.6 NM Knots 60 90 120 150 180 Min:Sec 2:36 1:44 1:18 1:02 0:52	

