

WAAS CH 61340 W36A	APP CRS 002°	Rwy Idg TDZE 187 Apt Elev 188
--	------------------------	---

RNAV (GPS) RWY 36

COLUMBUS-LOWNDES COUNTY (UBS)

RNP APCH.


▼

▲ NA

Rwy 36 helicopter visibility reduction below $\frac{3}{4}$ SM NA. Use Columbus AFB altimeter setting; when not received, use Golden Triangle Rgnl altimeter setting and increase all DA 5 feet and all MDA 20 feet, increase LPV and LNAV/VNAV all Cats visibilities to $1\frac{1}{2}$ SM. Baro-VNAV NA.

MISSED APPROACH: Climb to 740 then climbing left turn to 2500 direct CENOK and hold.

COLUMBUS APP CON ★ 135.6 323.275	UNICOM 122.8 (CTAF) 0
--	---------------------------------

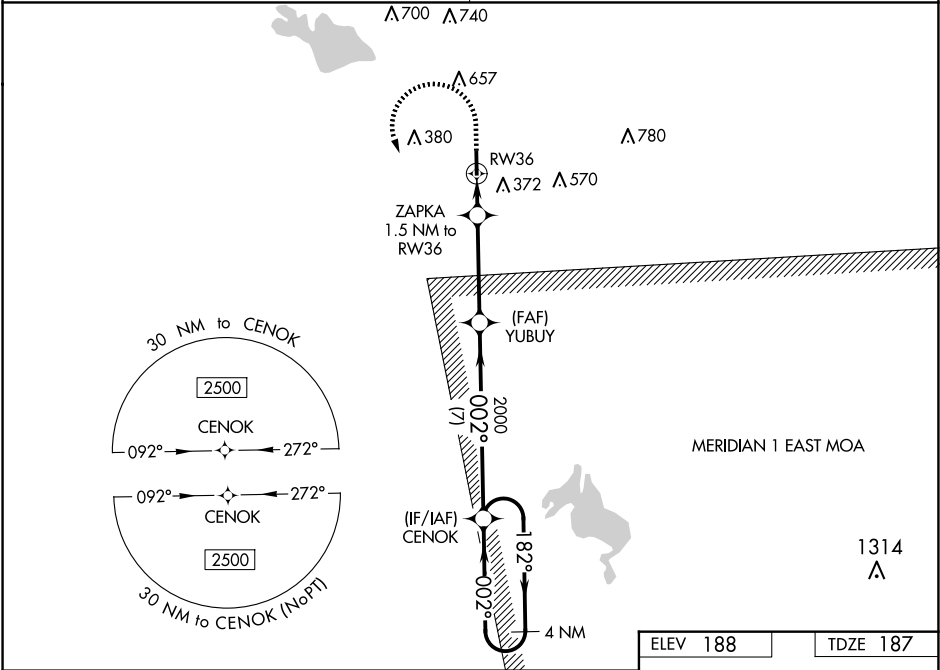

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 40).

4 NM Holding Pattern

2500

←182°

002°→

GP 3.10°

TCH 58

740

2500

CENOK

*LNAV only.

YUBUY 2000

ZAPKA 1.5 NM to RW36

RW36

*720

7 NM

3.8 NM

1.5 NM

CATEGORY	A	B	C	D
LPV DA		527-1	340 (400-1)	
LNAV/VNAV DA		526-1	339 (400-1)	
LNAV MDA	600-1	413 (500-1)	600-1 $\frac{1}{8}$	413 (500-1 $\frac{1}{8}$)
CIRCLING	760-1 572 (600-1)	780-1 592 (600-1)	1040-2 $\frac{1}{2}$ 852 (900-2 $\frac{1}{2}$)	1040-2 $\frac{3}{4}$ 852 (900-2 $\frac{3}{4}$)

81

4503 X 100

235★

P

36

002° to RW36

MIRL Rwy 18-36 0