

LOC/DME I-TZX 109.55 Chan 32 (Y)	APP CRS 324°	Rwy Idg 5498 TDZE 715 Apt Elev 726
--	------------------------	---

ILS or LOC RWY 32
WINCHESTER RGNL (OKV)


V Rwy 32 helicopter visibility reduction below $\frac{3}{4}$ SM NA. When local altimeter setting not received, use Martinsburg altimeter setting and increase all DA 63 feet and all MDA 80 feet and Circling Cat C visibility $\frac{1}{4}$ mile. For inoperative MALSR, increase S-L0C 32 Cat C visibility to 1 mile. For inoperative MALSR when using Martinsburg altimeter setting, increase S-ILS 32 all Cats visibility $\frac{1}{2}$ mile. VDP NA when using Martinsburg altimeter setting.

MALSR



MISSED APPROACH: Climb to 1400 then climbing right turn to 3700 via heading 160° and I-TZX SE course to CLADD INT/I-TZX 12.6 DME and hold.

AWOS-3 124.85	POTOMAC APP CON 120.45 306.925	CLNC DEL 126.15	UNICOM 122.975 (CTAF) 0
-------------------------	--	---------------------------	-----------------------------------

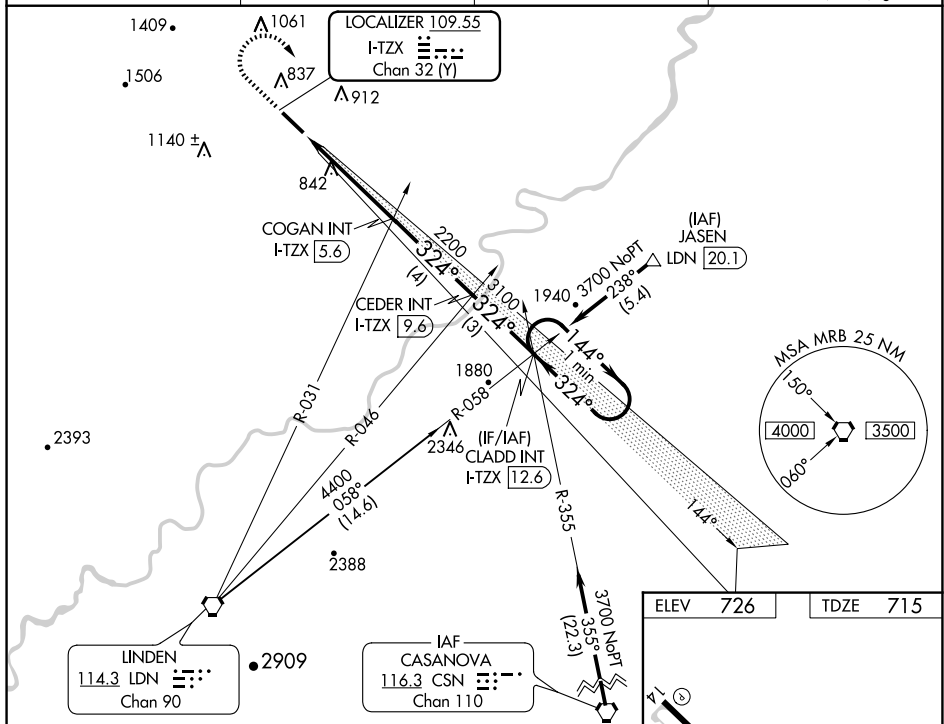

1400 ↑	3700 hdg 160°	I-TXZ SE crs	CLADD INT	CLADD INT I-TXZ 12.6	One Minute Holding Pattern
CATEGORY	A	B	C	D	
S-ILS 32	915-½ 200 (200-½)				
S-LOC 32	1040-½ 325 (400-½)			1040-¾ 325 (400-¾)	
C CIRCLING	1180-1 454 (500-1)	1220-1 494 (500-1)	1380-1¾ 654 (700-1¾)	1480-2½ 754 (800-2½)	

