

APP CRS	Rwy Idg	3613
348°	TDZE	463
	Apt Elev	463

RNAV (GPS) RWY 35
LAMAR COUNTY (M55)

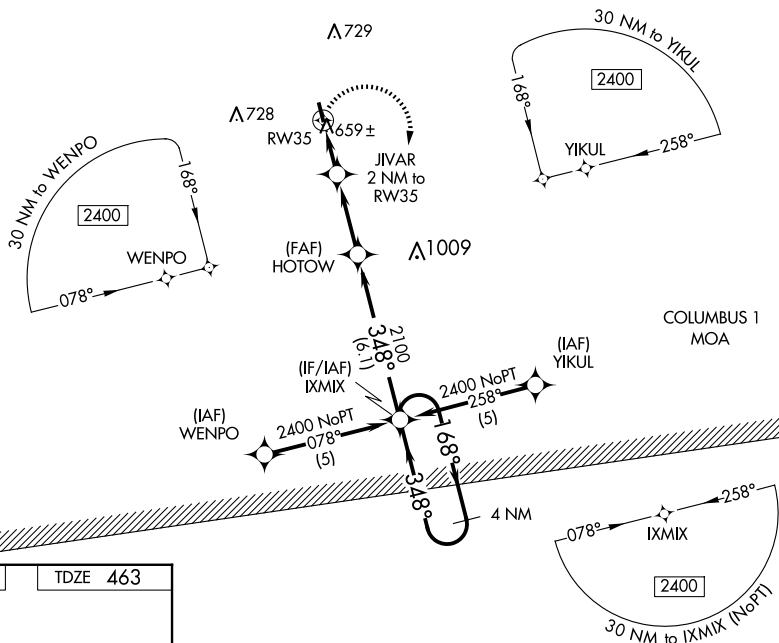
RNP APCH.

T Use Columbus AFB altimeter setting; when not received use Golden Triangle Rgnl
A **NA** altimeter setting and increase all MDA 40 feet and Circling Cats C/D visibility
1/4 mile. Procedure NA at night. Rwy 35 helicopter visibility reduction below
1 SM NA.

MISSED APPROACH: Climbing right turn to 2400 direct IXMIX and hold.

KCBM ATIS★
115.2 273.5

COLUMBUS APP CON★
126.075 239.25

CTAF
122.9

ELEV 463

TDZE 463



MIRL Rwy 17-35

2400 IXMIX Visual Segment - Obstacles. 4 NM Holding Pattern

IXMIX

168° → 2400

← 348°

HOTOW

JIVAR 2 NM to RW35

RW35

1120

2100

2 NM

3 NM

6.1 NM

CATEGORY	A	B	C	D
LNNAV MDA	1000-1	537 (600-1)	1000-1½ 537 (600-1½)	1000-1¾ 537 (600-1¾)
CIRCLING	1100-1	637 (700-1)	1180-2 717 (800-2)	1180-2¼ 717 (800-2¼)

CATEGORY	A	B	C	D
INAV MDA	1000-1 537 (600-1)		1000-1½ 537 (600-½)	1000-1¾ 537 (600-¼)
CIRCLING	1100-1 637 (700-1)		1180-2 717 (800-2)	1180-2¼ 717 (800-¼)