

24305


RNAV (RNP) Z RWY 24R
CLEVELAND-HOPKINS INTL (CLE)

T For uncompensated Baro-VNAV systems, procedure NA below -18°C (0°F) or above 54°C (130°F). For inop ALS, increase RNP 0.13 all Cats visibility to RVR 4500.


MISSED APPROACH: Climb to 3000 direct ZAPAN and on track 274° to DJB VOR/DME and hold.

D-ATIS	CLEVELAND APP CON	CLEVELAND TOWER	GND CON	CLNC DEL	CPDLC
ARR 127.85	126.55 346.325	124.5 273.45	121.7 273.45	125.05 273.45	
DEP 132.375					

DRYER
DJB

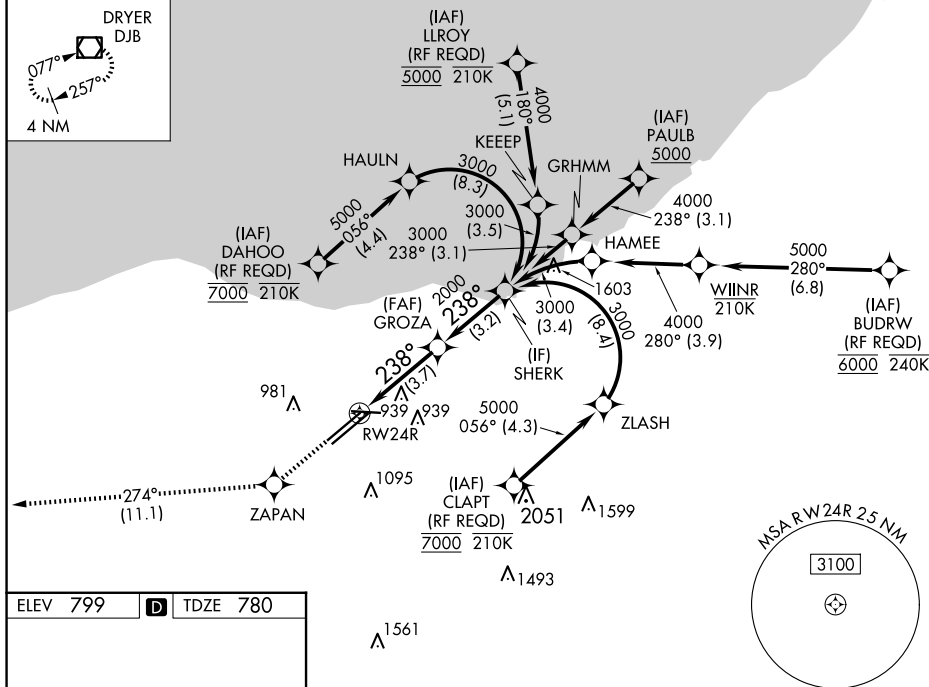

ELEV 799	D	TDZE 780
----------	----------	----------

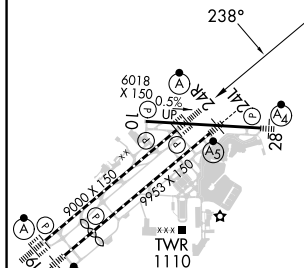

REIL Rwy 10
TDZ/CL Rwy 6L, 6R, 24L and 24R
HIRL Rwys 6R-24L, and 6L-24R, 10-28

3000 ↑ ZAPAN ✦ tr 274° ◼ DJB VGSi and RNAV glidepath not coincident (VGSi Angle 3.00°/TCH 65).				
CATEGORY	A	B	C	D
RNP 0.13 DA	1064/24 284 (300-½)			
RNP 0.30 DA	1176/35 396 (400-¾)			

AUTHORIZATION REQUIRED

Orig 24MAY18

41°25'N-81°51'W

CLEVELAND-HOPKINS INTL (CLE)

RNAV (RNP) Z RWY 24R