

GOLDSBORO, NORTH CAROLINA

TACAN Y RWY 8

TACAN GSB Chan 112	APCH CRS 081°	Rwy Idg 11,760 TDZE 73 Arpt Elev 109
-----------------------	------------------	--

[USAF]

SEYMOUR JOHNSON AFB (KGSB)


⚠ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles.
** Circling N of Rwy 8-26 not authorized.

ALSF-1


A1

MISSED APPROACH: Climb to 2300 via GSB R-081 to ZILOB and hold.

ATIS ★ 317.625	APP CON 123.7 290.9 (258°-110°) 119.7 273.6 (111°-257°)	TOWER ★ 126.25 370.875	GND CON 132.45 275.8	CLNC DEL 128.025 270.8
-------------------	---	---------------------------	-------------------------	---------------------------

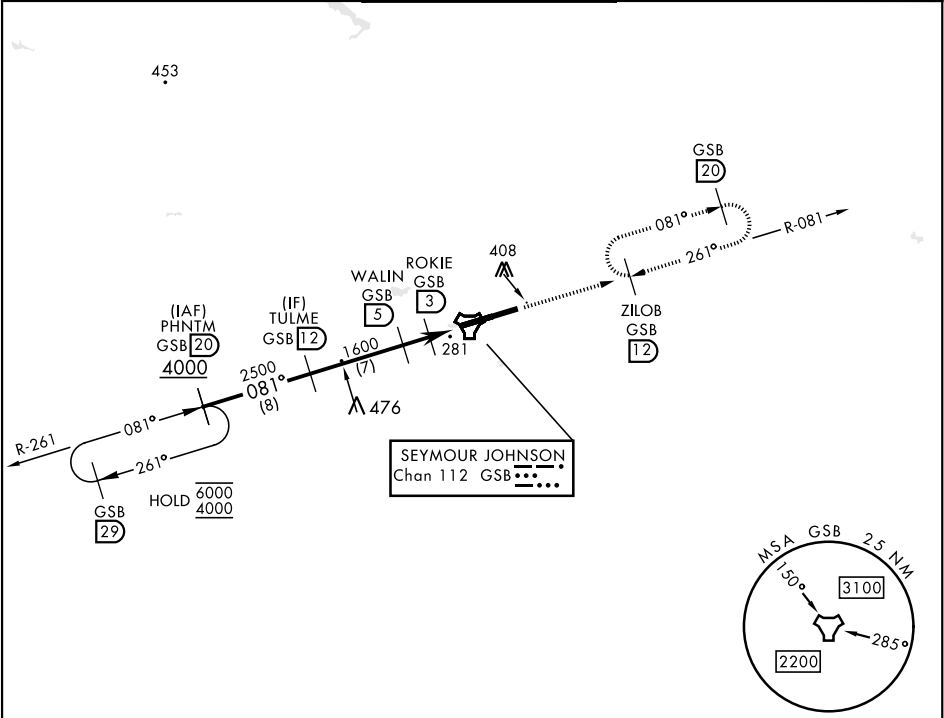

EMERG SAFE ALT 100 NM 3700

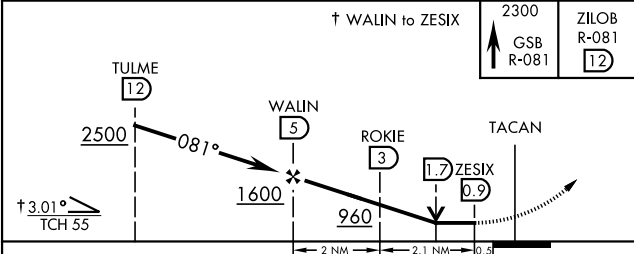

ELEV 109 TDZE 73

The diagram shows the flight path from TACAN to ZILOB (12) to TWR. It includes altitudes of 11,760 and 300, and a 0.3% UP climb. The diagram also shows the location of Seymour Johnson AFB and the Goldsboro VORTAC.

CATEGORY	A	B	C	D	E
S-8 *	540/24 467 (500-1/2)		540/50 467 (500-1)		
CIRCLING **	580-1 471 (500-1)	600-1 491 (500-1)	680-1 1/2 571 (600-1 1/2)	740-2 631 (700-2)	740-2 1/4 631 (700-2 1/4)

HIRL Rwy 8-26

GOLDSBORO, NORTH CAROLINA

35°20'N-77°58'W

SEYMOUR JOHNSON AFB (KGSB)

Amdt 8 03NOV22

TACAN Y RWY 8

SE-2, 04 SEP 2025 to 02 OCT 2025

SE-2, 04 SEP 2025 to 02 OCT 2025