


WICHITA FALLS, TEXAS

HI-TACAN RWY 33L


TACAN Chan 45	APCH CRS 334°	Rwy ldg 13,100 TDZE 1000 Arpt Elev 1019	[USAF]	SHEPPARD AFB/WICHITA FALLS MUNI (KSPS)	
* When ALS inop, increase CAT CDE vis to 1½ miles. ** Circling not authorized W of Rwy 15R-33L.			MALSR A5	MISSED APPROACH: Climb and maintain 3300, intercept SHP TACAN R-335 to SHP R-335/9 DME (MEDSE) and hold.	
ATIS★ 132.05 269.9	APP CON 118.2 269.025	TOWER★ 119.75 0 279.525 (CTAF)	GND CON 125.5 289.4	CLNC DEL 121.2 282.225	ASR

CAUTION: Do not confuse parallel taxiway with Rwy 15R-33L.

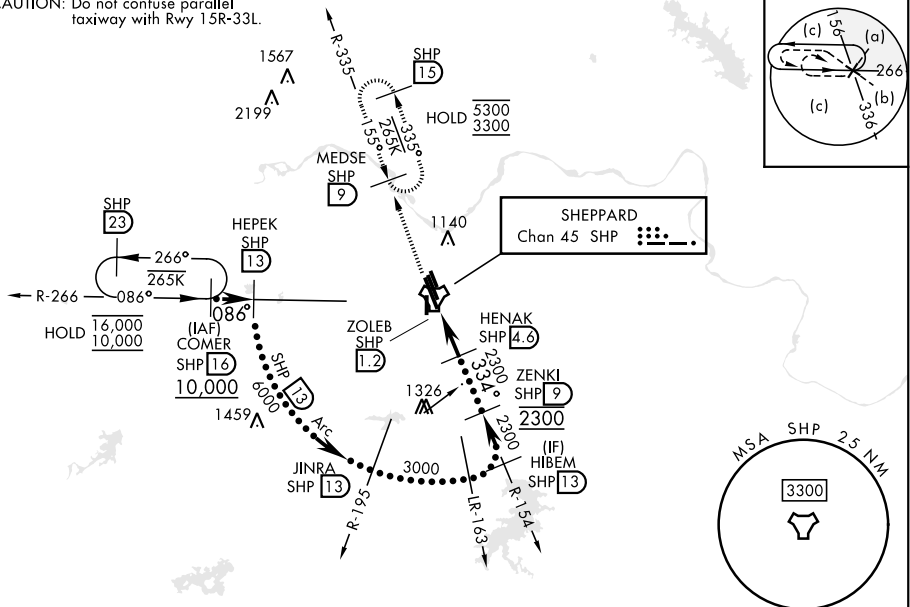

EMERG SAFE ALT 100 NM 4600

3300 ↑ SHP R-335	MEDSE SHP 9	VGSI and descent angles not coincident.		
CATEGORY	C	D	E	
S-33L *	1420-¾	420	(500-¾)	
CIRCLING**	1480-1½ 461 (500-1½)	2100-3	1081	(1100-3)

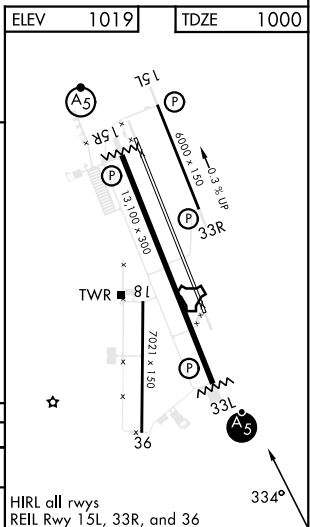

WICHITA FALLS, TEXAS

33°59'N-98°30'W

SHEPPARD AFB/WICHITA FALLS MUNI (KSPS)

Amtd 6 23JAN25

HI-TACAN RWY 33L

SC-2, 04 SEP 2025 to 02 OCT 2025